US00RE37784E

(19) **United States**

(12) **Reissued Patent**

Fitzgibbon et al.

(10) **Patent Number: US RE37,784 E**

(45) **Date of Reissued Patent: Jul. 9, 2002**

(54) **BARRIER OPERATOR HAVING SYSTEM FOR DETECTING ATTEMPTED FORCED ENTRY**

(75) Inventors: **James J. Fitzgibbon**, Batavia, IL (US); **John V. Moravec**, Egg Harbor, WI (US)

(73) Assignee: **The Chamberlain Group, Inc.**, Elmhurst, IL (US)

(21) Appl. No.: **09/614,222**

(22) Filed: **Jul. 11, 2000**

Related U.S. Patent Documents

Reissue of:

(64) Patent No.: **5,780,987**
Issued: **Jul. 14, 1998**
Appl. No.: **08/888,836**
Filed: **Jul. 7, 1997**

U.S. Applications:

(63) Continuation of application No. 08/443,178, filed on May 17, 1995, now abandoned.

(51) **Int. Cl.**[7] **E05F 15/10**

(52) **U.S. Cl.** **318/466**; 318/16; 318/286; 318/468; 318/480; 318/563; 318/565

(58) **Field of Search** 318/16, 286, 466, 318/467, 468, 469, 480, 452, 563, 565, 566, 264, 265, 266; 49/25, 26

(56) **References Cited**

U.S. PATENT DOCUMENTS

4,021,796	A	*	5/1977	Fawcett, Jr. et al.	
4,035,702	A	*	7/1977	Pettersen et al.	318/285
4,048,630	A	*	9/1977	Deming et al.	
4,247,806	A	*	1/1981	Mercier	318/267
4,274,227	A	*	6/1981	Toenjes	49/28
4,328,540	A	*	5/1982	Matsuoka et al.	318/266 X
4,338,553	A	*	7/1982	Scott, Jr.	318/266
4,357,564	A	*	11/1982	Deming et al.	318/282
4,360,801	A	*	11/1982	Duhame	318/16
4,383,206	A	*	5/1983	Matsuoka et al.	318/445
4,386,398	A	*	5/1983	Matsuoka et al.	318/266 X
4,404,558	A	*	9/1983	Yen	318/466 X
4,581,606	A	*	4/1986	Mallory	
4,638,292	A	*	1/1987	Mochida et al.	
4,638,433	A	*	1/1987	Schindler	364/400
4,750,197	A	*	6/1988	Denekamp et al.	
4,847,542	A	*	7/1989	Clark et al.	318/560
4,916,860	A		4/1990	Richmond et al.	49/28
4,939,434	A	*	7/1990	Elson	318/285
5,076,012	A		12/1991	Richmond et al.	49/28
RE33,873	E	*	4/1992	Romano	318/466 X
5,136,809	A		8/1992	Richmond et al.	49/28
5,230,179	A		7/1993	Richmond et al.	49/28
5,247,232	A	*	9/1993	Lin	318/468
5,285,136	A	*	2/1994	Duhame	318/266
5,444,440	A	*	8/1995	Heydendahl	340/825.32
5,510,686	A	*	4/1996	Collier	318/446
5,684,372	A		11/1997	Fitzgibbon et al.	318/280
5,841,253	A		11/1998	Fitzgibbon et al.	318/280
5,998,950	A		12/1999	Fitzgibbon et al.	318/280

* cited by examiner

Primary Examiner—Bentsu Ro

(74) *Attorney, Agent, or Firm*—Fitch, Even, Tabin & Flannery

(57) **ABSTRACT**

A movable barrier or garage door operator has a barrier drive for moving the movable barrier or garage door between open and closed positions. Motion of the barrier is detected by a tachometer connected to the barrier drive or by upper and lower barrier travel limit switches. A test is made to determine if the barrier has been commanded to be in a closed state and to determine if a preselected time interval has elapsed following closure of the barrier. When both of those conditions are present and the door is moved upward without authorization an alarm signal is generated and can signal the barrier drive to apply a closing force. The timer prevents the barrier from being closed on a person or obstacle during normal operation and prevents injury. An obstacle detector also prevents unwanted closure on an obstacle.

41 Claims, 14 Drawing Sheets

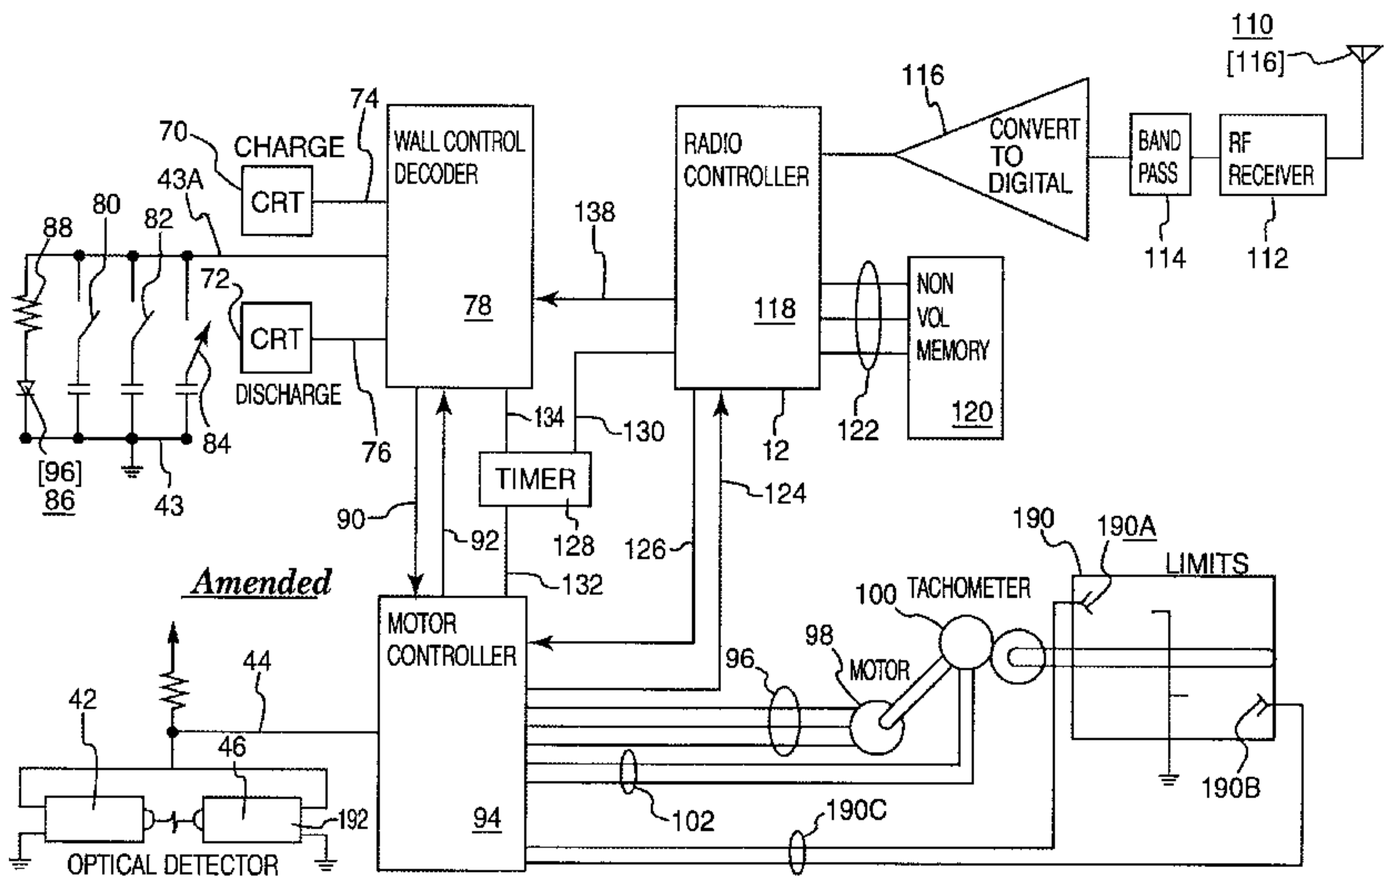

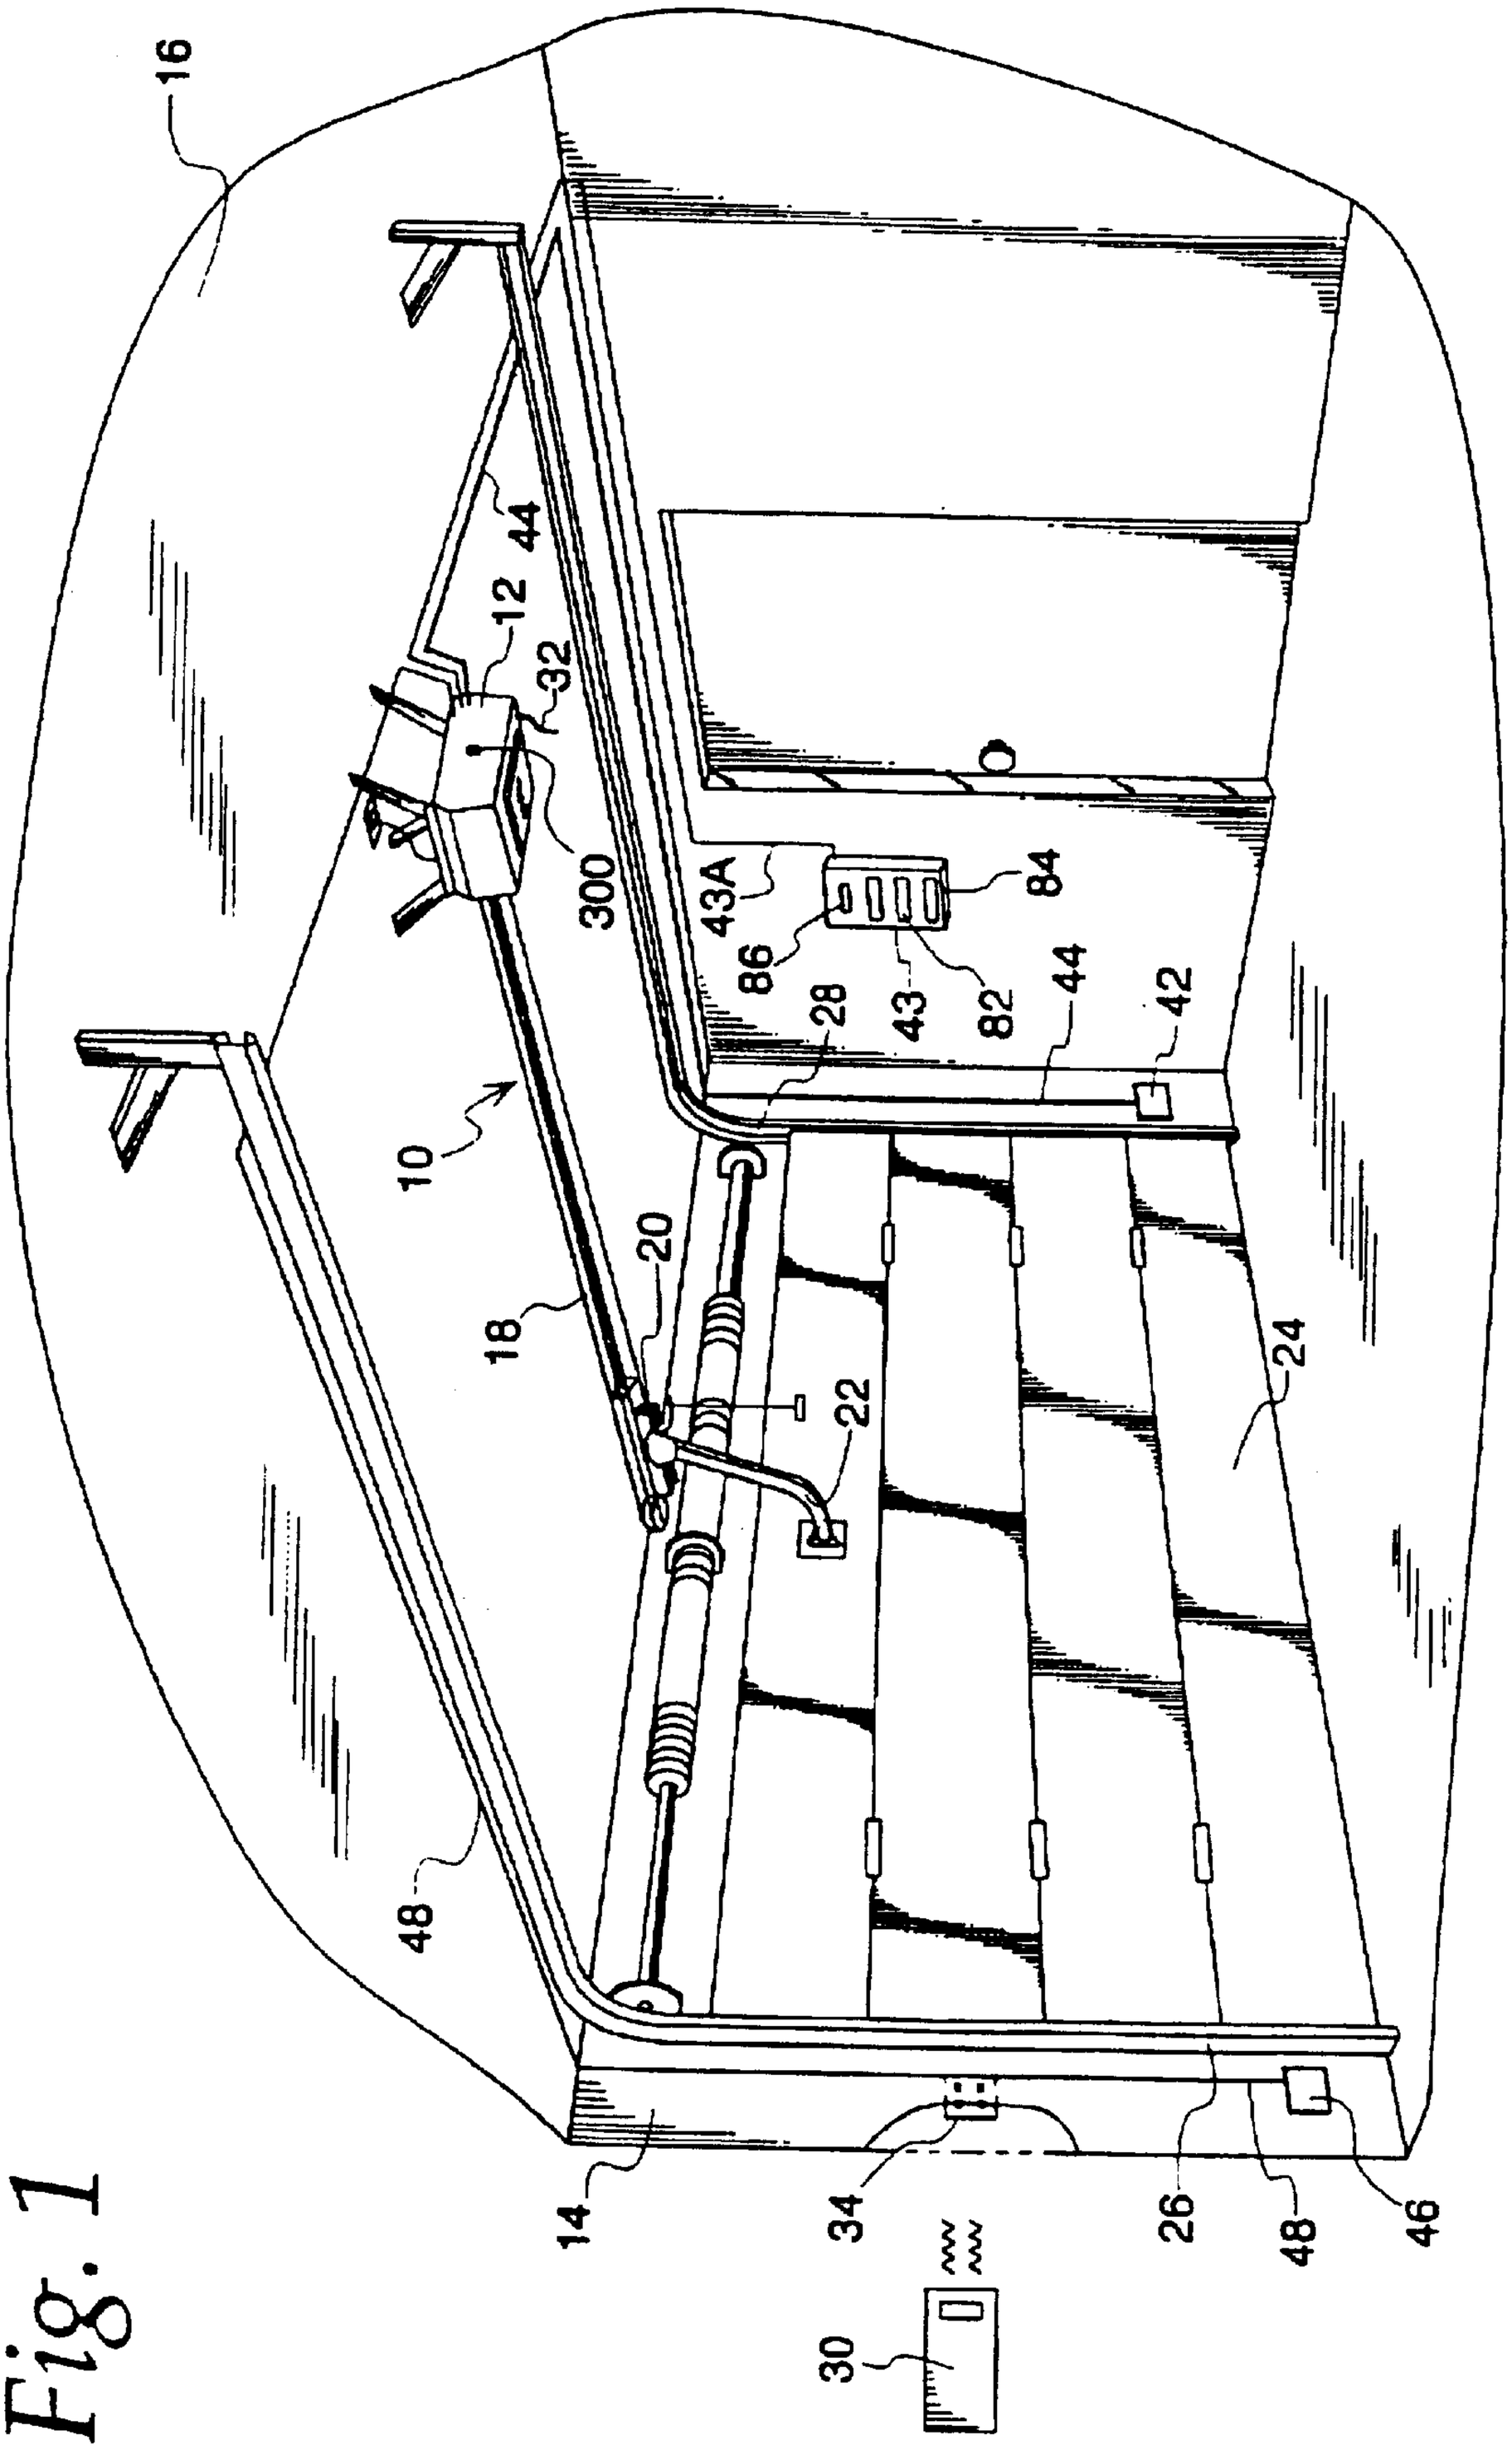
16
44
12
32
300
43A
84
86
28
43
82
44
42
10
20
18
22
24
48
14
34
26
48
46
30

Fig. 1

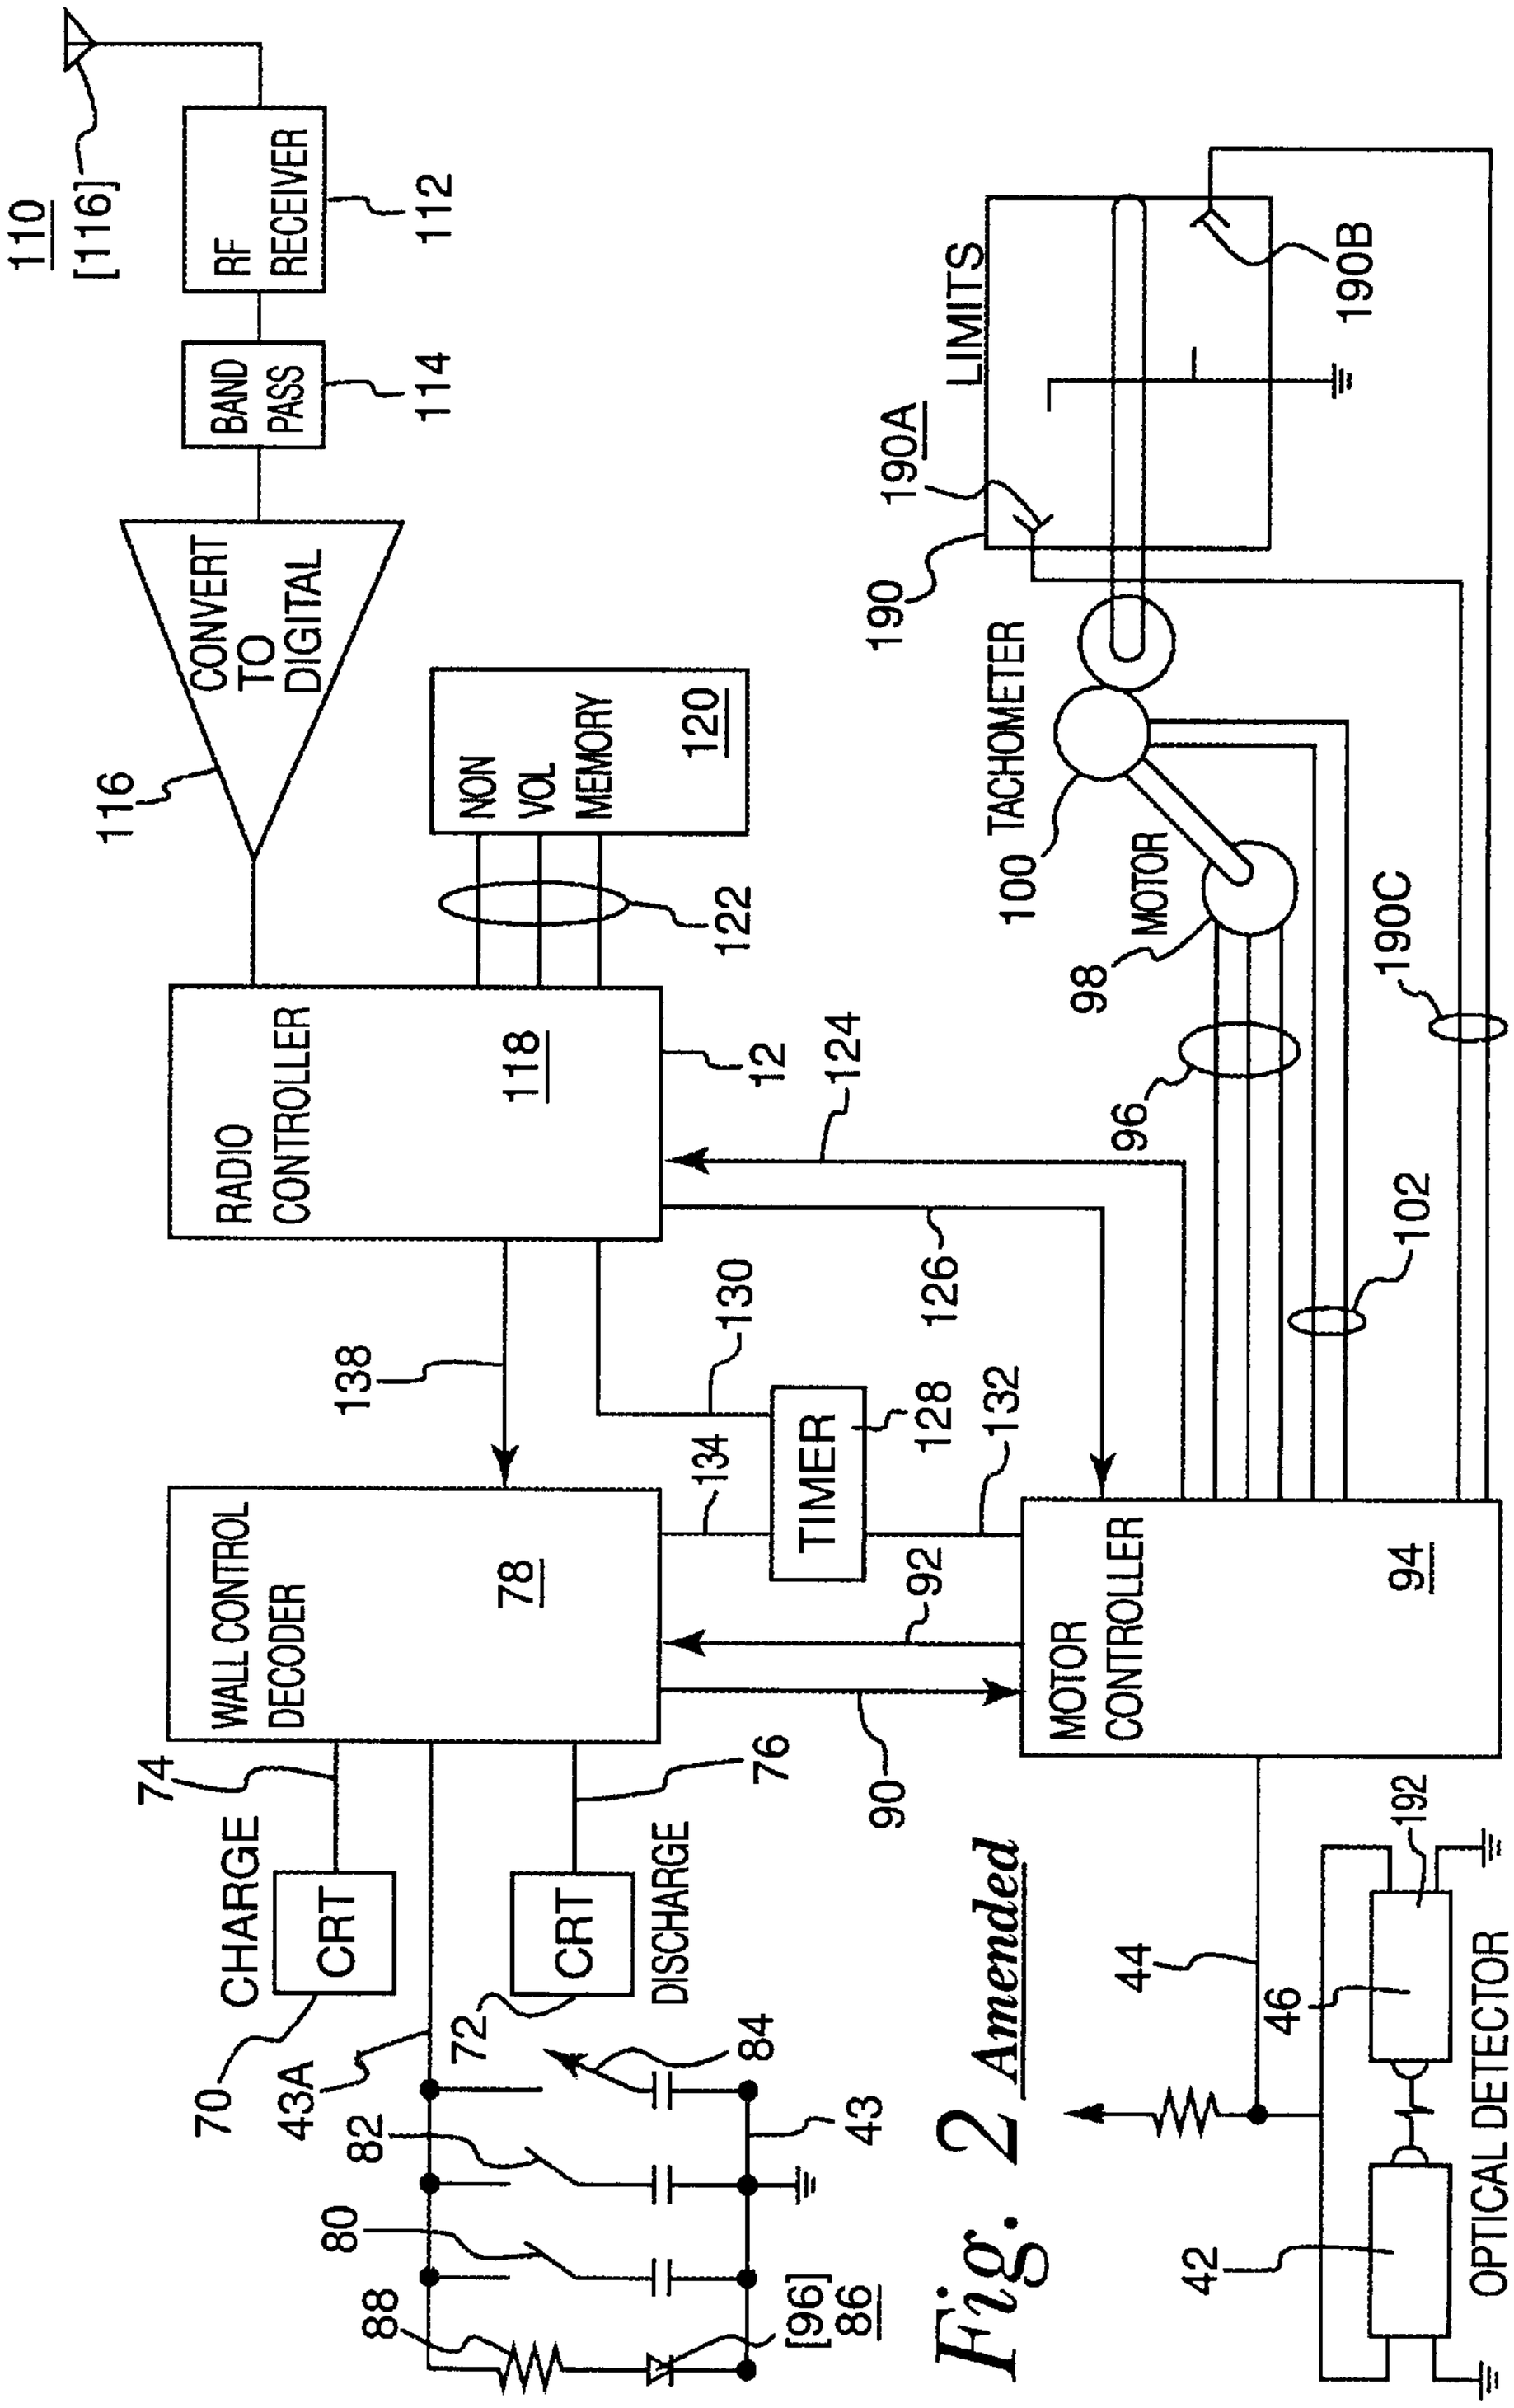

Fig. 2 Amended

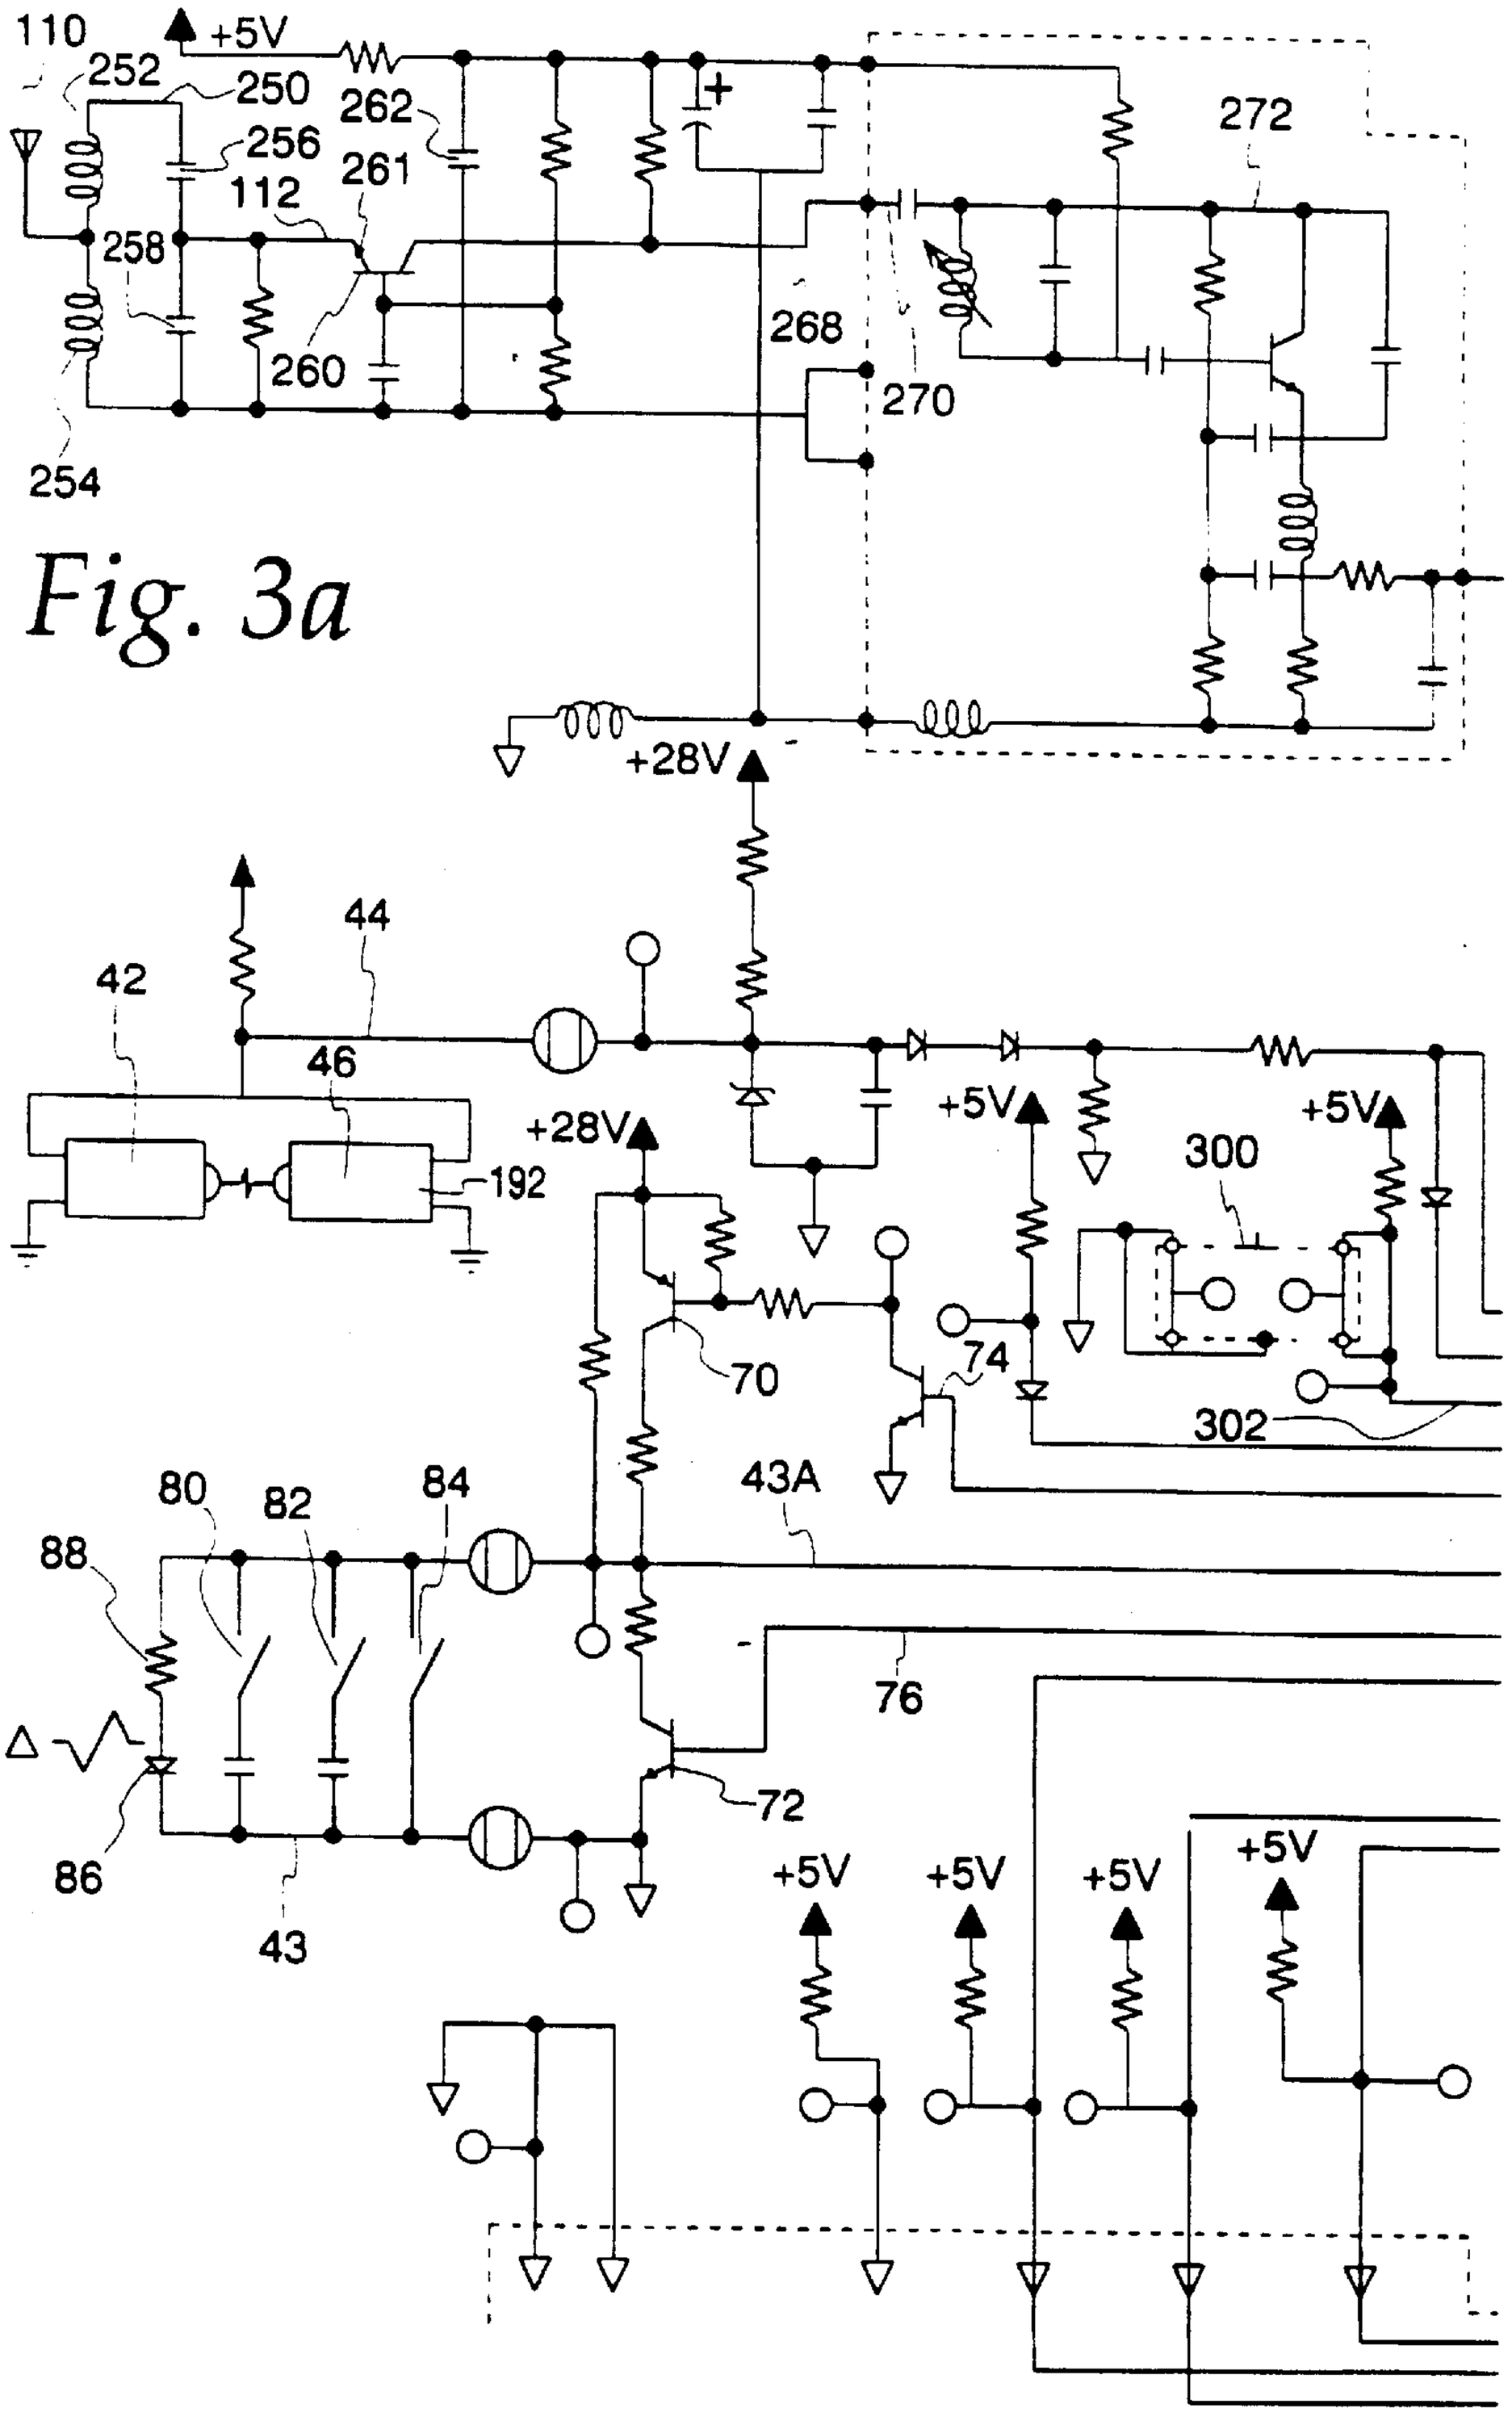
110
+5V
252
250
262
256
261
112
258
260
254
268
270
272
+28V
44
42
46
192
+28V
+5V
+5V
300
70
74
302
80
82
84
43A
88
86
43
76
72
+5V
+5V
+5V
+5V

Fig. 3a

Fig. 3b
Amended

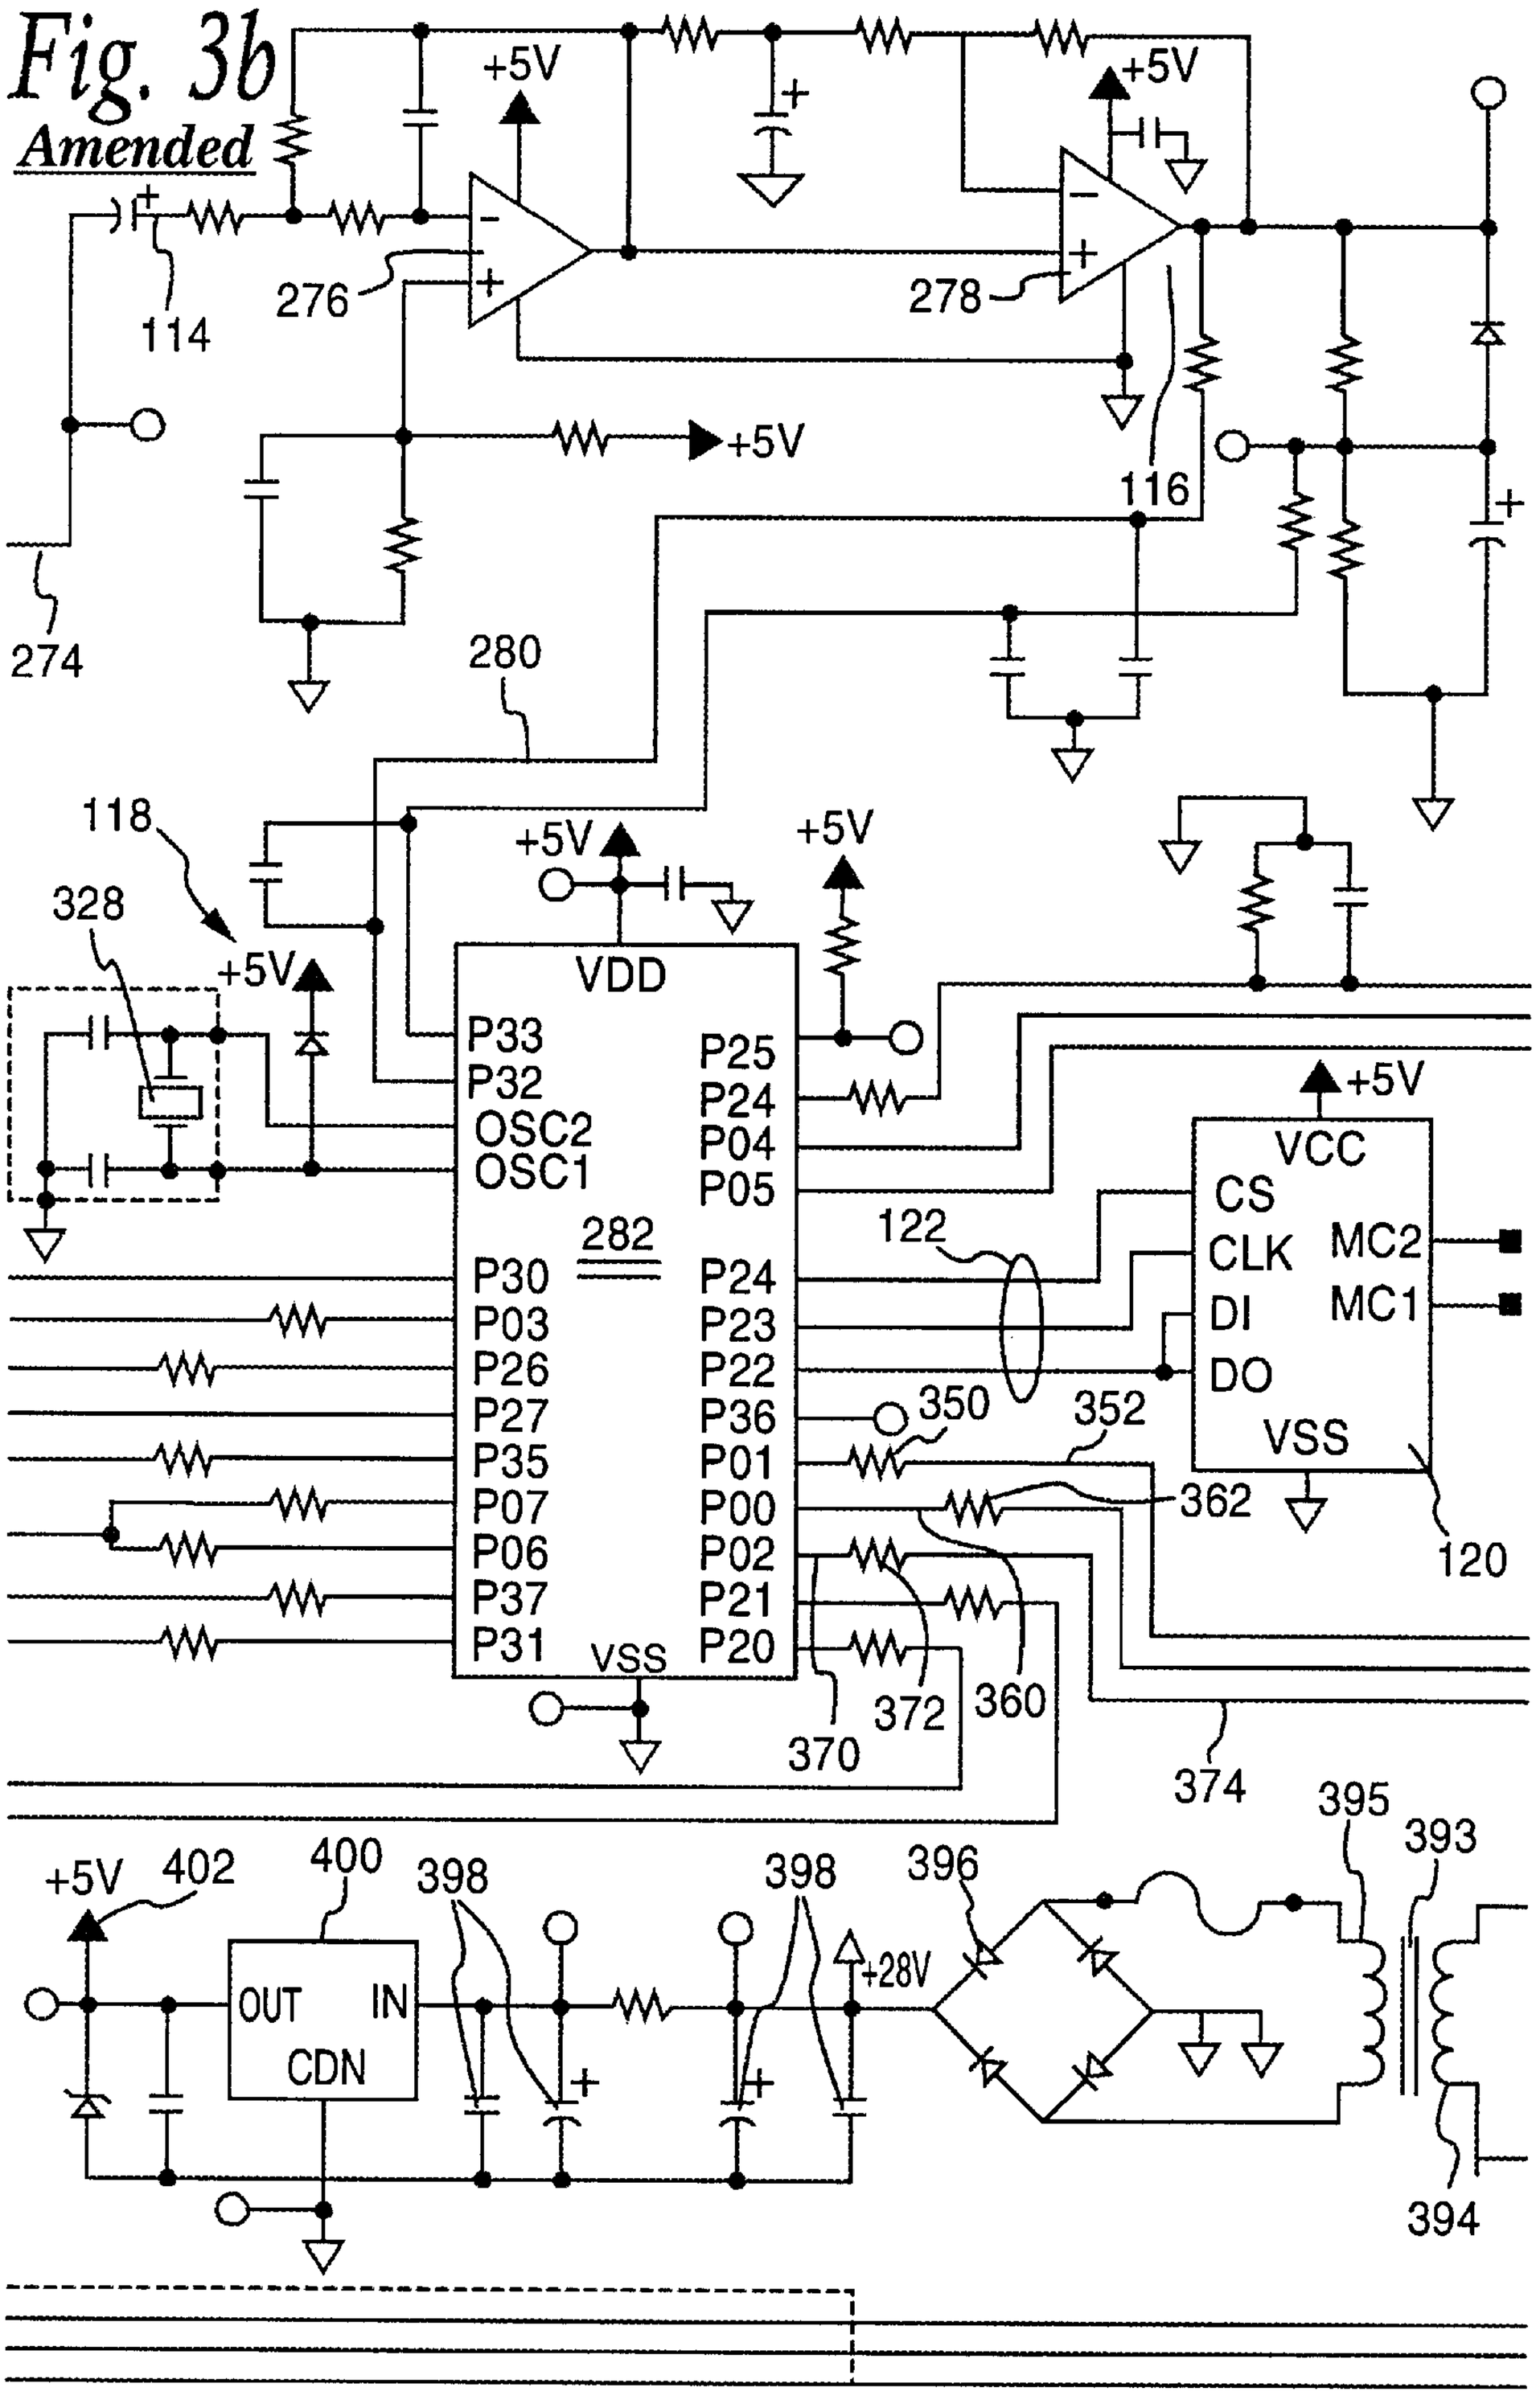

Fig. 3a	Fig. 3b	Fig. 3c

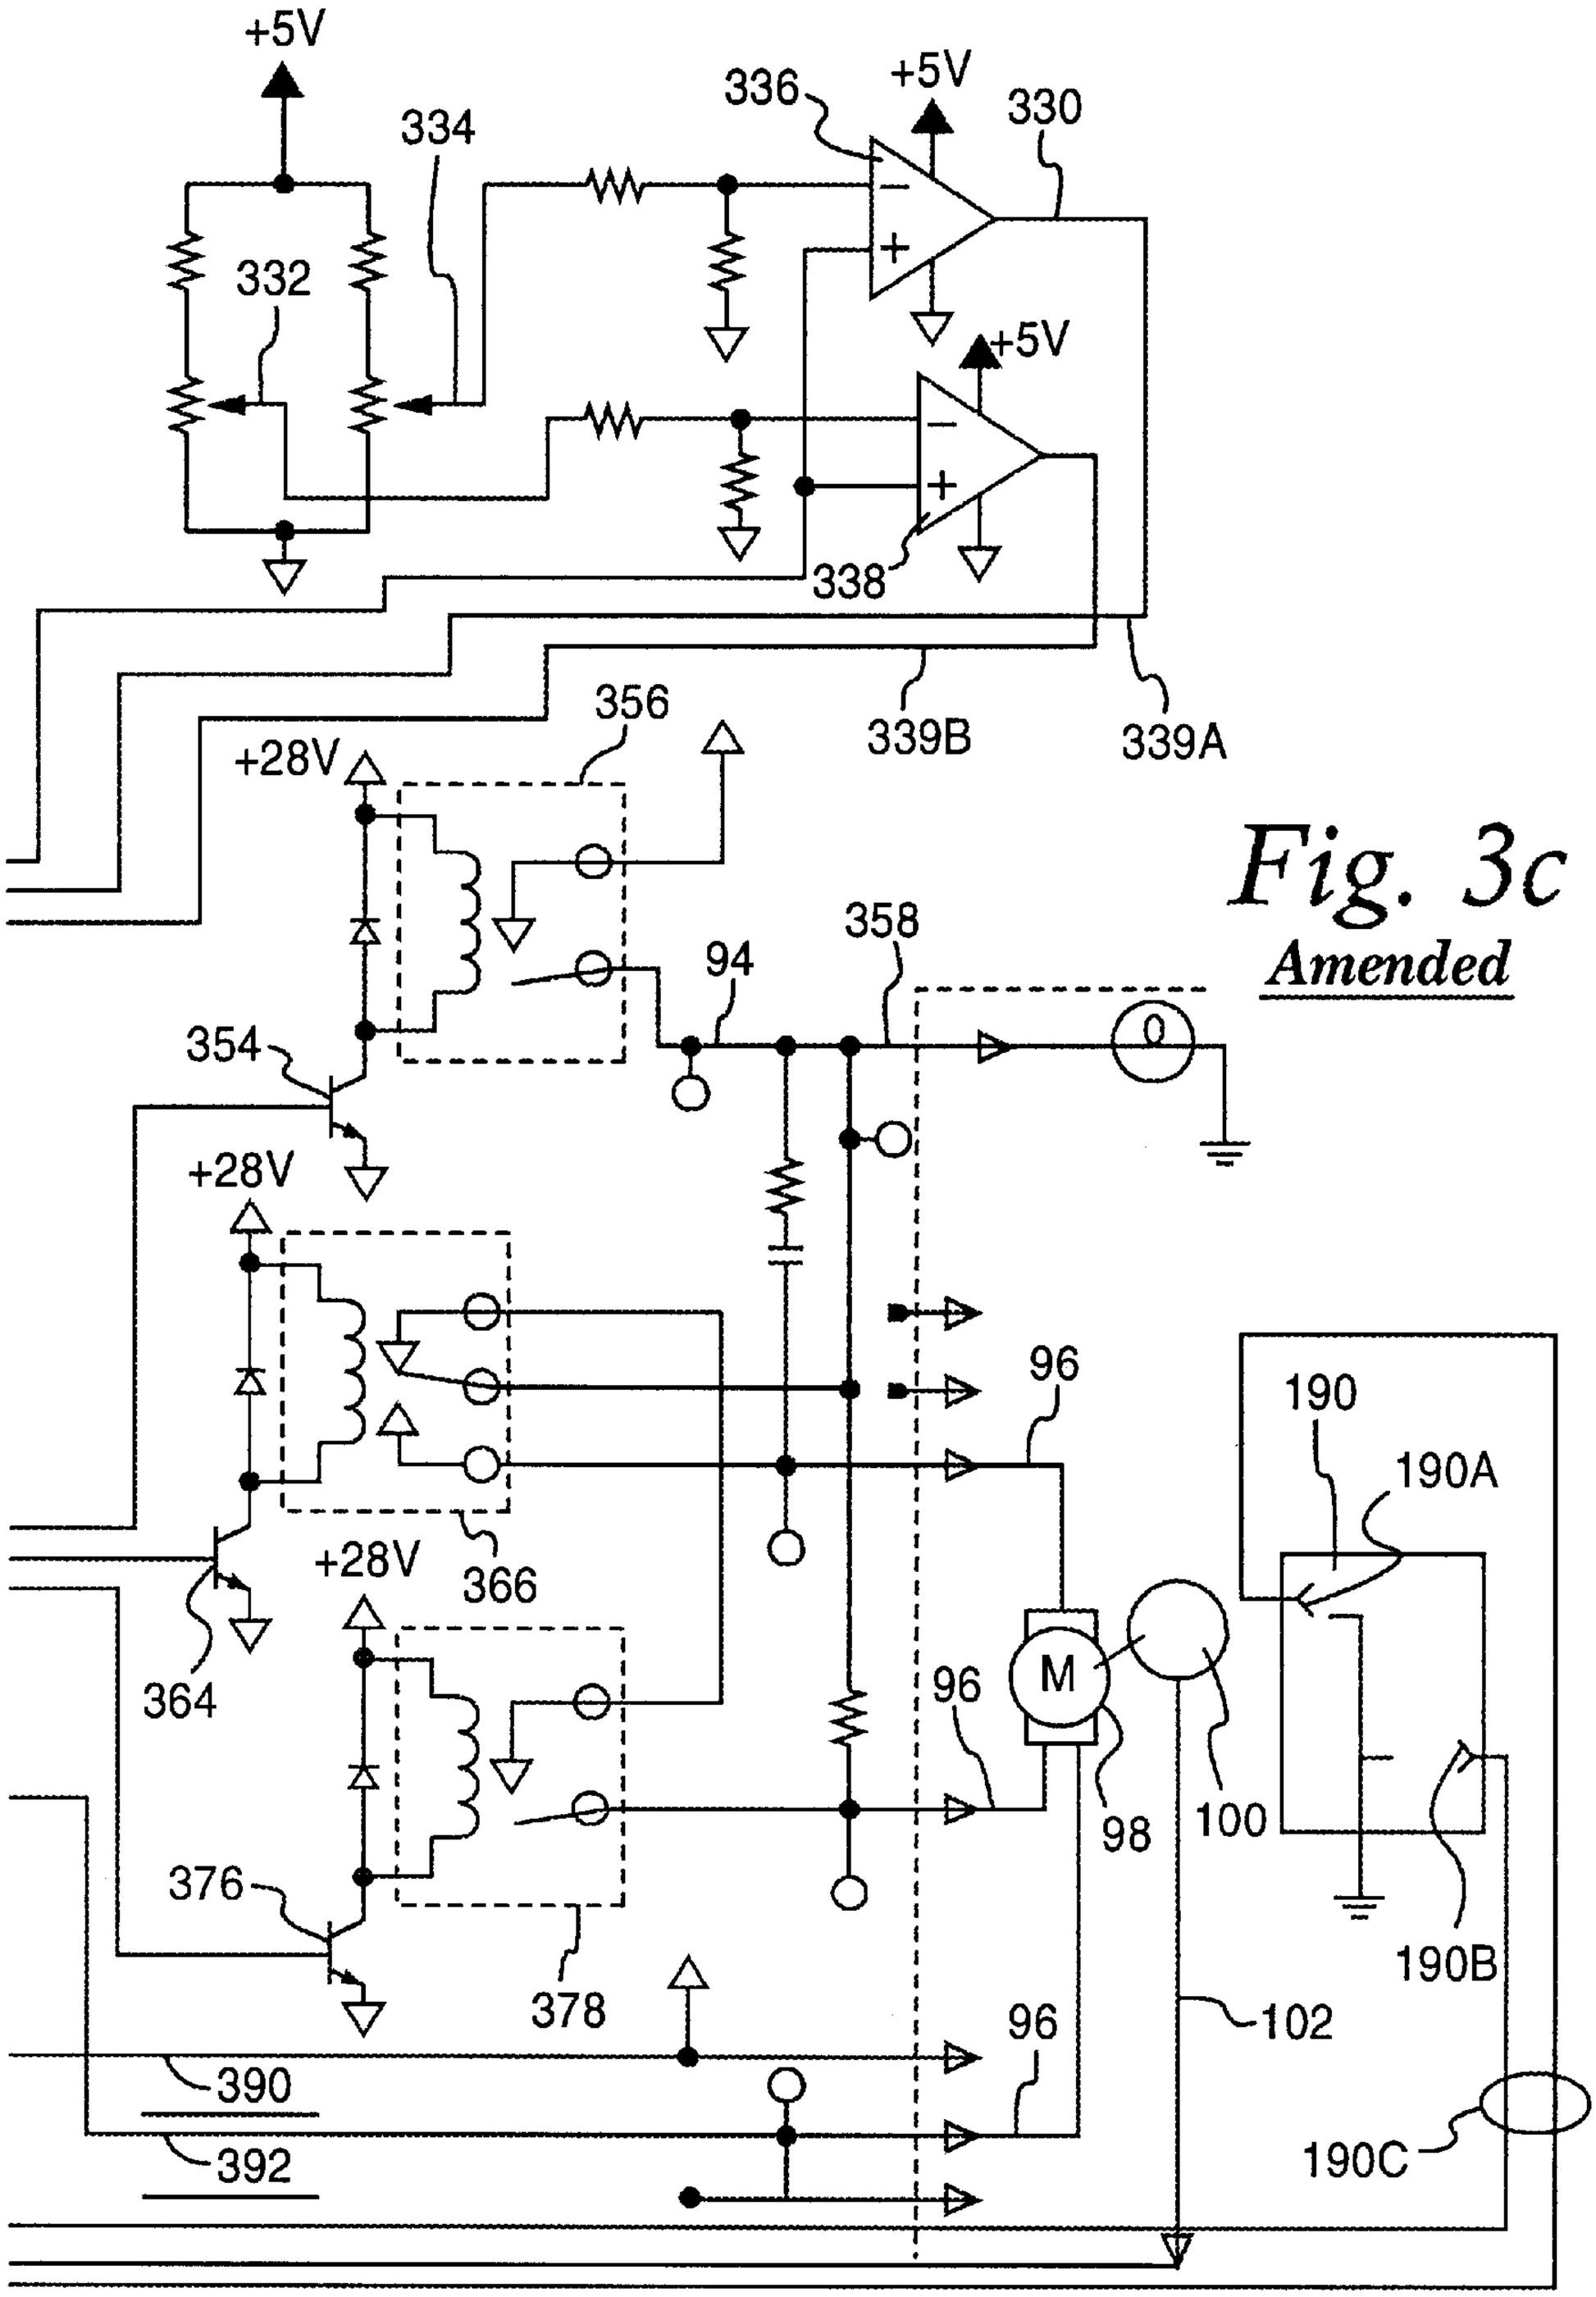

Fig. 3c
Amended

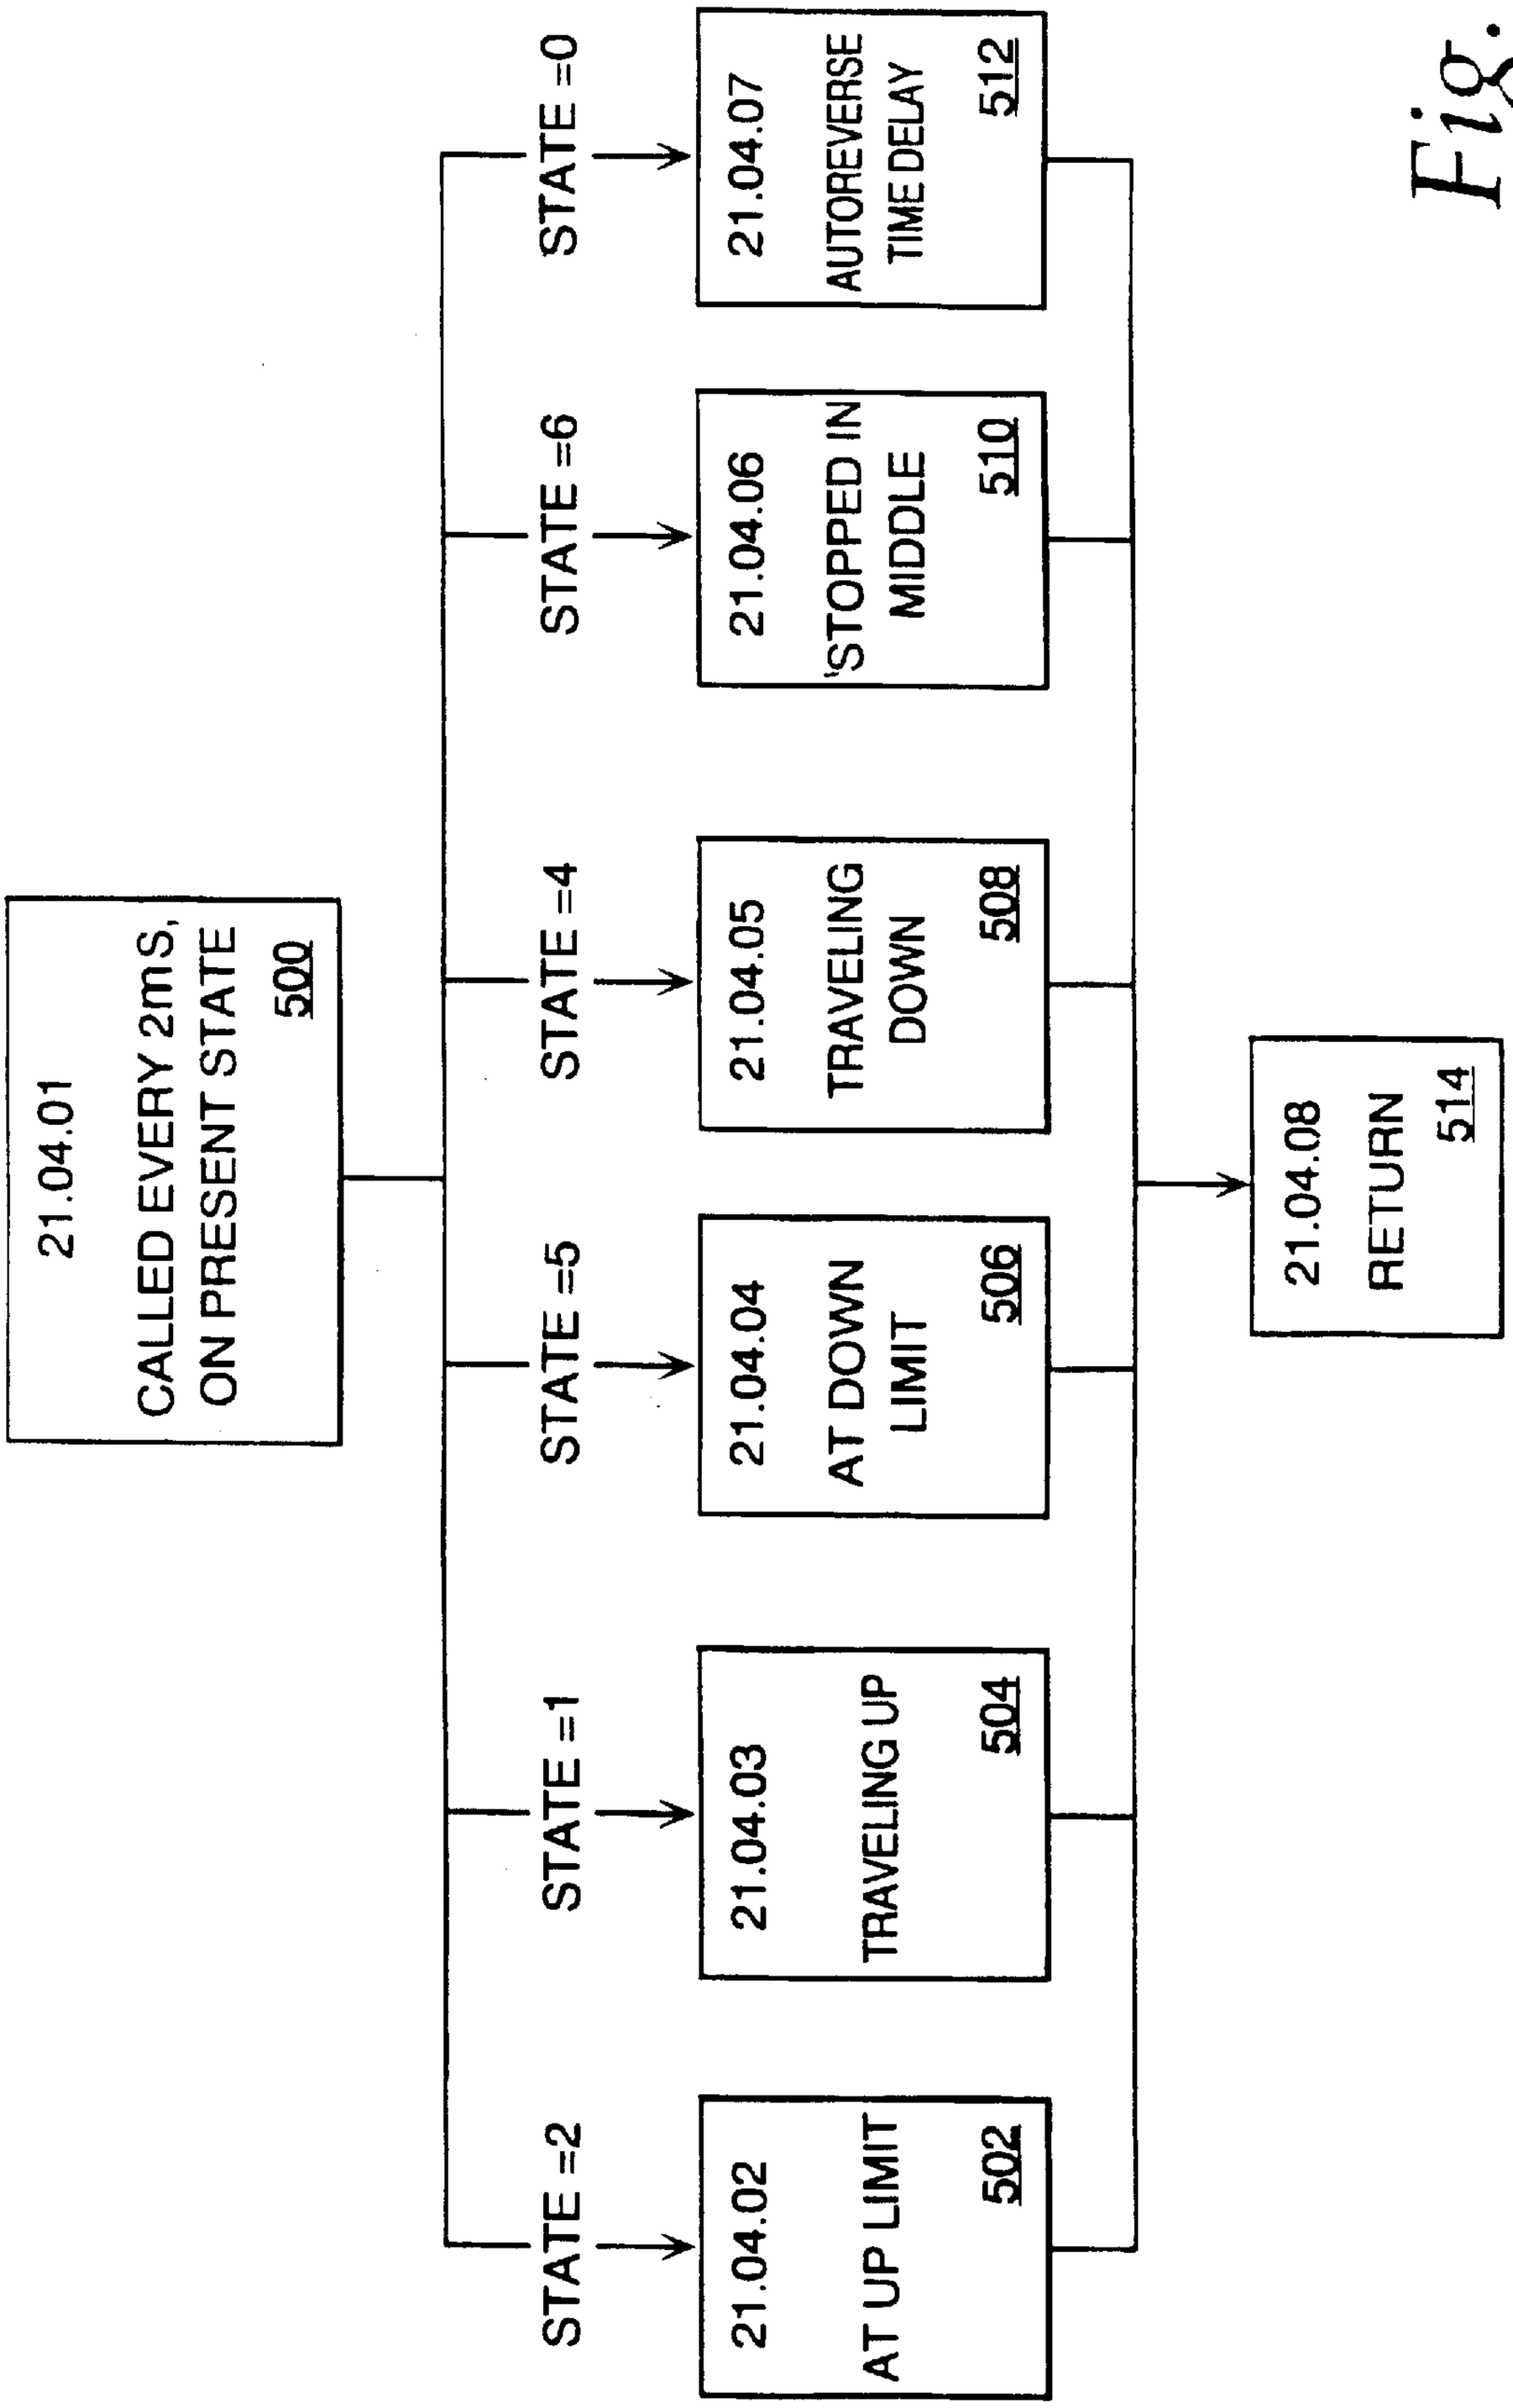
21.04.01
CALLED EVERY 2mS, ON PRESENT STATE
500
STATE =0
21.04.07
AUTOREVERSE TIME DELAY
512
STATE =1
21.04.03
TRAVELING UP
504
STATE =2
21.04.02
AT UP LIMIT
502
STATE =4
21.04.05
TRAVELING DOWN
508
STATE =5
21.04.04
AT DOWN LIMIT
506
STATE =6
21.04.06
STOPPED IN MIDDLE
510
21.04.08
RETURN
514

Fig. 4

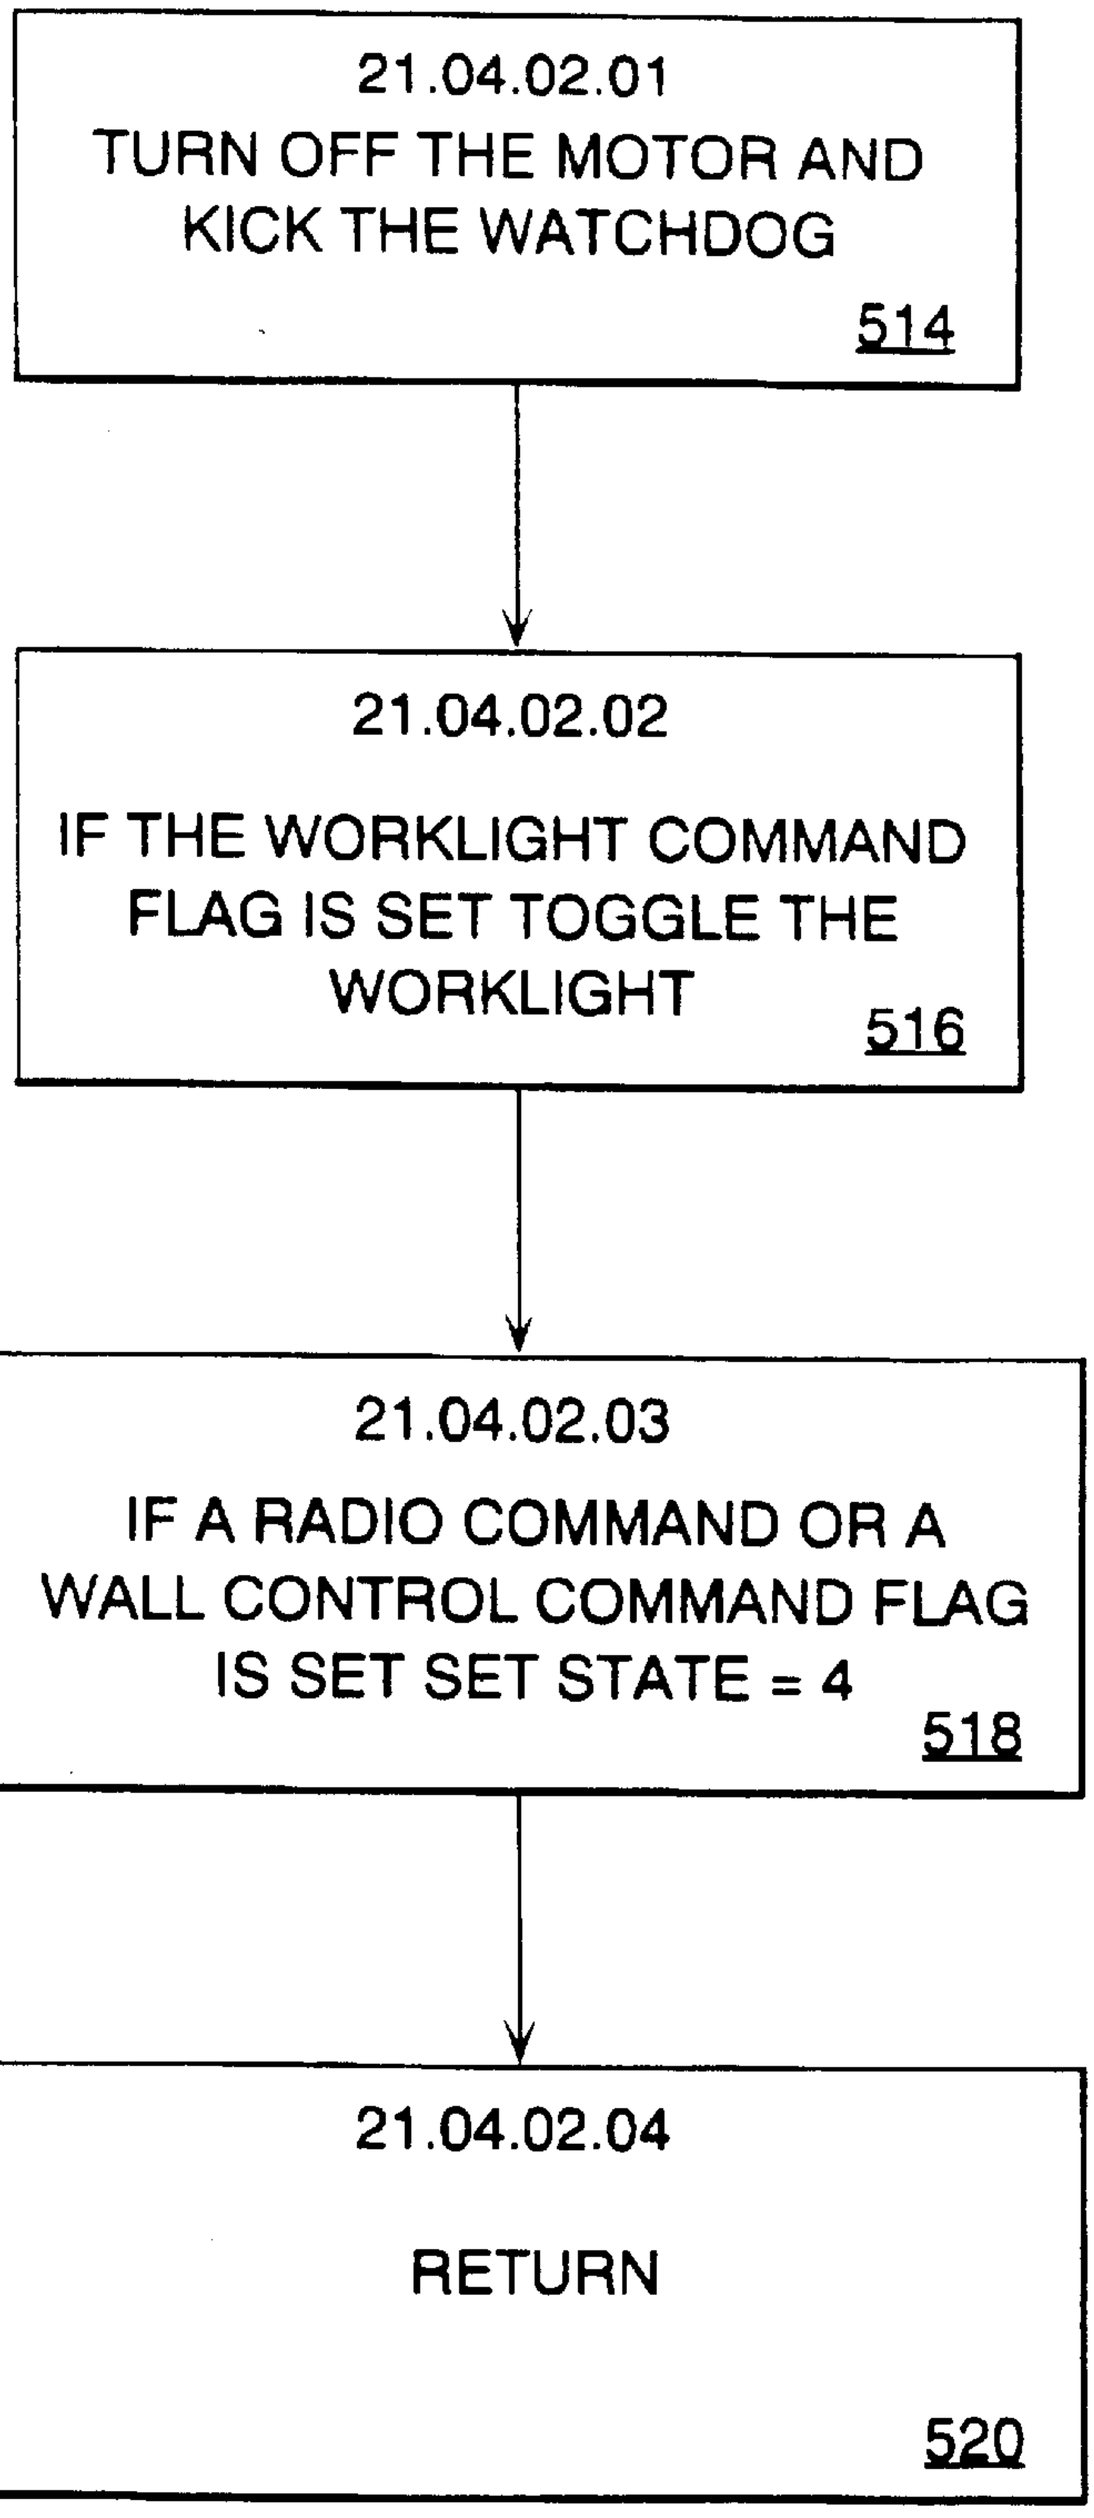
502
21.04.02.01
TURN OFF THE MOTOR AND KICK THE WATCHDOG
514
21.04.02.02
IF THE WORKLIGHT COMMAND FLAG IS SET TOGGLE THE WORKLIGHT
516
21.04.02.03
IF A RADIO COMMAND OR A WALL CONTROL COMMAND FLAG IS SET SET STATE = 4
518
21.04.02.04
RETURN
520

Fig. 5

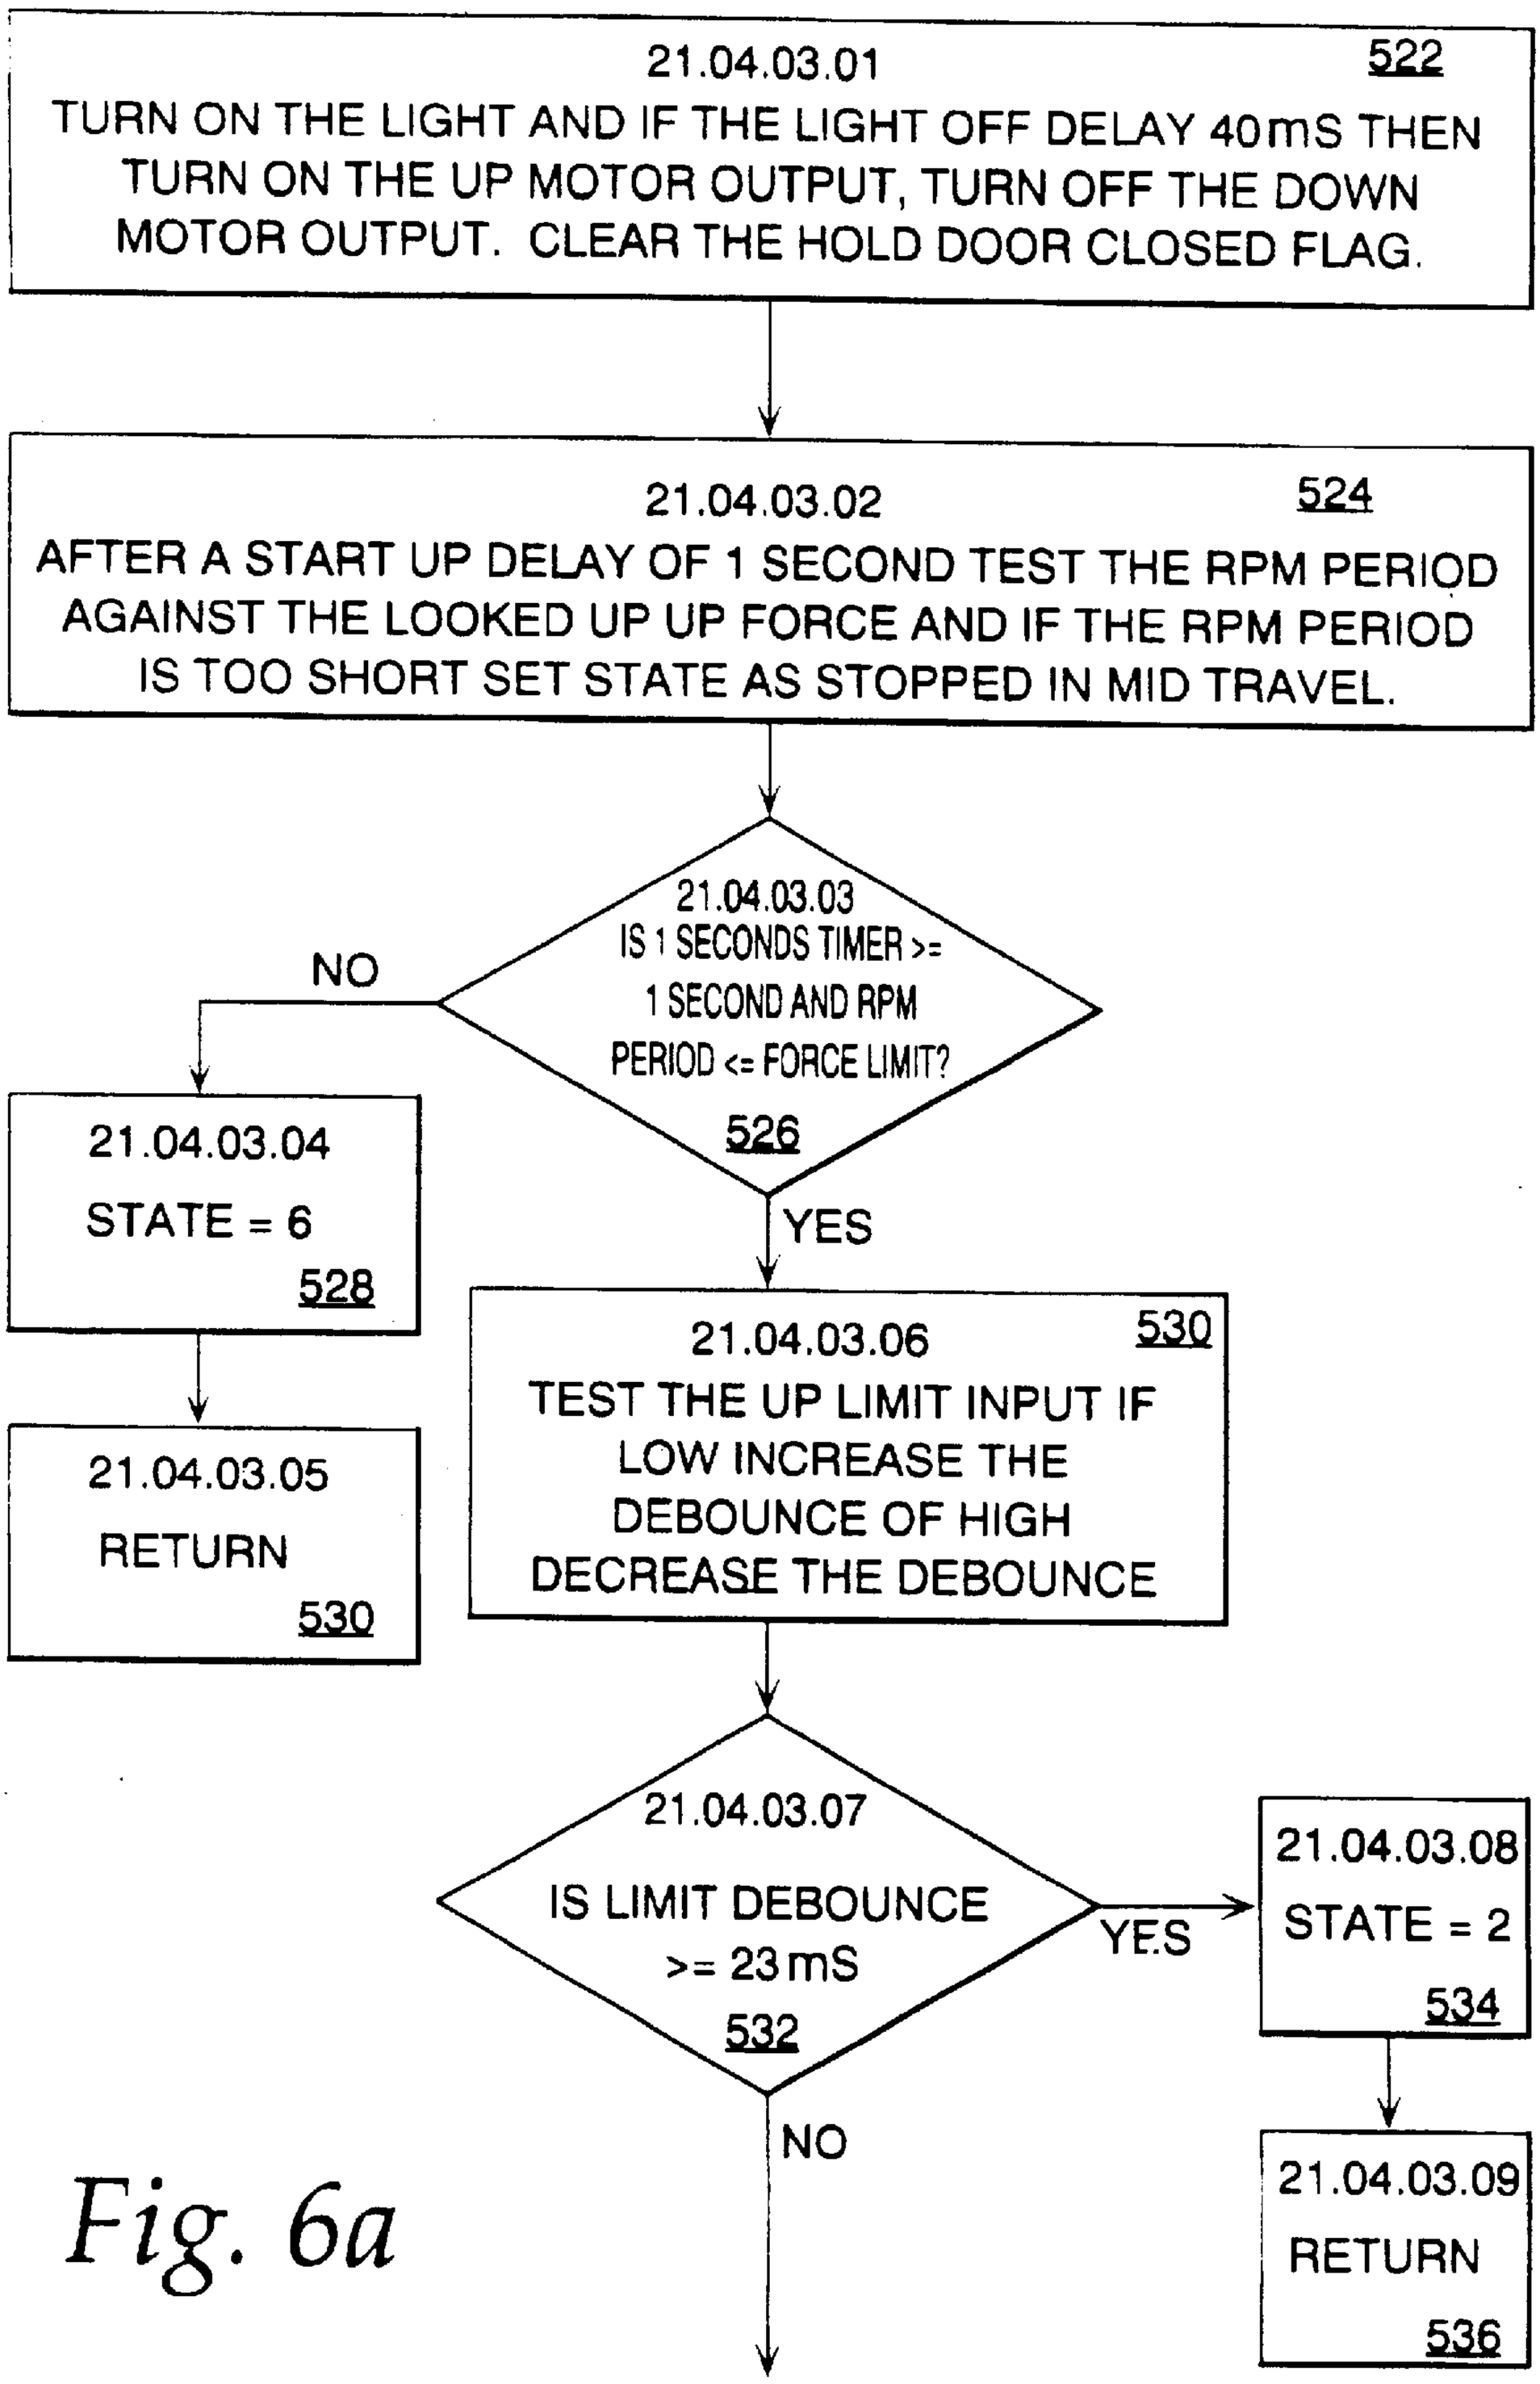
21.04.03.01
522
TURN ON THE LIGHT AND IF THE LIGHT OFF DELAY 40mS THEN TURN ON THE UP MOTOR OUTPUT, TURN OFF THE DOWN MOTOR OUTPUT. CLEAR THE HOLD DOOR CLOSED FLAG.
21.04.03.02
524
AFTER A START UP DELAY OF 1 SECOND TEST THE RPM PERIOD AGAINST THE LOOKED UP UP FORCE AND IF THE RPM PERIOD IS TOO SHORT SET STATE AS STOPPED IN MID TRAVEL.
21.04.03.03
IS 1 SECONDS TIMER >= 1 SECOND AND RPM PERIOD <= FORCE LIMIT?
526
NO
YES
21.04.03.04
STATE = 6
528
21.04.03.05
RETURN
530
21.04.03.06
530
TEST THE UP LIMIT INPUT IF LOW INCREASE THE DEBOUNCE OF HIGH DECREASE THE DEBOUNCE
21.04.03.07
IS LIMIT DEBOUNCE >= 23mS
532
YES
NO
21.04.03.08
STATE = 2
534
21.04.03.09
RETURN
536

Fig. 6a

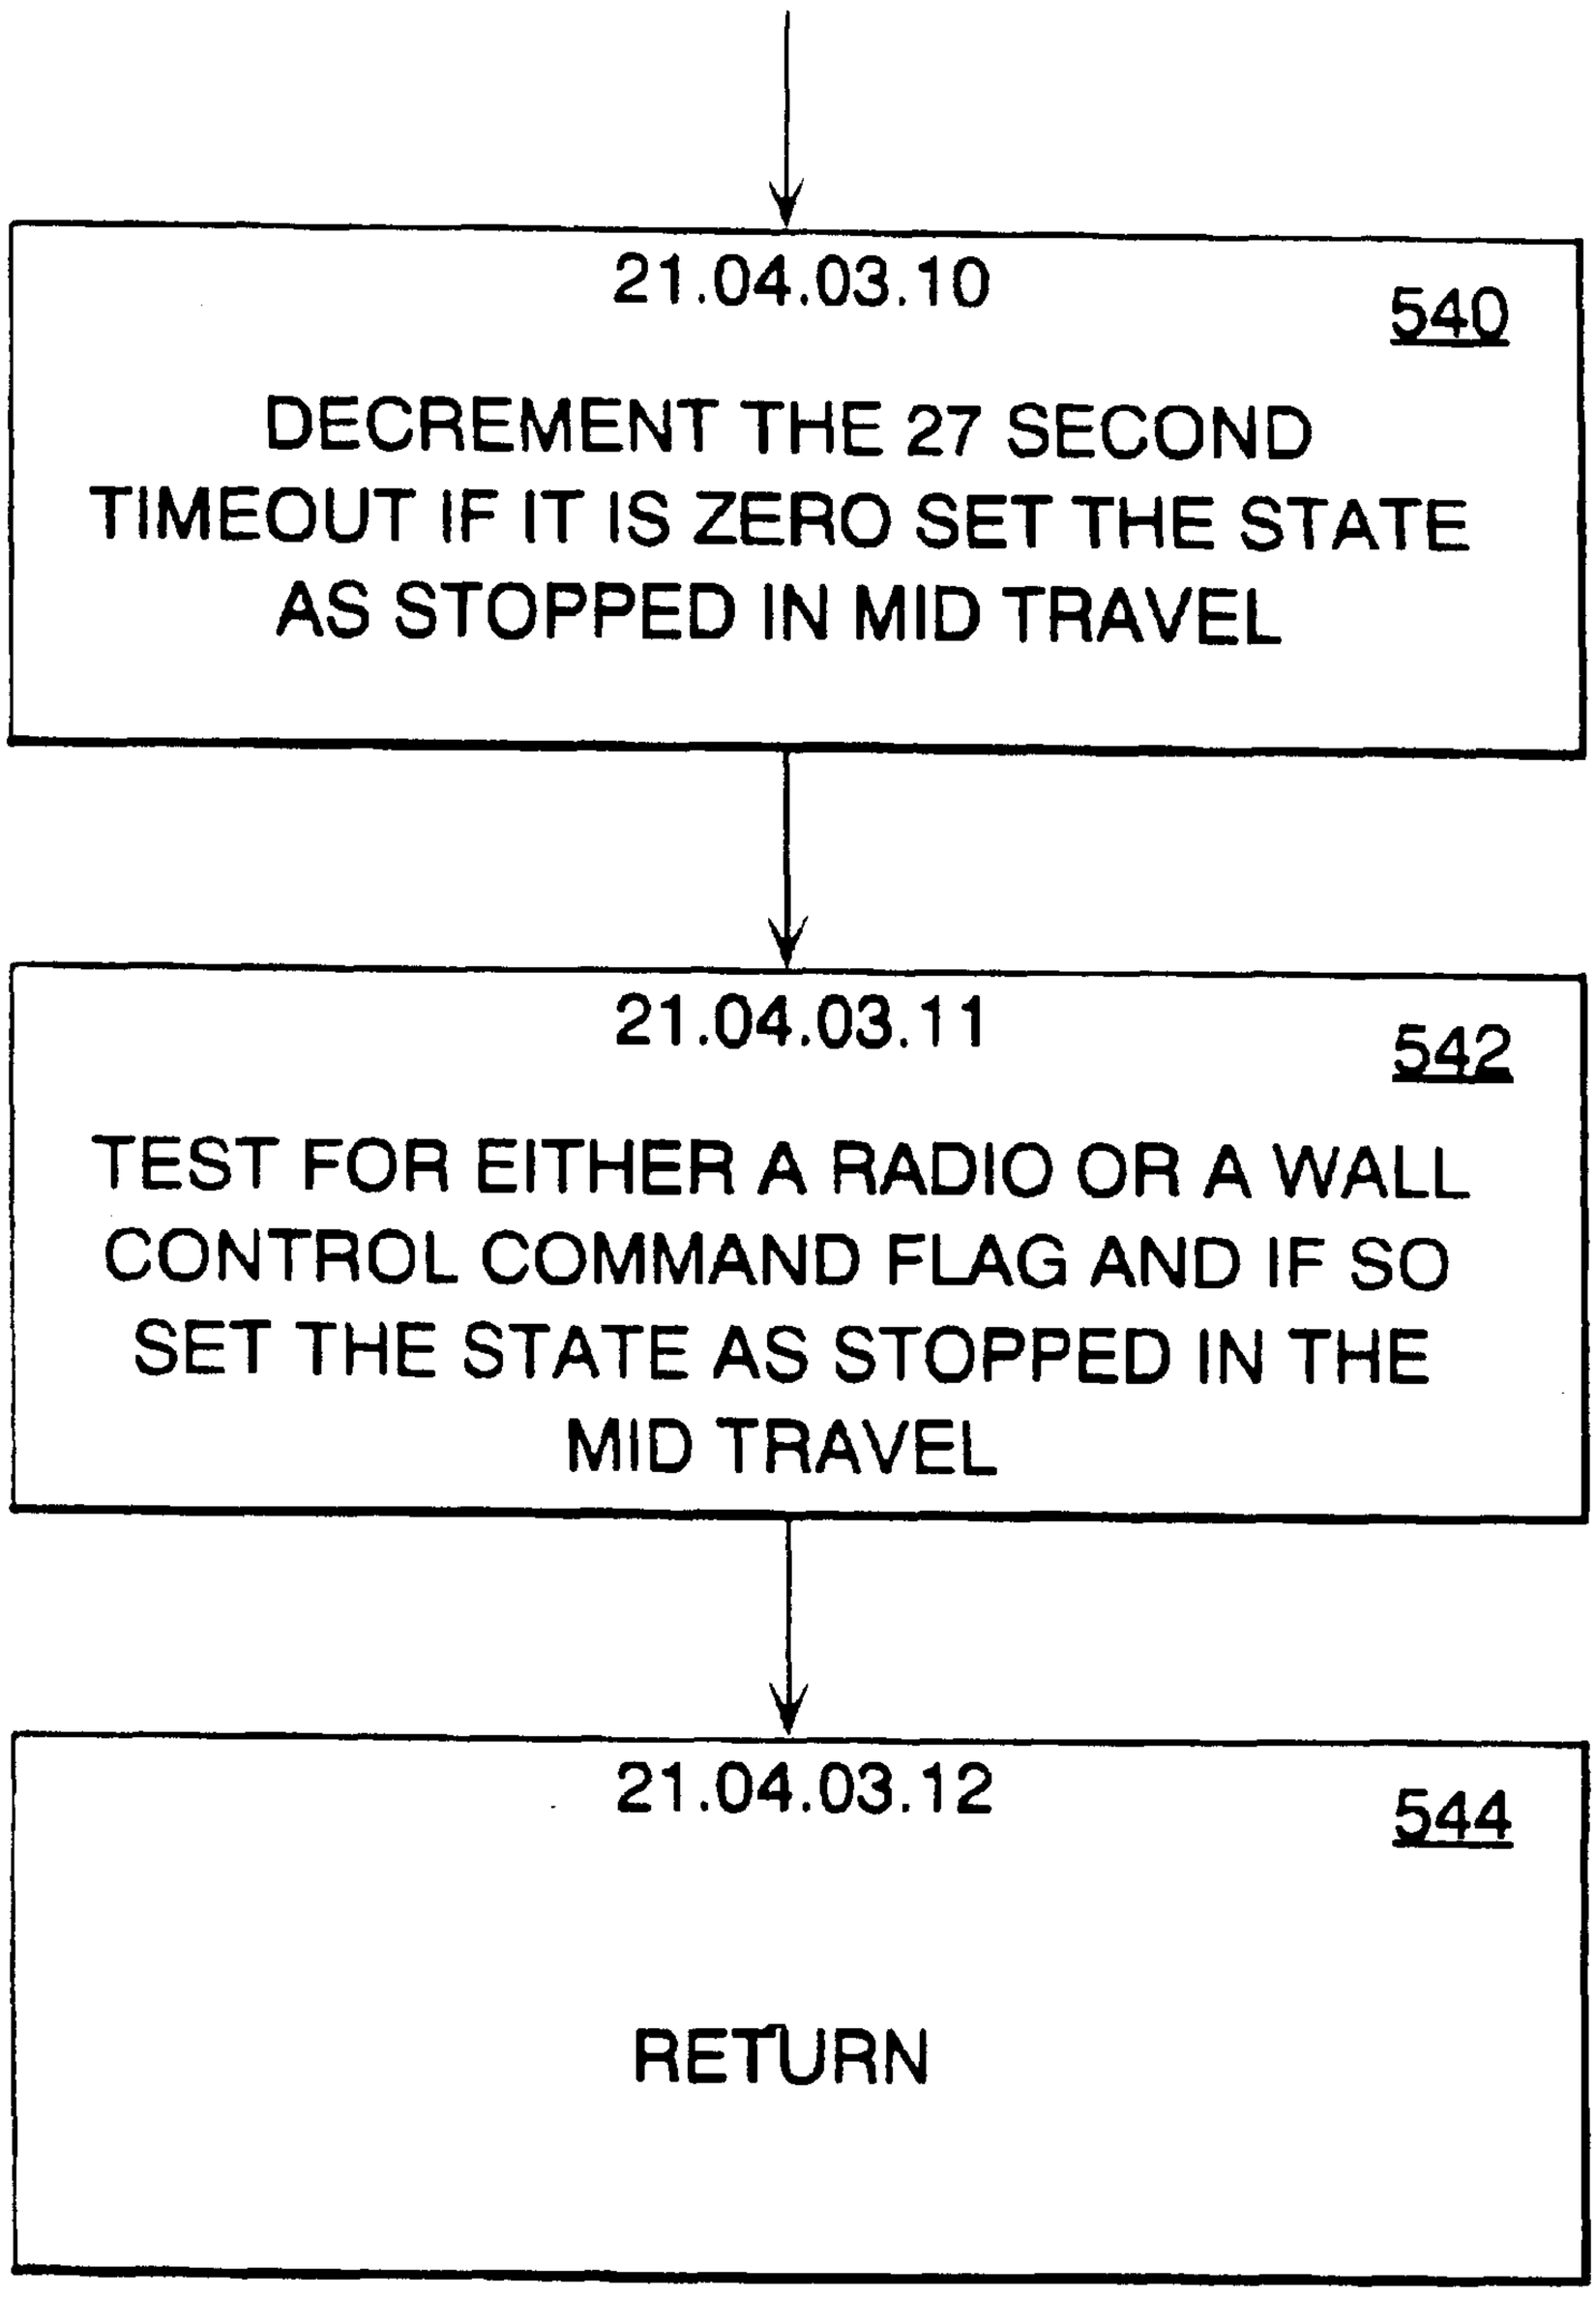
21.04.03.10
540
DECREMENT THE 27 SECOND TIMEOUT IF IT IS ZERO SET THE STATE AS STOPPED IN MID TRAVEL
21.04.03.11
542
TEST FOR EITHER A RADIO OR A WALL CONTROL COMMAND FLAG AND IF SO SET THE STATE AS STOPPED IN THE MID TRAVEL
21.04.03.12
544
RETURN

Fig. 6b

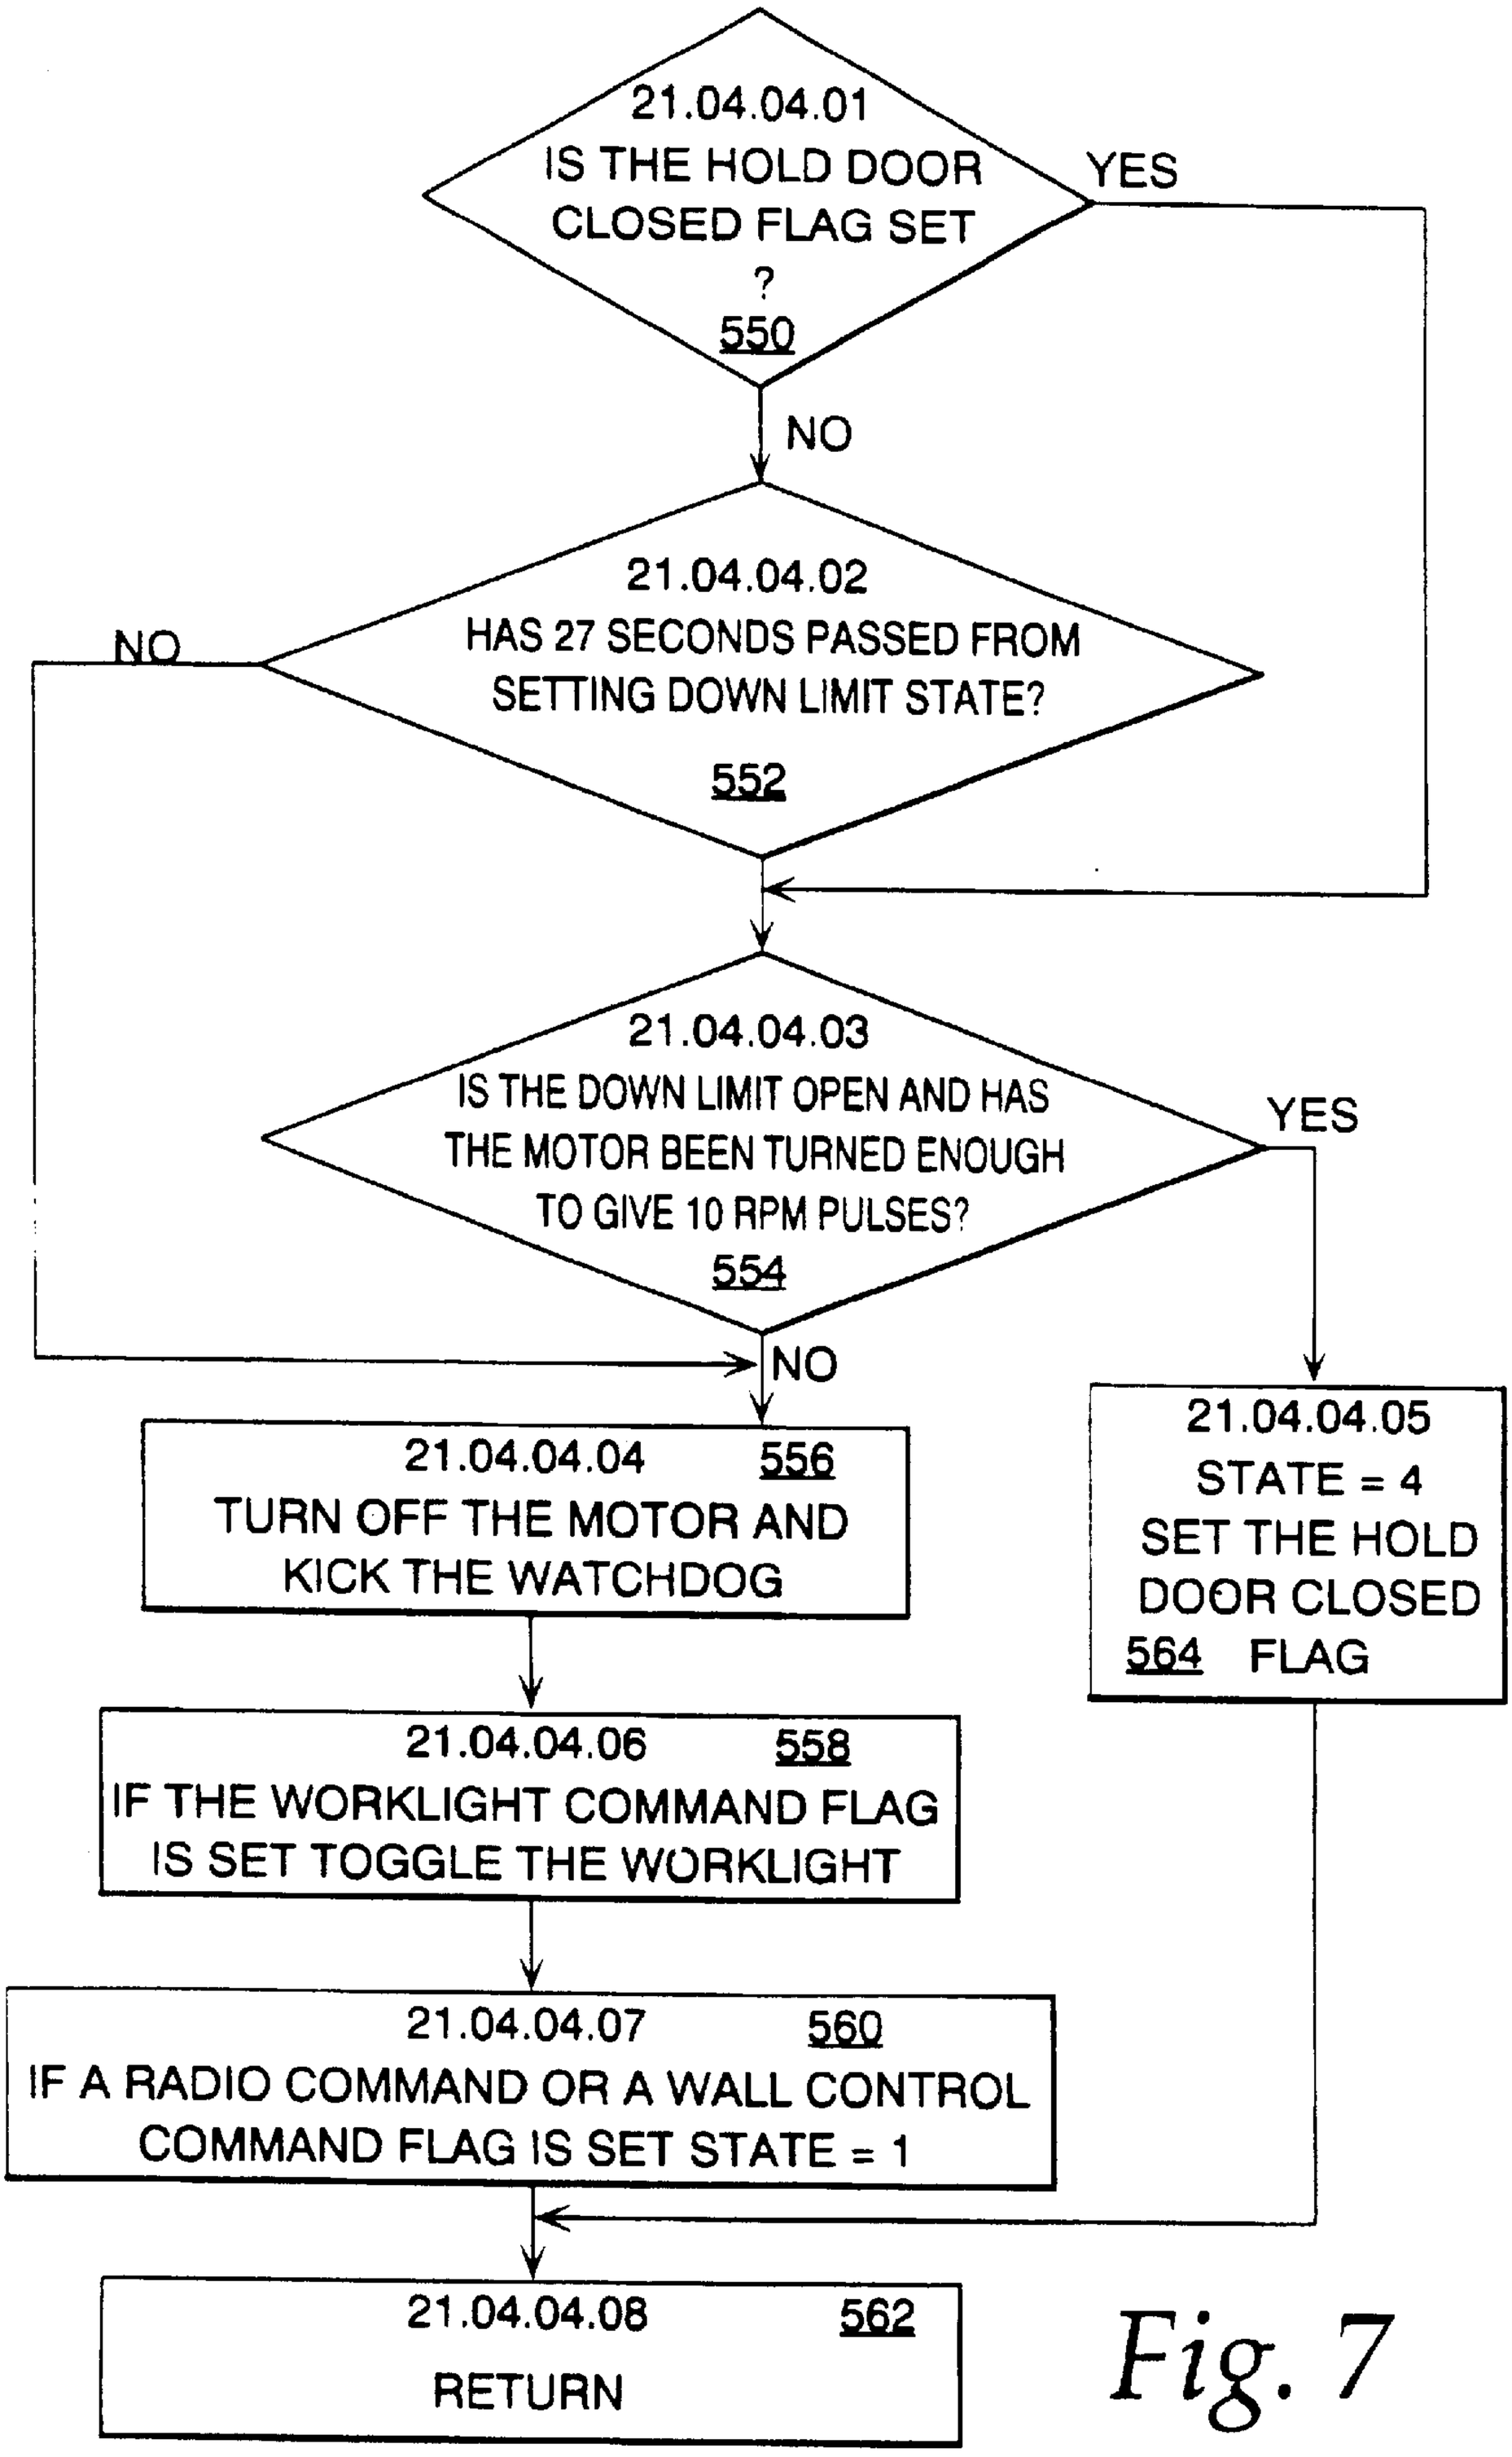
21.04.04.01
IS THE HOLD DOOR CLOSED FLAG SET ?
550
YES
NO
21.04.04.02
HAS 27 SECONDS PASSED FROM SETTING DOWN LIMIT STATE?
552
NO
21.04.04.03
IS THE DOWN LIMIT OPEN AND HAS THE MOTOR BEEN TURNED ENOUGH TO GIVE 10 RPM PULSES?
554
YES
NO
21.04.04.04 556
TURN OFF THE MOTOR AND KICK THE WATCHDOG
21.04.04.05
STATE = 4
SET THE HOLD DOOR CLOSED FLAG
564
21.04.04.06 558
IF THE WORKLIGHT COMMAND FLAG IS SET TOGGLE THE WORKLIGHT
21.04.04.07 560
IF A RADIO COMMAND OR A WALL CONTROL COMMAND FLAG IS SET STATE = 1
21.04.04.08 562
RETURN

Fig. 7

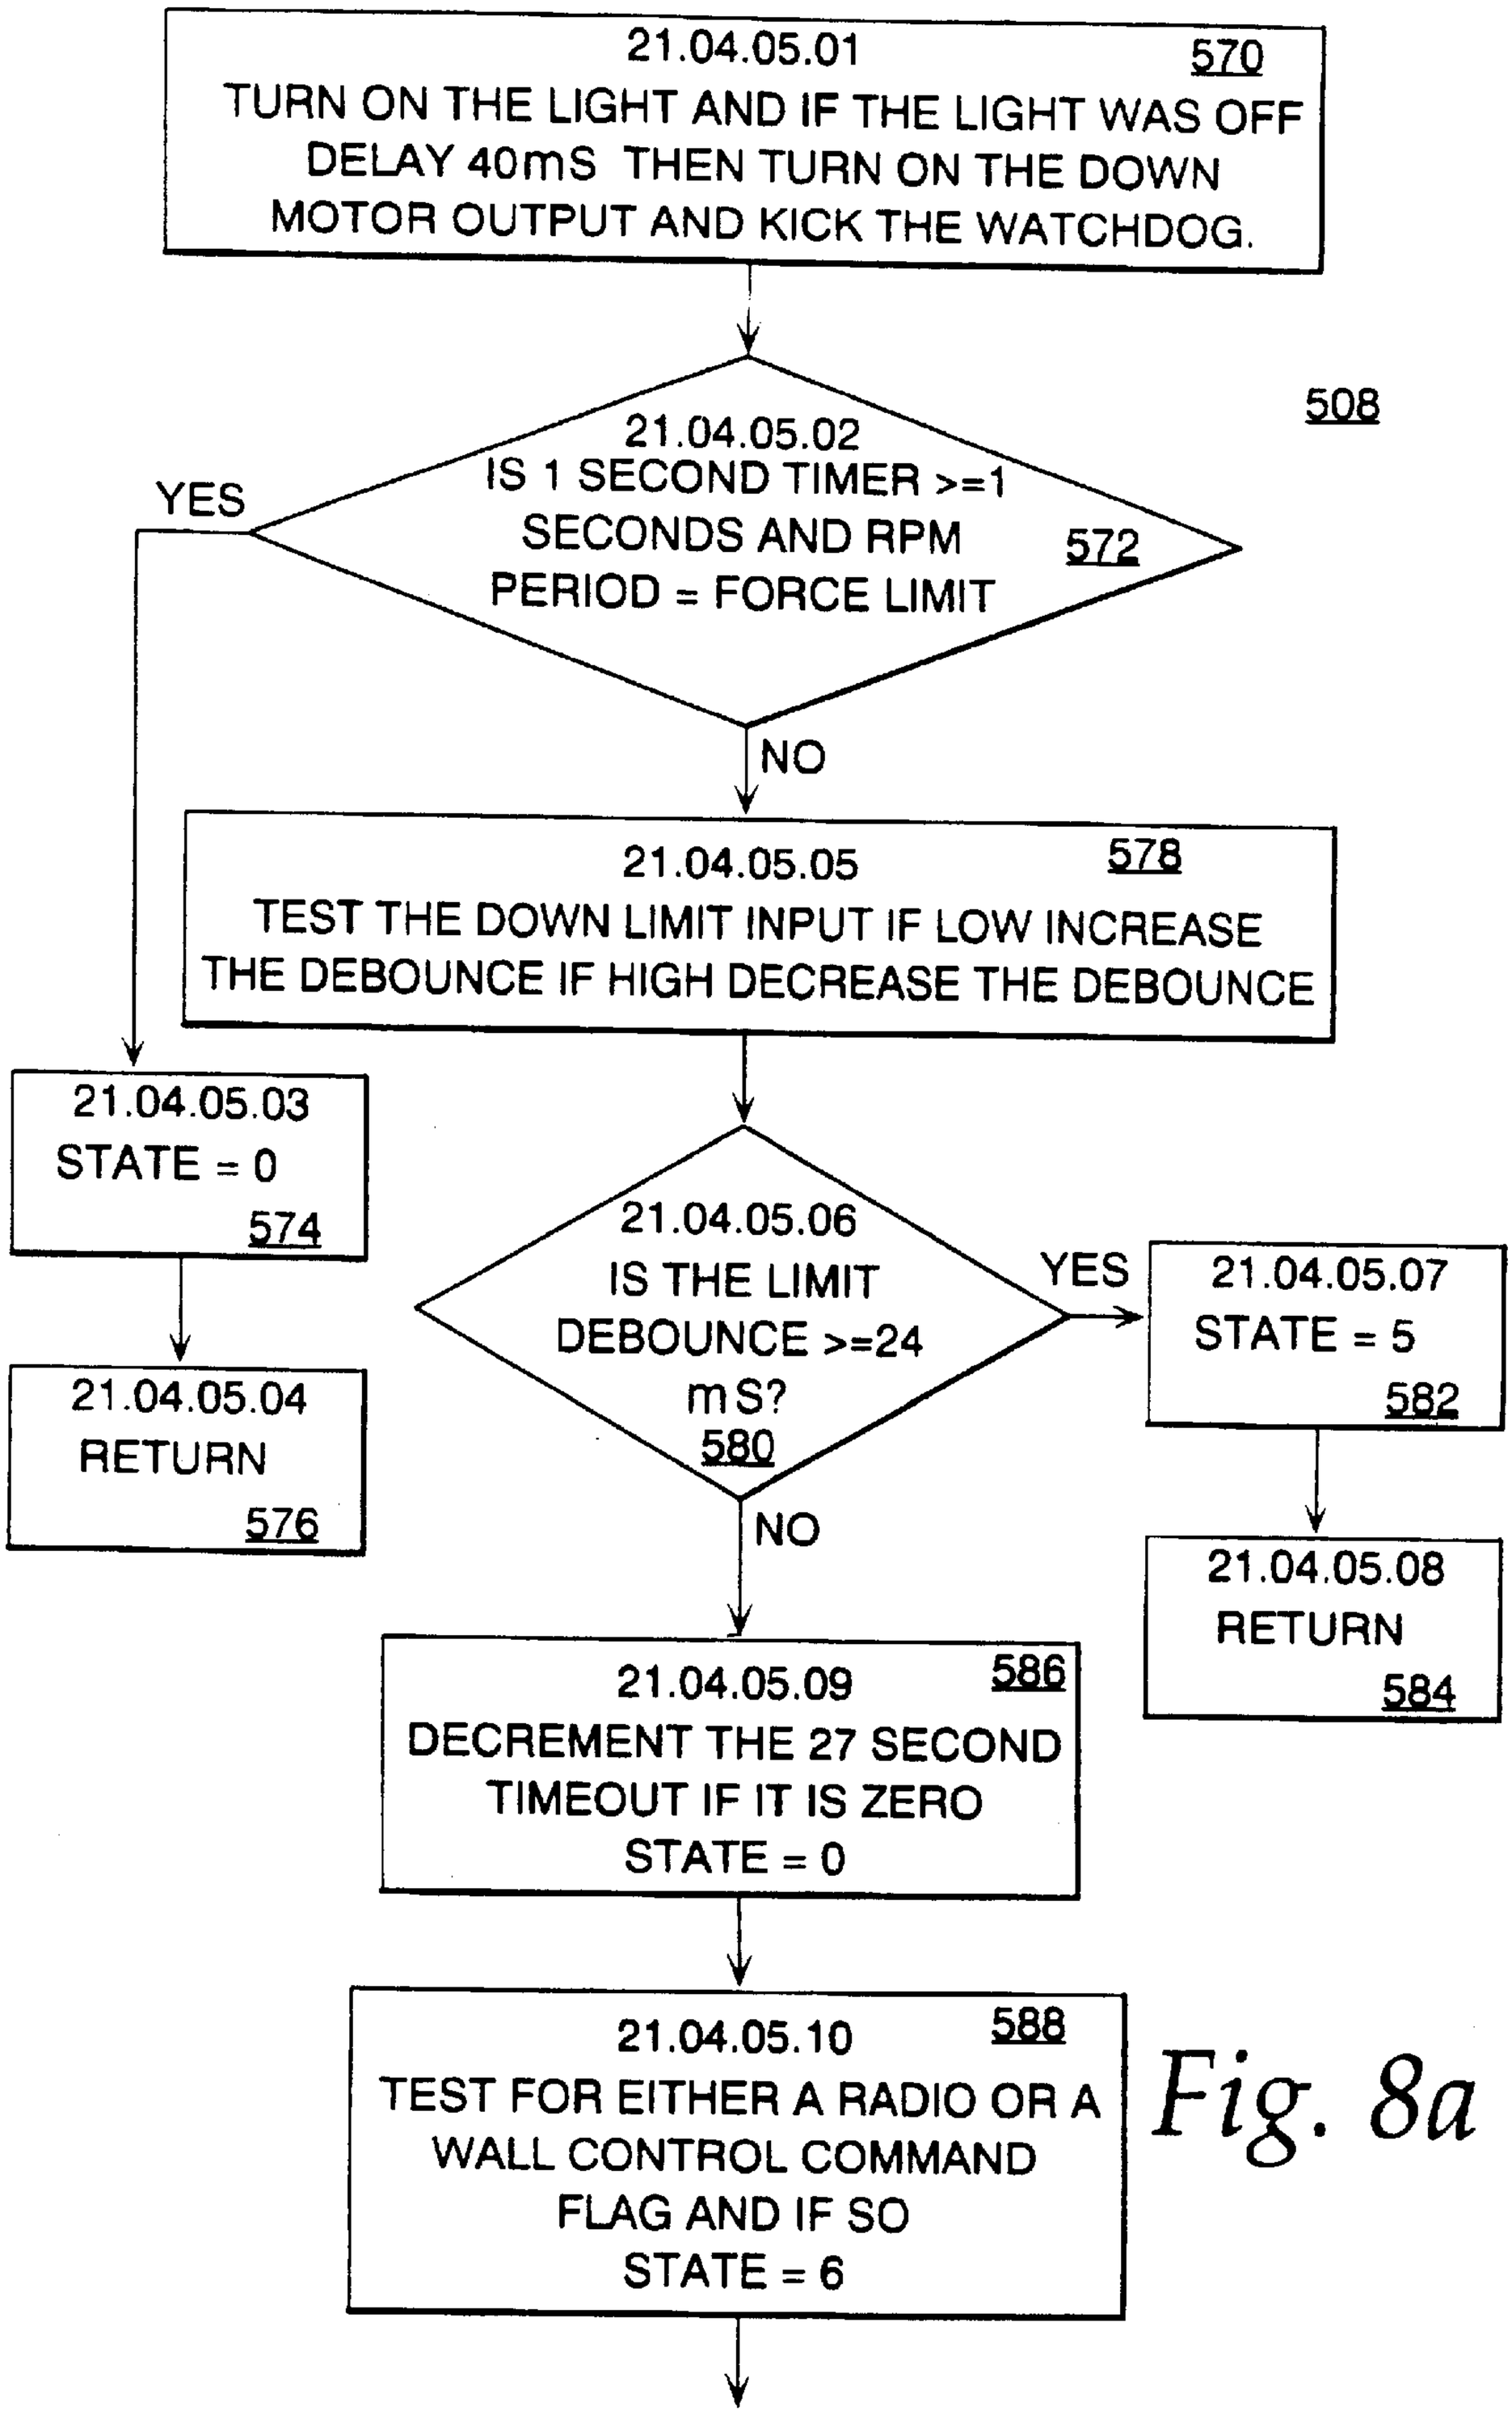
21.04.05.01
570
TURN ON THE LIGHT AND IF THE LIGHT WAS OFF DELAY 40mS THEN TURN ON THE DOWN MOTOR OUTPUT AND KICK THE WATCHDOG.
508
21.04.05.02
IS 1 SECOND TIMER >=1 SECONDS AND RPM PERIOD = FORCE LIMIT
572
YES
NO
21.04.05.05
578
TEST THE DOWN LIMIT INPUT IF LOW INCREASE THE DEBOUNCE IF HIGH DECREASE THE DEBOUNCE
21.04.05.03
STATE = 0
574
21.04.05.04
RETURN
576
21.04.05.06
IS THE LIMIT DEBOUNCE >=24 mS?
580
YES
21.04.05.07
STATE = 5
582
21.04.05.08
RETURN
584
NO
21.04.05.09
586
DECREMENT THE 27 SECOND TIMEOUT IF IT IS ZERO STATE = 0
21.04.05.10
588
TEST FOR EITHER A RADIO OR A WALL CONTROL COMMAND FLAG AND IF SO STATE = 6

Fig. 8a

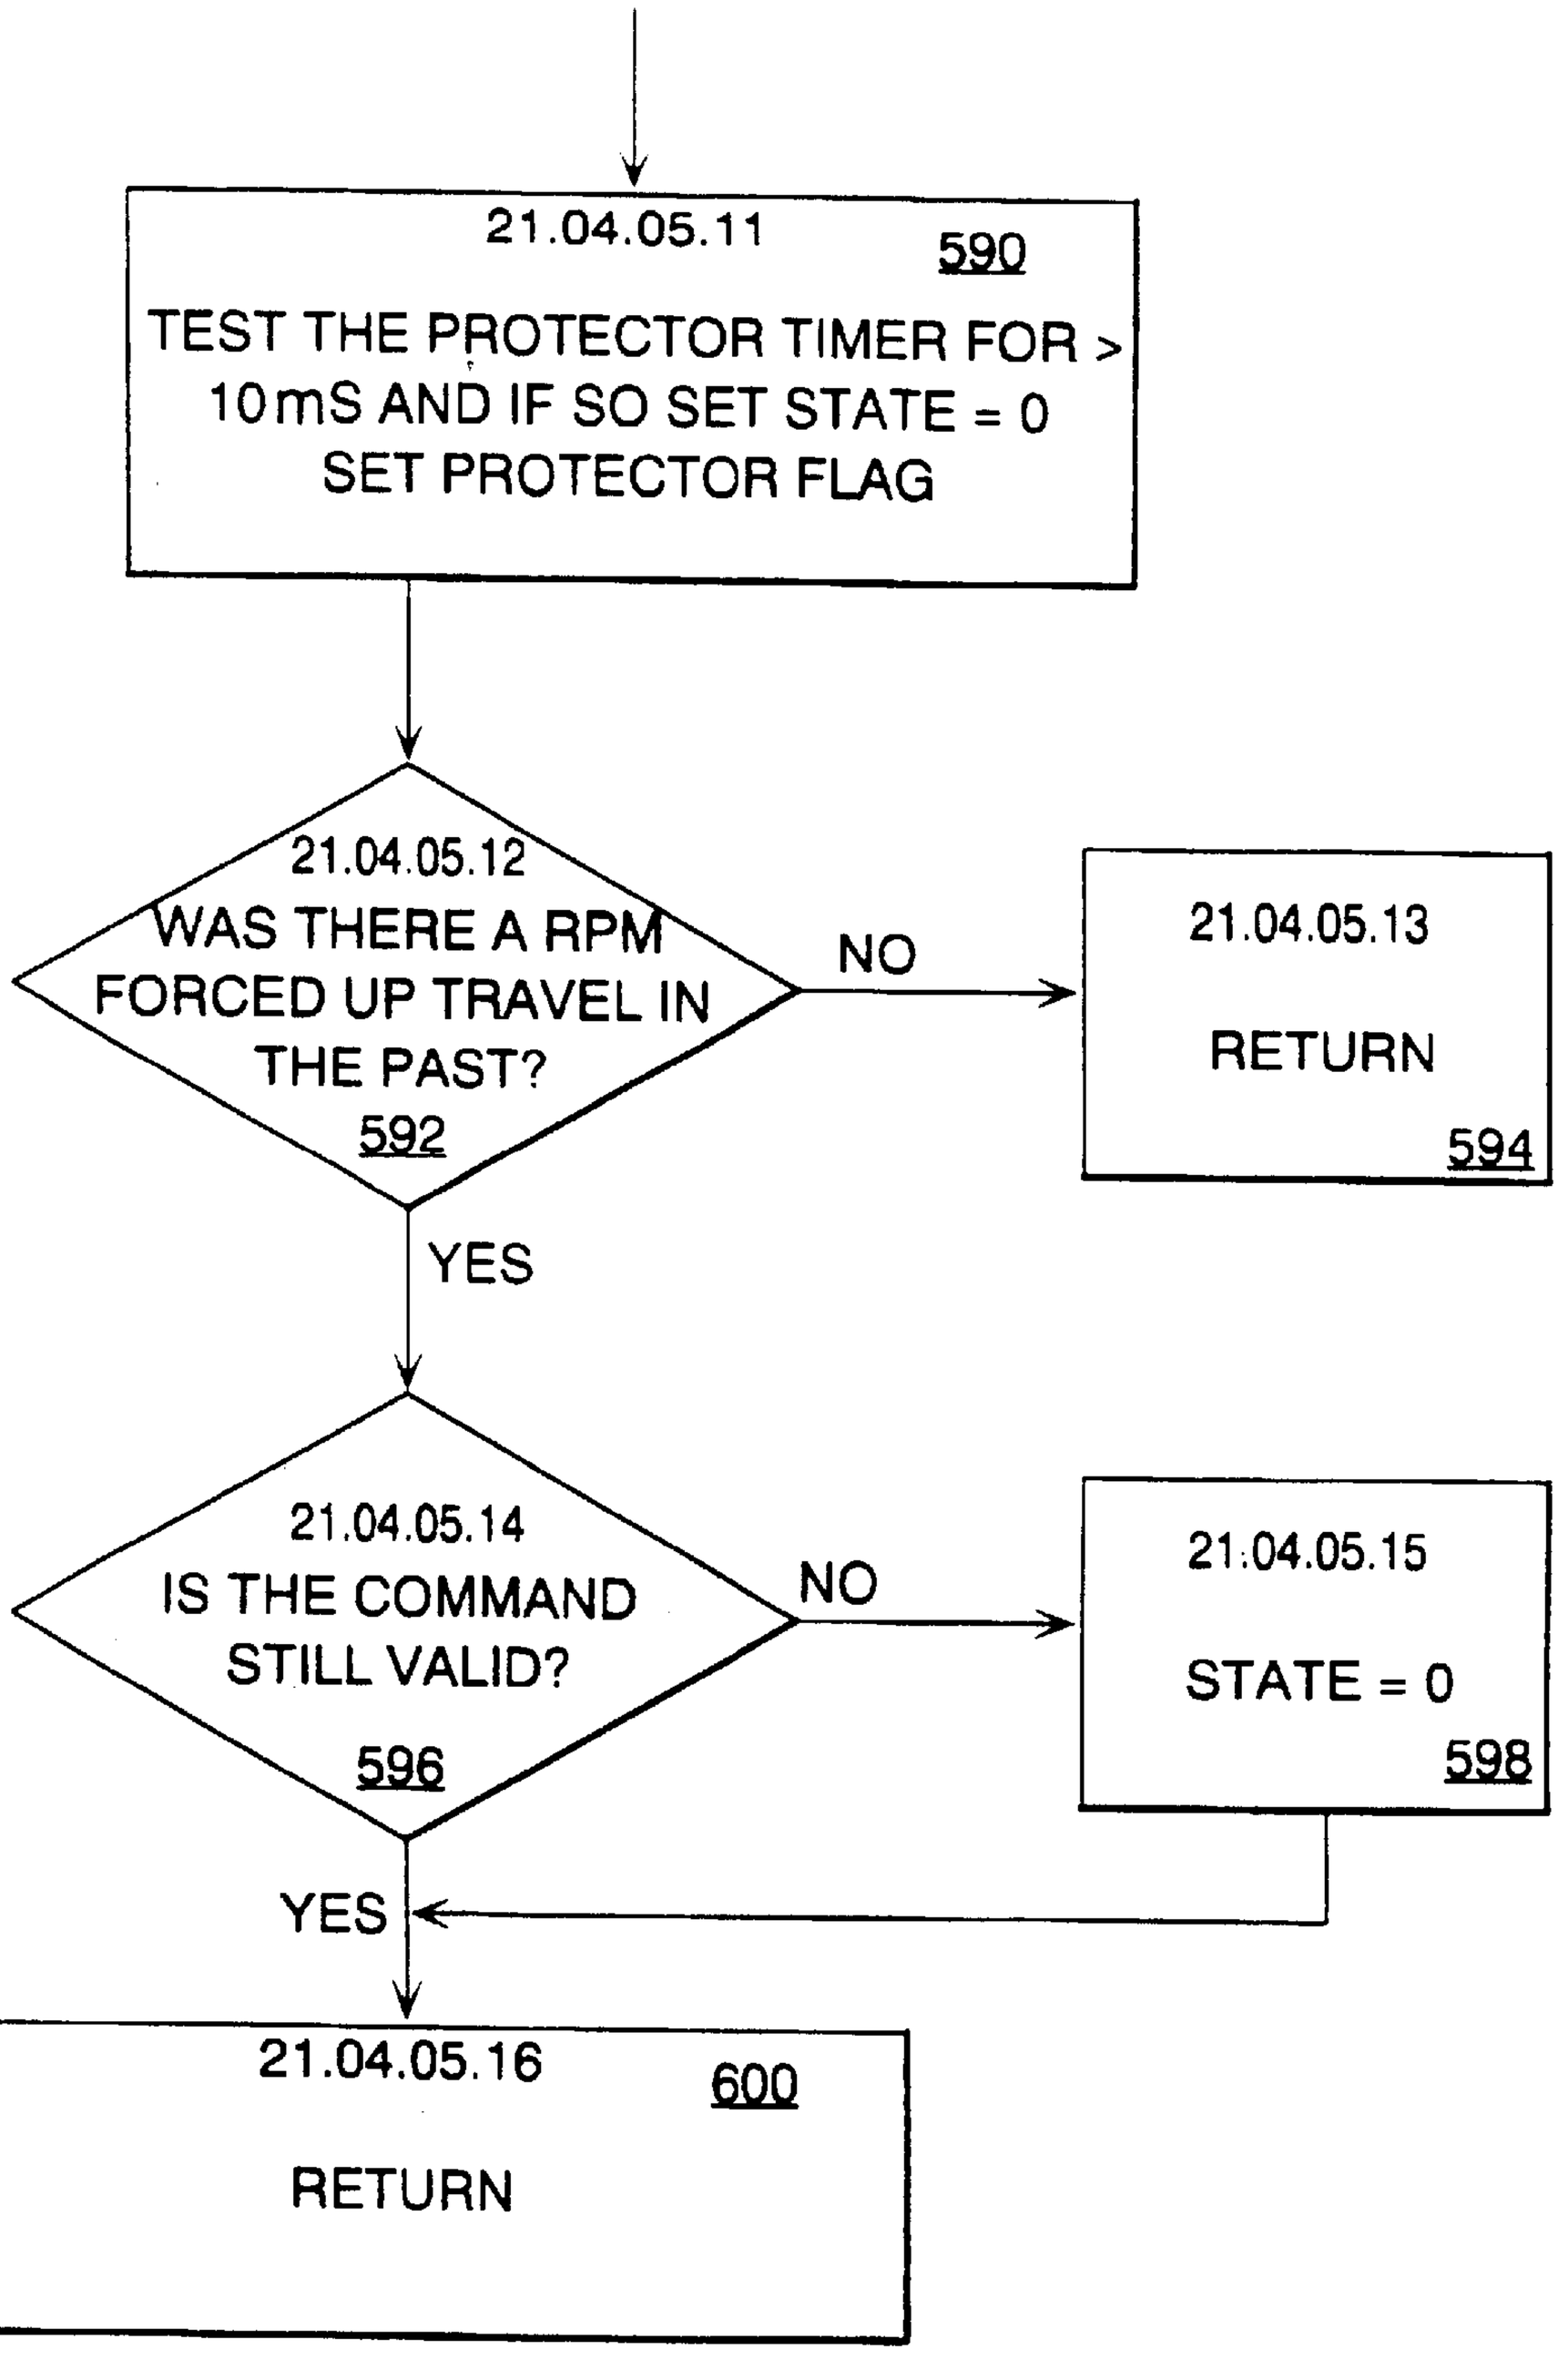
21.04.05.11
590
TEST THE PROTECTOR TIMER FOR > 10mS AND IF SO SET STATE = 0 SET PROTECTOR FLAG
21.04.05.12
WAS THERE A RPM FORCED UP TRAVEL IN THE PAST?
592
NO
21.04.05.13
RETURN
594
YES
21.04.05.14
IS THE COMMAND STILL VALID?
596
NO
21:04.05.15
STATE = 0
598
YES
21.04.05.16
600
RETURN

Fig. 8b

510

21.04.06.01
TEST THE RPM FORCED UP
FLAG IF SET TURN OFF THE LIGHT.
TURN OFF THE MOTOR AND
KICK THE WATCHDOG
602

21.04.06.02
IS THE WORKLIGHT COMMAND
FLAG IS SET TOGGLE THE
WORKLIGHT
604

21.04.06.03
IF A RADIO COMMAND OR A
WALL CONTROL COMMAND FLAG
IS SET SET STATE = 4
606

21.04.06.04
RETURN
608

Fig. 9

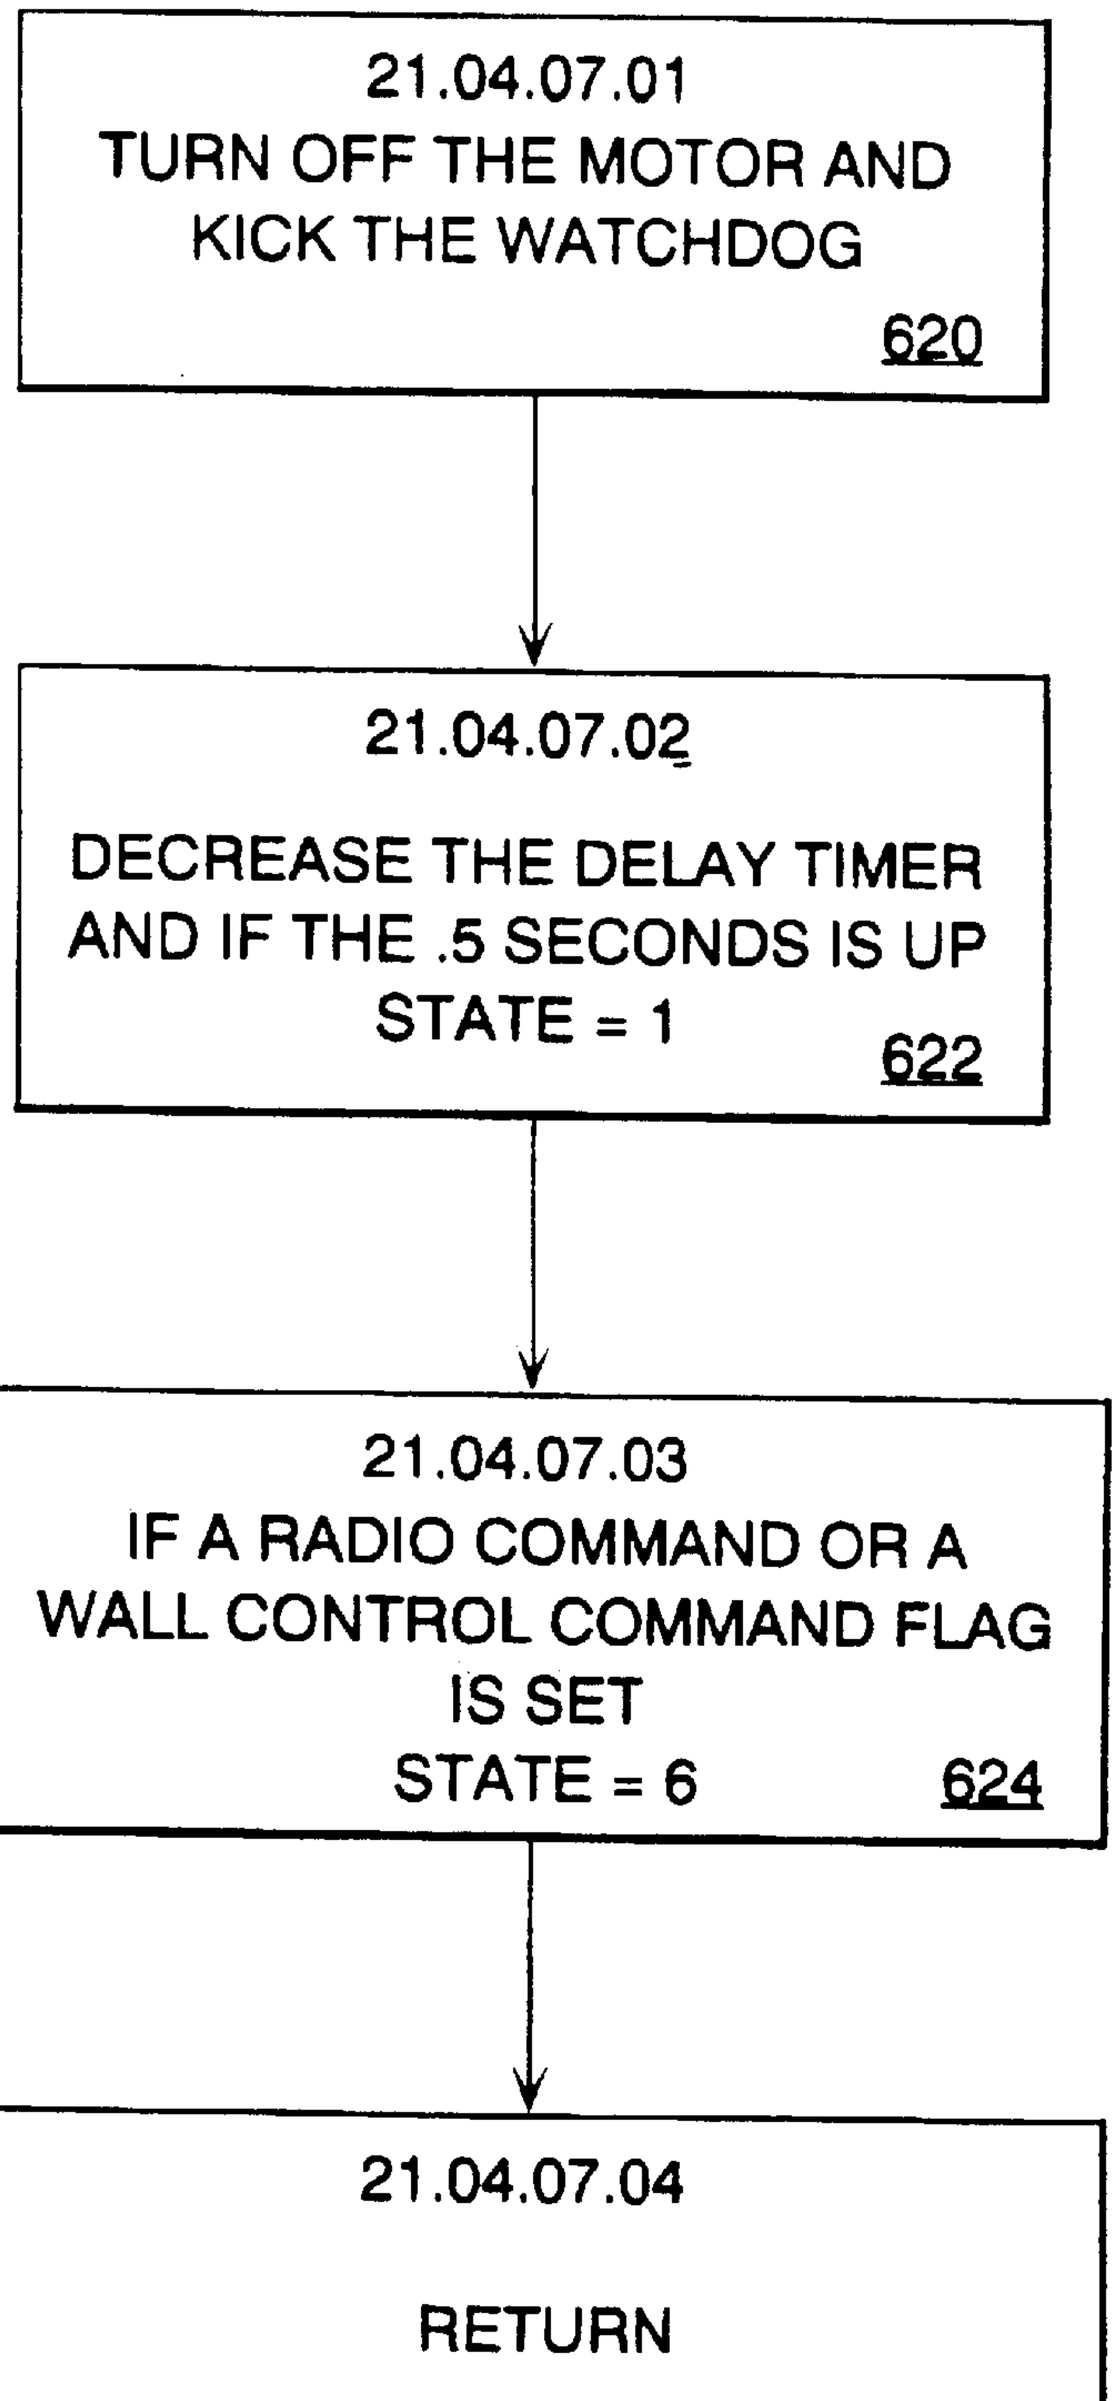
512
21.04.07.01
TURN OFF THE MOTOR AND
KICK THE WATCHDOG
620
21.04.07.02
DECREASE THE DELAY TIMER
AND IF THE .5 SECONDS IS UP
STATE = 1
622
21.04.07.03
IF A RADIO COMMAND OR A
WALL CONTROL COMMAND FLAG
IS SET
STATE = 6
624
21.04.07.04
RETURN
626

Fig. 10

BARRIER OPERATOR HAVING SYSTEM FOR DETECTING ATTEMPTED FORCED ENTRY

Matter enclosed in heavy brackets [ ] appears in the original patent but forms no part of this reissue specification; matter printed in italics indicates the additions made by reissue.

This application is a continuation of application Ser. No. 08/443,178 filed May 17, 1995, now abandoned.

BACKGROUND OF THE INVENTION

The invention relates, in general, to barrier operators and, in particular to a garage door operator including a system for detecting when an attempt is made to force open a closed garage door.

Several garage door operator systems are available on the market for maintaining a garage door either in a closed or open position. It is clear that the systems should be relatively easy to use and should be able to open the door relatively rapidly to allow quick and easy access to the garage. In addition, many systems are provided which include detectors, pressure detectors and the like that sense when the garage door is being brought down and the bottom edge of the door comes in contact with an obstacle prior to the door reaching the fully closed position. These systems are important because they prevent the garage door from closing on people, pets or small objects and, therefore, prevent personal injury and property damage. One of the drawbacks of such systems, however, is that for some such systems, when the door has been closed, if a lifting force is applied to the door, or instance by an unwanted intruder grabbing the handle of the door and attempting to raise it by jacking the door or the like, some systems through a force measurement routine, automatically cause the door to be opened, in order to prevent what the garage door operator senses might be potential harm. Of course, if the person operating the door is attempting to break and enter the garage for nefarious purposes and it is important that while the system prevents harm, the system also be provided such that the door cannot be forced open if the operator does not want it to be and if no persons or property are in danger.

A system available from the Stanley Company provides a garage door operator having upper travel limit and lower travel limit switches associated therewith. The switches may be set or moved so that the limits of travel may be changed. In the Stanley system, for instance, if the door has reached a nominal closed position and the operator has its down limit switch position changed, the door will actually dynamically track changes in the switch position and open or close according to switch commands.

Mechanical systems may be available that in effect, jam the door closed; however, once these systems are placed in effect, if a person not knowing that the door is down and effectively mechanically locked attempts to open the door the garage door operator then attempts to lift the door against the locking mechanism and the garage door operator may be inadvertently damaged thereby or, at the very least, not open the door because it is locked.

What is needed then is a system which provides a sensing modality for a garage door or other barrier operator which, while maintaining all safety features to prevent personal injury or property damage due to unwanted closing of the door, nevertheless senses when an intruder attempts to open the door and prevents the door from being opened by a positive drive force provided by the garage door operator motor.

SUMMARY OF THE INVENTION

The invention relates, in general, to a barrier system operator and, in particular, to a garage door operator which while having all safety features for preventing personal injury and property damage due to inadvertent closing of the garage door, nevertheless provides a positively actuated door closure system which prevents forcing the door once it has closed without having detected any objects underneath it. The system includes a barrier drive including an electric motor which may be connected to a belt, chain or screw drive. Means are provided for detecting motion of the movable barrier. These means may include a motor tachometer, upper and lower limit switches and the like. Means are also provided for detecting when a barrier command signal has been given to the barrier drive so that when a door has been commanded by a radio frequency control, the keypad control, indoor wired control or the like to open, the door may be automatically opened. The system also includes a storage device for storing the commanded state of the barrier drive which may be a microcontroller or a microprocessor in combination with a memory or some other integrated circuit device capable of storing digital or analog information. The commanded state is stored and is then compared in a comparator means with the position indicated by the barrier detection. In the event that the comparison of the barrier state signal and the barrier position signal indicates that the system already has been in a lowered position, usually for given time intervals, such as 27 seconds and attempt is made to raise the door causing unwanted motion of the door when there has been no up command given, an alarm signal is generated which may be passed through electronic and electromechanical logic to the door motor causing the door motor to provide thrust to the door to hold the door in the closed position.

In the alternative, the system may also provide a signal to operate a visual or audio alarm or to call over a telephonic or other wired system to a police department or to a security service to indicate that the system is being broken into.

It is a principal object of the present invention to provide a barrier operator for opening and closing a movable barrier which includes an electronic system for detecting when forced entry is being attempted on the carrier and for preventing the barrier from being opened.

Other objects of this invention will become obvious to one of ordinary skill in the art upon a perusal of the following specification and claims in light of the accompanying drawings.

BRIEF DESCRIPTION OF THE DRAWINGS

FIG. **1** is a perspective view of an apparatus comprising a garage door operator and embodying the present invention;

FIG. **2** is a block diagram of a portion of the head unit and associated controls of the apparatus shown in FIG. **1**;

[FIG. **3** is**]** *FIGS. 3A–3C are* a schematic diagram showing details of the circuit shown in FIG. **2**;

FIG. **4** is a flow chart of a top level flow diagram for the apparatus embodying the present invention;

FIG. **5** is a flow diagram of an upper limit routine;

FIGS. **6**A and **6**B are a flow diagram controlling travel upward;

FIG. **7** is a flow diagram of a down limit routine;

FIGS. **8**A and **8**B are a flow chart of a downward or closing movement routine;

FIG. **9** is a flow chart of a barrier closed routine; and

FIG. **10** is a flow chart of an auto-reverse time delay routine.

DETAILED DESCRIPTION OF THE PREFERRED EMBODIMENT

Referring now to the drawings and especially to FIG. **1**, more specifically a movable barrier door operator or garage door operator is generally shown therein and includes a head unit **12** mounted within a garage **14**. More specifically, the head unit **12** is mounted to the ceiling of the garage **14** and includes a rail **18** extending therefrom with a releasable trolley **20** attached having an arm **22** extending to a multiple paneled garage door **24** positioned for movement along a pair of door rails **26** and **28**. The system includes a hand-held transmitter unit **30** adapted to send signals to an antenna **32** positioned on the head unit **12** and coupled to a receiver as will appear hereinafter. An external control pad **34** is positioned on the outside of the garage having a plurality of buttons thereon and disposed to communicate via radio frequency transmission with the antenna **32** of the head unit **12**. An optical emitter **42** is connected via a power and signal line **44** to the head unit. An optical detector **46** is connected via a wire **48** to the head unit **12**.

The head unit **12** has a wired wall control panel **43** connected to it via a line or wire **43***a*, as is shown in FIG. **2**. More specifically, the wall control panel **43** is connected to a charging circuit **70** and a discharging circuit **72** coupled via respective lines **74** and **76** to a wall control decoder **78**. The wall control decoder **78** decodes closures of a plurality of switches **80**, **82** and **84** in the wall circuit. The wall control panel also includes a light emitting diode **86** connected by a resistor **88** to the line **43***a* and to ground. Switch **80** is the command switch, switch **82** is the work light switch and switch **84** is the vacation switch. Switch closures are decoded by the wall decoder **78** which sends signals along lines **90** and **92** to a motor control **94** coupled via motor control lines **96** to an electric motor **98** positioned within the head unit. A tachometer **100** receives a mechanical feed from the motor **98** and provides feedback signals on lines **102** to the motor controller.

The receiver unit also includes an antenna **110** coupled to receive radio frequency signals either from the fixed RF keypad **34** or the hand-held transmitter **30**. The RF signals are fed to a radio frequency receiver **112** where they are buffer amplified and supplied to a bandpass circuit **114** which outputs low frequency signals in the range of 1 Hz to 1 kHz. The low frequency signals are fed to an analog-to-digital converter **116** that sends digitized code signals to a radio controller **118**. The radio controller **118** is also connected to receive signals from a non-volatile memory **120** over a non-volatile memory bus **122** and to communicate via lines **124** and **126** with the motor controller **94**. A timer **128** is also provided, coupled via lines **130** with the radio controller, a line **132** with the motor controller and a line **134** with the wall control decoder **78**. A barrier travel limit detection device **190** includes an up limit detector **190***a* and a down limit detector **190***b* that sends signals to pins P**20** and P**21** of the microcontroller **282** *(as depicted in FIG. 3b)*. The obstacle detector comprising the emitter **42** and detector **46** send signals to pins P**03** and P**30** of the microcontroller **282** *(as depicted in FIG. 3b)* indicating when an obstacle is blocking the path of the door.

Referring now to FIG. **3**, the system shown in FIG. **3** is shown therein with the antenna **110** coupled to a reactive divider network **250**, comprised of a pair of series connected inductances **252** and **254** and capacitors **256** and **258**, which

supplies an RF signal to the buffer amplifier **112** having an NPN transistor **260** connected to receive the RF signal at its emitter **261**. The NPN transistor **260** has a capacitor **262** connected to it for power supply isolation. The buffer amplifier **112** provides a buffered radio frequency output signal on a lead **268**. The buffered RF signal is fed to an input **270** which forms part of a super-regenerative receiver **272** having an output at a line **274** coupled to the bandpass filter **114** which provides output to a comparator **278**. The bandpass filter **114** and analog-to-digital converter provide a digital level output signal at a lead **280** which is supplied to an input pin P**32** of an 8-bit Zilog microcontroller **282**.

The microcontroller **282** may have its mode of operation controlled by a programming or learning switch **300** positioned on the outside of the head unit **12** and coupled via a line **302** to the P**26** pin of the microcontroller **282**. The wired control panel **43** is connected via the lead **43***a* to input pins P**06** and P**07** The microcontroller **282** has a 4 MHz crystal **328** connected to it to provide clock signals. A force sensor **330** includes a bridge circuit having a potentiometer **332** for setting the up force and a potentiometer **334** for setting the down force, respectively connected to inverting terminals of a first comparator **336** and a second comparator **338**. The comparator **336** sends an up force signal over a line **339***a*. The comparator **338** sends a down force signal over the line **339***b*, respectively to pins P**04** and P**05** of the 8-bit microcontroller **282**. Although details of the operation of the microcontroller in conjunction with other portions of the circuit will be discussed hereinafter, it should be appreciated that the P**01** pin of the microcontroller is connected via a resistor **350** to a line **352** which is coupled to an NPN transistor **354** that controls a light relay **356** which may supply current via a lead **358** to a fight in the head unit or the like. Similarly, the pin P**000** feeds an output signal on a line **360** to a resistor **362** which biases a base of an NPN transistor **364** to cause the transistor **364** to conduct, drawing current through the coil of the relay an up relay **366** causing an up motor command to be sent over a line **90** to the motor **98**. Finally, the P**02** pin sends a signal through a line **370** to a resistor **372** via a line **374** to the base of an NPN transistor **376** connected to control current through a coil of a down control relay **378** which is coupled by one of the leads to the motor **98** to control motion of the motor **98**.

Electric power is received on a hot AC line **390** and a neutral line AC line **392** which are coupled to a transformer **393** at its primary winding **394**. The AC is stepped down at a secondary winding **395** and is full wave rectified by a full wave rectifier 3%. It may be appreciated that, in the alternative, a half wave rectifier may also be used.

A plurality of filter capacitors **398** receive the full wave rectified fluctuating voltage and remove some transients from the voltage supplying a voltage with reduced fluctuation to an input of a voltage regulator **400**. The voltage regulator **400** produces a 5-volt output signal available at a lead **402** for use in other portions of the circuit.

Referring now to FIG. **4**, a top level routine is shown therein which is entered every two milliseconds upon at timing interrupt in a step **500**. The routine then enters a variety of other routines depending upon the value of a state number. When the state number is 2 an upper limit routine is entered in a step **502**. If the state number is 1, a traveling up routine is entered in a state **504**. If the state is 5, a down limit routine is entered in a step **506**. If the state is 4, a traveling down routine is entered in a step **508**. If the state is 6, a barrier halt or stopped in middle routine is entered in a step **510**. If the state is 0, an auto-reverse time delay routine is entered in a step **512**. When any of the aforementioned

routines **502** through **512** are exited, a return step **514** is entered and other portions of code not pertinent to this invention are executed.

In the event that the state equals 2, the routine **502** is entered as may best be seen in FIG. **5** wherein the upper limit switch has indicated that the door has reached the upper end of its authorized travel, the motor is switched off and a watchdog timer is started in a step **514**. The work light command flag is set in step **516** to toggle the work light on. In a step **518**, a radio command or wall control command flag is tested for and, if set, the state is set to **4**. In a step **520**, the routine is exited and return is switched to the step **514**. In the event that the state has been set equal to **4**, in step **518** at the next 2 millisecond interval, control is transferred to the routine **508**.

In the event that the state has been set equal to 1, control is transferred to a barrier traveling up or a barrier opening routine shown in FIGS. **6**A and **6**B. In a step **522**, the work light is turned on and in the event that the light was off, a delay of 40 milliseconds is then provided to turn on the up motor output, the down motor output is turned off and the hold door closed flag is cleared. In a step **524**, after a start up delay of 1 second the rpm period of the tachometer is tested against the look up force and if the rpm period is too brief, a state is set to indicate that the door has stopped in mid travel. In a step **526**, a test is made to determine whether the one second timer has exceeded one second and whether the rpm period is below the set force limit indicating that the door has been halted in an unwanted manner. If it is not, control is transferred to a step **528** wherein the state variable is set to 6, following which the routine is exited in a step **530**. In the event that the decision in step **526** is positive, the up limit input is tested. If the voltage is low, it is increased. If it is high, the debounce is decreased. Control is then transferred to a test step **532** to test whether the limit debounce is greater than 24 milliseconds. If it is, the state is set equal to 2 in a step **534** and the routine is exited in a step **536**. If the limit debounce is less than 24 milliseconds, control is transferred to a step **540** where a 27 second time out is decremented and tested for. If the time out is zero, the state is set as indicating that the door has stopped in mid travel. A step **542** is executed to test for either a radio or wall control command flag having been set and, if so, the state is set as stop in mid travel. The routine is then executed in a step **544**.

In the event that the state has been set equal to 5, a routine **506** to handle down limits, as shown in FIG. **7**, is entered. In a step **550**, a hold door closed flag is tested to determine whether it is set or not. If it is not set, control is transferred to a step **552** to determine whether the 27 seconds timer has timed out following the down limit having been set, indicating that the door has safely closed and did not contact an obstruction or obstacle. In the event that the hold door closed flag has been set, as tested for in step **550**, control is transferred to a step **554** testing whether the down limit indicates the door is open and whether the motor has been given enough current or turned on long enough to provide 10 rpm pulses. In the event that the 27 second clock has not been timed out as indicated by step **552**, control is transferred to a step **556**, switching the motor off, and starting a watchdog timer. Control is then transferred to a step **558** to determine if the work light command flag has been set and, if it has, the work light is toggled. Control is then transferred to a step **560**, testing for whether there is a radio command or wall control command flag. If so, the state is set equal to 1 and the routine is exited in a return step **562**. In the event that the down limit does not indicate that the door is open and the motor has been turned enough to give 10 rpm pulses, control is transferred to a step **564** setting the state equal to 4 and setting the hold door closed flag. The state equal 4 indicates that the door is to be traveling down, thereby causing the barrier to close after the 27 second limit has timed out.

In the event the state has been set equal to 4 to command the door to travel down, the routine **508** is entered as shown in FIGS. **8**A and **8**B. In a step **570**, the work light is turned on, and if the light had previously been off, a delay of 40 milliseconds occurs following which down motor output is turned on and the up motor output is turned off, the watchdog is also started. In a step **572**, a test is made to determine whether the 1 second timer has exceeded 1 second and whether the rpm period is indicative of a force limit having been exceeded. If so, indicating that the door is stalled on an obstacle, control is transferred to a step **574**, setting a state equal to zero and the routine is exited in a step **576**. If the door has not been indicated to be stalled by the step **572**, control is transferred to a step **578** testing the status of the down limit input. If it is low, the debounce is increased. If it is high, the debounce is decreased. In a step **580**, the limit debounce is tested to determine whether it is greater than or equal to 24 milliseconds. If it is, the state is set equal to 5 in a step **582** and the routine is exited in a step **584**. If it is not, the 27 second time out is decremented and tested to determine if it is zero. If it is zero, the state is set equal to zero in a step **586**. In a step **588**, a test is made to determine whether the radio or wall control command flag has been set and, if so, the state is then set equal to 6. In a step **590**, as shown in FIG. **8**B, the timer associated with the optical detector is tested to determine whether it is greater than 10 milliseconds and, if it is, indicating that an obstacle is blocking the light path, the state is set equal to zero to cause the auto-reverse routine **512** to be entered following exiting from this routine. It will be entered on the next interrupt which is in less than 2 milliseconds. Control is then transferred to a step **592**, testing whether the motor speed indicated that the door had been forced upward. If it is not the routine is exited in a step **594**. If the rpm sensing indicates that the door has been forced upward, a test is made in the step **596** to determine if the command is still valid, indicating the door is to move upward. If it is not, control is transferred to a step **598** setting the state equal to zero which will cause the door to auto reverse and move down. Control is then transferred to a step **600** exiting the routine.

In the event that the state has been set equal to 6, the routine **510** shown in FIG. **9** is entered. A test is made to determine whether the motor motion indicates that the door has been forced upward. If so, a flag is set to turn off the light and the electric motor is switched off and the watchdog is started. If the worklight command flag has been set in a step **604**, the work light is then toggled. In a step **606**, a test is made to determine whether the radio command or wall control command flag has been set and, if it has, the state is then set equal to 4 which will cause entry of the traveling down routine **508**. The routine is then exited in a step **608**.

In the event that the state has been set equal to zero indicating that an auto reverse is to be commanded, the routine **512** is entered in a step **620**, the motor is turned off and a watchdog timer is started. In the step **622**, the delay timer is decreased and if 0.5 seconds has expired, the state is set equal to 1 to cause the door to travel upward on the next 2 millisecond interrupt. In a step **624**, a test is made for the radio command or wall control command flag being set. If it has, the stopped in middle routine **510** will be entered on the next interrupt. The routine **512** is then exited in a step **626**.

While there has been illustrated and described a particular embodiment of the present invention, it will be appreciated that numerous changes and modifications will occur to those skilled in the art, and it is intended in the appended claims to cover all those changes and modifications which fall within the true spirit and scope of the present invention.

7

8

NON-VOL MEMORY MAP

00	A1
01	A1
02	A2
03	A2
04	A3
05	A3
06	A4
07	A4
08	A5
09	A5
0A	A6
0B	A6
0C	A7
0D	A7
0E	A8
0F	A8
10	A9
11	A9
12	A10
13	A10
14	A11
15	A11
16	A12
17	A12
18	B
19	B
1A	C
1B	C
1C	CYCLE COUNTER 1ST 16 BITS
1D	CYCLE COUNTER 2ND 16 BITS
1E	VACATION FLAG
1F	A MEMORY ADDRESS LAST WRITTEN

20-2F OPERATION BACK TRACK

30-3F FORCE BACK TRACE

RS232 DATA

INPUT	OUTPUT	
30H	SWITCH STATUS	
	XXXXXXX0	UP LIMIT OPEN
	XXXXXXX1	UP LIMIT CLOSED
	XXXXXX0X	DOWN LIMIT OPEN
	XXXXXX1X	DOWN LIMIT CLOSED
	XXXXX0XX	COMMAND OPEN
	XXXXX1XX	COMMAND CLOSED
	XXXX0XXX	WORKLIGHT OPEN
	XXXX1XXX	WORKLIGHT CLOSED
	XXX0XXXX	VACATION OPEN
	XXX1XXXX	VACATION CLOSED
31H	SYSTEM STATUS	
	XXXXSSSS	STATE DATA
	XXX0XXXX	NOT IN LEARN MODE
	XXX1XXXX	IN LEARN MODE
	XX0XXXXX	NOT IN VACATION MODE
	XX1XXXXX	IN VACATION MODE
	X0XXXXXX	LIGHT OFF
	X1XXXXXX	LIGHT ON
	0XXXXXXX	AOBS OK
	1XXXXXXX	AOBS ERROR
32H	RPM PERIOD	
	RETURNED HIGH BYTE	
	RETURNED LOW BYTE	
33H	FORCE	
	RETURNED DOWN FORCE	
	RETURNED UP FORCE	
34H	RADIO MEMORY CODES PAGE 00	
	32 BYTES	
35H	RADIO MEMORY CODES PAGE 10	
	32 BYTES	
36H	OPERATION HISTORY PAGE 20	
	32 BYTES	
37H	FORCE HISTORY PAGE 30	
38H	MEMORY TEST AND ERASE ALL!!	
	00 OK	

FF ERROR

39H SET PROGRAM MODE

REASON
00 COMMAND
10 RADIO COMMAND
20 FORCE
30 AUX OBS
40 A REVERSE DELAY
50 LIMIT
60 EARLY LIMIT
70 MOTOR MAX TIME, TIME OUT
80 MOTOR COMMANDED OFF RPM CAUSING AREV
90 DOWN LIMIT WITH COMMAND HELD
A0 DOWN LIMIT WITH THE RADIO HELD
B0 RELEASE OF COMMAND OR RADIO AFTER A FORCED UP MOTOR ON DUE TO RPM PULSE WITHG MOTOR OFF

STATE
00 AUTOREVERSE DELAY
01 TRAVELING UP DIRECTION
02 AT THE UP LIMIT AND STOPED
03 ERROR RESET
04 TRAVELING DOWN DIRECTION
05 AT THE DOWN LIMIT
06 STOPPED IN MID TRAVEL

DIAG

---

1) AOBS SHORTED
2) AOBS OPEN / MISS ALIGNED
3) COMMAND SHORTED
4) PROTECTOR INTERMITTENENT
5) CALL DEALER
   A) NO RPM IN THE FIRST SECOND
   B) RPM FORCED A REVERSE
   C)

DOG 2

DOG 2 IS A SECONDARY WATCHDOG USED TO RESET THE SYSTEM IF THE LOWEST LEVEL "MAINLOOP" IS NOT REACHED WITHIN A 3 SECOND

EQUATE STATEMENTS

```
check_sum_value     .equ    09AH
TIMER_0             .EQU    10H
TIMER_0_EN          .EQU    03H
TIMER_1_EN          .EQU    0CH

MOTOR_HI            .EQU    034H
MOTOR_LO            .EQU    0BCH
PWM_CHARGE          .EQU    00H
PWM_DISCHARGE       .EQU    01H
LIGHT               .EQU    0FFH
LIGHT_ON            .EQU    02H
MOTOR_UP            .EQU    01H
MOTOR_DN            .EQU    04H
DN_LIMIT            .EQU    02H
UP_LIMIT            .EQU    01H
DIS_SW              .EQU    10000000B
CDIS_SW             .EQU    01111111B
SWITCHES            .EQU    01000000B
CHARGE_SW           .EQU    00100000B
CCHARGE_SW          .EQU    11011111B
PWM_HI              .EQU    10H
COMPARATORS         .EQU    30H
DOWN_COMP           .EQU    20H
UP_COMP             .EQU    10H
PWM_DIS             .EQU    20H
P01M_INIT           .EQU    01000100B   ; set mode p00-p03 out p04-p07in
P2M_INIT            .EQU    01100011B
P3M_INIT            .EQU    00000011B   ; set port3 p30-p33 input ANALOG mode
P01S_INIT           .EQU    00000010B
P2S_INIT            .EQU    10000011B
P3S_INIT            .EQU    00000000B

FLASH               .EQU    0FFH
WORKLIGHT           .EQU    02H

COM_CHARGE          .EQU    2
WORK_CHARGE         .EQU    20
VAC_CHARGE          .EQU    80

COM_DIS             .EQU    01
WORK_DIS            .EQU    04
VAC_DIS             .EQU    24

CMD_TEST            .EQU    00
WL_TEST             .EQU    01
VAC_TEST            .EQU    02
CHARGE              .EQU    03

AUTO_REV            .EQU    00H
UP_DIRECTION        .EQU    01H
UP_POSITION         .EQU    02H
DN_DIRECTION        .EQU    04H
```

```
DN_POSITION         EQU   05H
STOP                EQU   06H
CMD_SW              EQU   01H
LIGHT_SW            EQU   02H
VAC_SW              EQU   04H

;-------------------------------------------------------------------------
;       PERIODS
;-------------------------------------------------------------------------

LIMIT_COUNT         EQU   0FH          ; limit debounce 1 way 32mS
AUTO_HI             EQU   00H          ; auto rev timer .5 sec
AUTO_LO             EQU   0F4H
MIN_COUNT           EQU   04H          ; pwm start point
TOTAL_PWM_COUNT     EQU   03FH         ; pwm end = start + 4*total-1
FLASH_HI            EQU   00H          ; .25 sec flash
FLASH_LO            EQU   07AH
SET_TIME_HI         EQU   02H          ; 4.5 MIN
SET_TIME_LO         EQU   02H          ; 4.5 MIN
SET_TIME_PRE        EQU   0FBH         ; 4.5 MIN
ONE_SEC             EQU   0F4H         ; WITH A /2 IN FRONT
CMD_MAKE            EQU   8D                 ; cycle count *10mS
CMD_BREAK           EQU   (255D-8D)
LIGHT_MAKE          EQU   8D                 ; cycle count *11mS
LIGHT_BREAK         EQU   (255D-8D)
VAC_MAKE_OUT        EQU   4D                 ; cycle count *100mS
VAC_BREAK_OUT       EQU   (255D-4D)
VAC_MAKE_IN         EQU   2D
VAC_BREAK_IN        EQU   (255D-2D)

VAC_DEL             EQU   8D
CMD_DEL_EX          EQU   4D
VAC_DEL_EX          EQU   50D

;-------------------------------------------------------------------------
;       PREDEFINED REG
;-------------------------------------------------------------------------

;SP          .equ    255          ; stack pointer
;RP          .equ    253          ; register pointer
;FLAGS       .equ    252          ; cpu flags
;IMR         .equ    251          ; interrupt mask reg
;IRQ         .equ    250          ; interrupt request
;IPR         .equ    249          ; interrupt priority
;P01M        .equ    248          ; port 0 mode
;P3M         .equ    247          ; port 3 mode
;P2M         .equ    246          ; port 2 mode
;PRE0        .equ    245          ; prescaler for timer 0
;T0          .equ    244          ; timer 0
;PRE1        .equ    243          ; prescaler for timer 1
;T1          .equ    242          ; timer 1
;TMR         .equ    241          ; timer mode
;P3          .equ    3            ; port 3
```

```
;P2             .equ    2               ; port 2
;P0             .equ    0               ; port 0

ALL_ON_IMR      .equ    00111101b       ; turn on  int for timers rpm auxobs radio
RETURN_IMR      .equ    00011101b       ; return on the IMR
;-----------------------------------------------------------------------
        GLOBAL REGISTERS
;-----------------------------------------------------------------------

STATUS                  .EQU    04H     ; CMD_TEST 00
                                        ; WL_TEST  01
                                        ; VAC_TEST 02
                                        ; CHARGE_03

STATE                   .EQU    05H     ; state register
PWM_STATUS              .EQU    06H
PWM_OFF                 EQU     07H
AUTO_DELAY_HI           .EQU    08H
AUTO_DELAY_LO           .EQU    09H
AUTO_DELAY              .EQU    08H
MOTOR_TIMER_HI          .EQU    0AH
MOTOR_TIMER_LO          .EQU    0BH
MOTOR_TIMER             .EQU    0AH
LIGHT_TIMER_HI          .EQU    0CH
LIGHT_TIMER_LO          .EQU    0DH
LIGHT_TIMER             .EQU    0CH

PRE_LIGHT               .EQU    0FH
SW_DATA                 .EQU    10H
ONEP2                   .EQU    11H     ; 1.2 SEC TIMER TICK .125
LAST_CMD                .EQU    12H     ; LAST COMMAND FROM
                                        ; = 55 WALL CONTROL
                                        ; = 00 RADIO

BCODEFLAG               .EQU    13H     ; B CODE FLAG
                                        ; 77 = b code

RPMONES                 .EQU    14H     ; RPM PULSE ONE SECOND DISABLE
RPMCLEAR                .EQU    15H     ; RPM PULSE CLEAR AND TEST TIMER
FAREVFLAG               .EQU    16H     ; RPM FORCED AREV FLAG
                                        ; 88H FOR A FORCED REVERSE

FLASH_FLAG              .EQU    17H
FLASH_DELAY_HI          .EQU    18H
FLASH_DELAY_LO          .EQU    19H
FLASH_DELAY             .EQU    18H
FLASH_COUNTER           .EQU    1AH
REASON                  .EQU    1BH     ;
                                        ; 00    COMMAND
                                        ; 10    RADIO COMMAND
                                        ; 20    FORCE
                                        ; 30    AUXOBS
                                        ; 40    AUTOREVERSE DELAY TIMEOUT
                                        ; 50    LIMIT
                                        ; 60    EARLY LIMIT
                                        ; 70    MOTOR MAX TIME OUT
                                        ; 80    FORCED AREV FROM RPM
                                        ; 90    CLOSED WITH COMMAND HELD
```

```
                                                    ; A0    CLOSED WITH THE RADIO HELD
LIGHT_FLAG          .EQU    1CH
CMD_DEB             .EQU    1DH
LIGHT_DEB           .EQU    1EH
VAC_DEB             .EQU    1FH


TIMER_GROUP         EQU     20H
sw_address_hi       .equ    r0
sw_address_lo       equ     r1
sw_address          .equ    rr0
t_address_hi        .equ    r2
t_address_lo        equ     r3
t_address           .equ    rr2
switch_delay        .equ    r4
limit               .equ    r5
obs_count           .equ    r6
rs232do             .equ    r7
rs232di             .equ    r8
rscommand           .equ    r9
rs232docount        .equ    r10
rs232dicount        .equ    r11
rs232odelay         .equ    r12
rs232idelay         .equ    r13
rs232ccount         .equ    r14
rs232page           .equ    r15

SWITCH_DELAY        .EQU    TIMER_GROUP+4
LIMIT               .EQU    TIMER_GROUP+5
OBS_COUNT           .EQU    TIMER_GROUP+6
RS232DO             .EQU    TIMER_GROUP+7
RS232Di             .EQU    TIMER_GROUP+8
RSCOMMAND           .EQU    TIMER_GROUP+9
RS232DOCOUNT        .EQU    TIMER_GROUP+10
RS232DICOUNT        .EQU    TIMER_GROUP+11
RS232ODELAY         .EQU    TIMER_GROUP+12
RS232IDELAY         .EQU    TIMER_GROUP+13
RS232CCOUNT         .EQU    TIMER_GROUP+14
RS232PAGE           .EQU    TIMER_GROUP+15

;*****************************************************************
; LEARN EE GROUP FOR LOOPS ECT
;*****************************************************************
LEARNEE_GRP         .equ    30H
TEMPH       .equ    LEARNEE_GRP     ;
TEMPL       .equ    LEARNEE_GRP+1   ;
TEMP        .equ    LEARNEE_GRP+2   ;
LEARNDB     .equ    LEARNEE_GRP+3   ; learn debouncer
LEARNT      .equ    LEARNEE_GRP+4   ; learn timer
ERASET      .equ    LEARNEE_GRP+5   ; erase timer
MTEMPH      .equ    LEARNEE_GRP+6   ; memory temp
MTEMPL      .equ    LEARNEE_GRP+7   ; memory temp
MTEMP       .equ    LEARNEE_GRP+8   ; memory temp
SERIAL      .equ    LEARNEE_GRP+9   ; serial data to and from nonvol memory
ADDRESS     .equ    LEARNEE_GRP+10  ; address for the serial nonvol memory
```

```
T0EXT       .equ    LEARNEE_GRP+11    ; timer 0 extend decremented every T0 int
T4MS        .equ    LEARNEE_GRP+12    ; 4 mS counter
T125MS      .equ    LEARNEE_GRP+13    ; 125mS counter
ZZWIN       .equ    LEARNEE_GRP+14    ; radio 00 code window
SKIPRADIO   .equ    LEARNEE_GRP+15    ; flag to skip the radio read and write if
                                      ; learn or vacation are talking to it

temph       .equ    r0                ;
templ       .equ    r1                ;
temp        .equ    r2                ;
learndb     .equ    r3                ; learn debouncer
learnt      .equ    r4                ; learn timer
eraset      .equ    r5                ; erase timer
mtemph      .equ    r6                ; memory temp
mtempl      .equ    r7                ; memory temp
mtemp       .equ    r8                ; memory temp
serial      .equ    r9                ; serial data to and from nonvol memory
address     .equ    r10               ; address for the serial nonvol memory
t0ext       .equ    r11               ; timer 0 extend decremented every T0 int
t4ms        .equ    r12               ; 4 mS counter
t125ms      .equ    r13               ; 125mS counter
zzwin       .equ    r14               ;
skipradio   .equ    r15               ; flag to skip the radio read and write if
                                      ; learn or vacation are talking to it

PWM_GROUP   .EQU    40H
dnforce     .equ    r0
upforce     .equ    r1
up_force_hi .equ    r4
up_force_lo .equ    r5
up_force    .equ    rr4
dn_force_hi .equ    r6
dn_force_lo .equ    r7
dn_force    .equ    rr6
force_add_hi .equ   r8
force_add_lo .equ   r9
force_add   .equ    rr8
up_temp     .equ    r10
dn_temp     .equ    r11
pulsewidth  .equ    r12
pwm_count   .equ    r13

DNFORCE     .equ    40H
UPFORCE     .equ    41H
AOBSTEST    .equ    42H
FAULTTIME   .equ    43H
UP_FORCE_HI .equ    44H
UP_FORCE_LO .equ    45H
DN_FORCE_HI .equ    46H
DN_FORCE_LO .equ    47H
PULSEWIDTH  .equ    4CH
PWM_COUNT   .equ    4DH
AOBSF       .equ    4EH
FAULTCODE   .equ    4FH
```

```
RPM_GROUP       .EQU  50H

stackreason     .equ  r0
stackflag       .equ  r1
rpm_temp_hi     .equ  r2
rpm_temp_lo     .equ  r3
rpm_past_hi     .equ  r4
rpm_past_lo     .equ  r5
rpm_past        .equ  rr4
rpm_period_hi   .equ  r6
rpm_period_lo   .equ  r7
rpm_period      .equ  rr6
rpm_count       .equ  r8
rpm_diff_hi     .equ  r9
rpm_diff_lo     .equ  r10
rpm_2past_hi    .equ  r11
rpm_2past_lo    .equ  r12
rpm_set_diff_hi .equ  r13
rpm_set_diff_lo .equ  r14
rpm_time_out    .equ  r15

STACKREASON     .EQU  RPM_GROUP+0
STACKFLAG       .EQU  RPM_GROUP+1
RPM_TEMP_HI     .EQU  RPM_GROUP+2
RPM_TEMP_LO     .EQU  RPM_GROUP+3
RPM_PAST_HI     .EQU  RPM_GROUP+4
RPM_PAST_LO     .EQU  RPM_GROUP+5
RPM_PERIOD_HI   .EQU  RPM_GROUP+6
RPM_PERIOD_LO   .EQU  RPM_GROUP+7
RPM_COUNT       .EQU  RPM_GROUP+8
RPM_DIFF_HI     .EQU  RPM_GROUP+9
RPM_DIFF_LO     .EQU  RPM_GROUP+10
RPM_2PAST_HI    .EQU  RPM_GROUP+11
RPM_2PAST_LO    .EQU  RPM_GROUP+12
RPM_SET_DIFF_HI .EQU  RPM_GROUP+13
RPM_SET_DIFF_LO .EQU  RPM_GROUP+14
RPM_TIME_OUT    .EQU  RPM_GROUP+15


;*****************************************************************
; RADIO GROUP
;*****************************************************************
RADIO_GRP   .equ   60H                ;
RTEMP       .equ   RADIO_GRP          ; radio temp storage
RTEMPH      .equ   RADIO_GRP+1        ; radio temp storage high
RTEMPL      .equ   RADIO_GRP+2        ; radio temp storage low
RTIMEAH     .equ   RADIO_GRP+3        ; radio active time high byte
RTIMEAL     .equ   RADIO_GRP+4        ; radio active time low byte
RTIMEIH     .equ   RADIO_GRP+5        ; radio inactive time high byte
RTIMEIL     .equ   RADIO_GRP+6        ; radio inactive time low byte
RTIMEPH     .equ   RADIO_GRP+7        ; radio past time high byte
RTIMEPL     .equ   RADIO_GRP+8        ; radio past time low byte
RADIO3H     .equ   RADIO_GRP+9        ; 3 mS code storage high byte
```

```
RADIO3L     .equ    RADIO_GRP+10        , 3 mS code storage low byte
RADIO1H     .equ    RADIO_GRP+11        ; 1 mS code storage high byte
RADIO1L     .equ    RADIO_GRP+12        ; 1 mS code storage low byte
RADIOC      .equ    RADIO_GRP+13        ; radio word count
RTIMEDH     .equ    RADIO_GRP+14        ; radio difference of active and inactive
RTIMEDL     .equ    RADIO_GRP+15        ; radio difference
rtemp       .equ    r0                  ; radio temp storage
rtemph      .equ    r1                  ; radio temp storage high
rtempl      .equ    r2                  ; radio temp storage low
rtimeah     .equ    r3                  ; radio active time high byte
rtimeal     .equ    r4                  ; radio active time low byte
rtimeih     .equ    r5                  ; radio inactive time high byte
rtimeil     .equ    r6                  ; radio inactive time low byte
rtimeph     .equ    r7                  ; radio past time high byte
rtimepl     .equ    r8                  ; radio past time low byte
radio3h     .equ    r9                  ; 3 mS code storage high byte
radio3l     .equ    r10                 ; 3 mS code storage low byte
radio1h     .equ    r11                 ; 1 mS code storage high byte
radio1l     .equ    r12                 ; 1 mS code storage low byte
radioc      .equ    r13                 ; radio word count
rtimedh     .equ    r14                 ; radio difference of active and inactive
rtimedl     .equ    r15                 ; radio difference

CHECK_GRP   .equ    70H
check_sum   .equ    r0                  ; check sum pointer
rom_data    .equ    r1
test_adr_hi .equ    r2
test_adr_lo .equ    r3
test_adr    .equ    rr2
CHECK_SUM   .equ    CHECK_GRP+0         ; check sum reg for por
ROM_DATA    .equ    CHECK_GRP+1         ; data read
AUXLEARNSW  .equ    CHECK_GRP+2         ;
RRTO        .equ    CHECK_GRP+3         ;
RPM_ACOUNT  .equ    74H                 ; to test for active rpm
RSCCOUNT    .equ    75H                 ; rs232 byte counter
RSSTART     .equ    76H                 ; rs232 start flag

RADIO_CMD   .equ    77H                 ; radio command
R_DEAD_TIME .equ    78H                 ;
FAULT       .equ    79H                 ;

VACFLAG     .equ    7AH                 ; VACATION mode flag
VACFLASH    .equ    7BH
VACCHANGE   .equ    7CH
TASKSWITCH  .equ    7DH
FORCE_IGNORE .equ   7EH
FORCE_PRE   .equ    7FH
SDISABLE    .equ    80H                 ; system disable timer
PRADIO3H    .equ    81H                 ; 3 mS code storage high byte
PRADIO3L    .equ    82H                 ; 3 mS code storage low byte
PRADIO1H    .equ    83H                 ; 1 mS code storage high byte
PRADIO1L    .equ    84H                 ; 1 mS code storage low byte
RTO         .equ    85H                 ; radio time out
RFLAG       .equ    86H                 ; radio flags
RINFILTER   .equ    87H                 ; radio input filter
```

```
LIGHT1S         .equ    88H             ; light timer for 1second flash
DOG2            .equ    89H             ; second watchdog
FAULTFLAG       .equ    8BH             ; flag for fault blink stops radio blink
MOTDEL          .equ    8CH             ; motor time delay
LIGHTS          .equ    8DH             ; light state
DELAYC          .equ    8EH             ; for the time delay for command
COUNTER         .equ    8FH             ; delay counter

BACKUP_GRP      .equ    90H
ForcedDown      .equ    BACKUP_GRP
BRPM_COUNT      .equ    BACKUP_GRP+1
BRPM_TIME_OUT   .equ    BACKUP_GRP+2
BFORCE_IGNORE   .equ    BACKUP_GRP+3
BAUTO_DELAY_HI  .equ    BACKUP_GRP+4
BAUTO_DELAY_LO  .equ    BACKUP_GRP+5
BAUTO_DELAY     .equ    BACKUP_GRP+4
BCMD_DEB        .equ    BACKUP_GRP+6
BSTATE          .equ    BACKUP_GRP+7

STACKTOP    .equ    238             ; start of the stack
STACKEND    .equ    0A0H            ; end of the stack

;P3         .equ    3               ; port 3
;P2         equ     2               ; port 2
;P0         .equ    0               ; port 0

RS232OS     .equ    01000000B       ; RS232 output bit set
RS232OC     .equ    10111111B       ; RS232 output bit clear
RS232OP     .equ    P3              ; RS232 output port
RS232IP     .equ    P2              ; RS232 input port
RS232IM     .equ    00100000B       ; RS232 mask
csh         .equ    00010000B       ; chip select high for the 93c46
csl         .equ    11101111B       ; chip select low for 93c46
clockh      .equ    00001000B       ; clock high for 93c46
clockl      .equ    11110111B       ; clock low for 93c46
doh         .equ    00000100B       ; data out high for 93c46
dol         .equ    11111011B       ; data out low for 93c46
ledh        .equ    10000000B       ; turn the led pin high "on"
ledl        .equ    01111111B       ; turn the led pin low "off"
psmask      .equ    01000000B       ; mask for the program switch
csport      .equ    P2              ; chip select port
dioport     .equ    P2              ; data i/o port
clkport     .equ    P2              ; clock port
ledport     .equ    P2              ; led port
psport      .equ    P2              ; program switch port

WATCHDOG_GROUP .EQU 0FH
pcon        .equ    r0
smr         .equ    r11
wdtmr       .equ    r15

WDT         .macro
            .byte   5fh
```

```
                .endm

FILL            .macro
                .byte   0FFh
                .endm

TRAP            .macro
                jp      start
                jp      start
                jp      start
                jp      start
                jp      start
                .endm
TRAP10          .macro
                TRAP
                TRAP
                TRAP
                TRAP
                TRAP
                TRAP
                TRAP
                TRAP
                TRAP
                .endm

;*****************************************************************
;*
;*              Interrupt Vector Table
;*
;*****************************************************************

                .org    0000H

                .word   RADIO_INT       ;IRQ0
                .word   000CH           ;IRQ1, P3.3
                .word   RPM             ;IRQ2, P3.1
                .word   AUX_OBS         ;IRQ3, P3.0
                .word   TIMERUD         ;IRQ4, T0
                .word   PWM             ;IRQ5, T1

                .page
                .org    000CH
                jp      START           ; start jmps to start at location 0101 or 0202 ect

;-----------------------------------------------------------------
;               FORCE TABLE
;-----------------------------------------------------------------
force_table_50:
F_0:            .word           107FH
F_1:            .word           107FH
F_2:            .word           109DH
F_3:            .word           10BBH
F_4:            .word           10D9H
```

```
F_5:        .word       10F8H
F_6:        .word       1116H
F_7:        .word       1134H
F_8:        .word       1152H
F_9:        .word       1168H
F_10:       .word       117DH
F_11:       .word       1193H
F_12:       .word       119FH
F_13:       .word       11ABH
F_14:       .word       11B7H
F_15:       .word       11C3H
F_16        .word       11CFH
F_17:       .word       11DFH
F_18:       .word       11E8H
F_19:       .word       11F4H
F_20        .word       1200H
F_21:       word        120CH
F_22:       .word       1218H
F_23:       .word       1224H
F_24:       .word       1230H
F_25:       .word       123CH
F_26:       .word       1248H
F_27:       .word       1254H
F_28:       .word       1260H
F_29:       .word       126CH
F_30:       .word       1278H
F_31:       .word       1284H
F_32:       word        1291H
F_33:       .word       129DH
F_34:       word        12BBH
F_35:       .word       12D9H
F_36:       .word       12F7H
F_37:       word        1315H
F_38:       .word       1333H
F_39:       .word       1352H
F_40:       .word       1370H
F_41:       .word       138EH
F_42        .word       13ACH
F_43:       .word       13CAH
F_44:       .word       1407H
F_45:       .word       1443H
F_46:       .word       147FH
F_47:       .word       14BCH
F_48:       .word       14F8H
F_49        .word       1534H
F_50:       .word       1571H
F_51:       .word       15E9H
F_52:       .word       1626H
F_53:       .word       169EH
F_54:       .word       1717H
F_55:       .word       17D5H
F_56:       .word       1951H
F_57:       .word       1B8DH
F_58:       .word       1E86H
F_59        .word       223EH
F_60        .word       26B4H
```

```
F_61:       .word       2BE9H
F_62:       .word       31DDH
F_63:       .word       388EH
F_64:       .word       388EH

;-------------------------------------------------------------------
;       RS232 DATA ROUTINES
;-------------------------------------------------------------------

;       enter rs232 start with word to output in rs232do

RS232OSTART:
            push    rp                  ; save the rp
            srp     #TIMER_GROUP        ; set the group pointer
            clr     RSSTART             ; one shot
            ld      rs232odelay,#6d     ; set the time delay to 3. mS
            clr     rs232docount        ; start with the counter at 0
            and     RS232OP,#RS232OC    ; clear the output
            jr      NORSOUT             ;

RS232:
            cp      RSSTART,#0FFH       ; test for the start flag
            jr      z,RS232OSTART
RS232OUTPUT:
            push    rp                  ; save the rp
            srp     #TIMER_GROUP        ; set the group pointer
            cp      rs232docount,#11d   ; test for last
            jr      nz,RS232R
            or      RS232OP,#RS232OS    ; set the output idle
            JR      NORSOUT
RS232R:
            djnz    rs232odelay,NORSOUT ; cycle count time delay
            inc     rs232docount        ; set the count for the next cycle
            scf                         ; set the carry flag for stop bits
            rrc     rs232do             ; get the data into the carry
            jr      c,RS232SET          ; if the bit is high then set
            and     RS232OP,#RS232OC    ; clear the output
            jr      SETTIME             ; find the delay time
RS232SET:
            or      RS232OP,#RS232OS    ; set the output
SETTIME:
            ld      rs232odelay,#6d     ; set the data output delay
            tm      rs232docount,#00000001b ; test for odd words
            jr      z,NORSOUT           ; if even done
            ld      rs232odelay,#7d     ; set the delay to 7 for odd
                                        ; this gives 6.5 *.512mS

NORSOUT:
RS232INPUT:
            cp      rs232dicount,#0FFH  ; test  mode
            jr      nz,RECEIVING        ; if receiving then jump
            tm      RS232IP,#RS232IM    ; test the incoming data
            jr      nz,NORSIN           ; if the line is still idle then skip
            clr     rs232dicount        ; start at 0
            ld      rs232idelay,#3      ; set the delay to mid
```

```
RECEIVING:
            djnz    rs232idelay,NORSIN          ; skip till delay is up
            inc     rs232dicount                ; bit counter
            cp      rs232dicount,#10d           ; test for last timeout
            jr      z,DIEVEN
            tm      RS232IP,#RS232IM            ; test the incoming data
            rcf                                 ; clear the carry
            jr      z,SKIPSETTING               ; if input bit not set skip setting carry
            scf                                 ; set the carry
SKIPSETTING:
            rrc     rs232di                     ; save the data into the memory
            ld      rs232idelay,#6d             ; set the delay
            tm      rs232dicount,#00000001b     ; test for odd
            jr      z,NORSIN                    ; if even skip
            ld      rs232idelay,#7              ; set the delay
            jr      NORSIN
DIEVEN.
            ld      rs232dicount,#0FFH          ; turn off the input till next start
            ld      rscommand,rs232di           ; save the value
            clr     RSCCOUNT                    ; clear the counter
NORSIN:
            pop     rp                          ; return the rp
            ret
            FILL
            FILL

;*****************************************************************
; REGISTER INITILIZATION
;*****************************************************************

            .org    0101H                       ; address has both bytes the same
start
START:      di                                  ; turn off the interrupt for init
            ld      RP,#WATCHDOG_GROUP
            ld      wdtmr,#00001111B            ; rc dog 100mS
            WDT                                 ; kick the dog
            clr     RP                          ; clear the register pointer

;*****************************************************************
; PORT INITILIZATION
;*****************************************************************

            ld      P0,#P01S_INIT               ; RESET all ports
            ld      P2,#P2S_INIT-2              ; Set the up limit high , down limit low
            ld      P3,#P3S_INIT                ;
            ld      P01M,#P01M_INIT             ; set mode p00-p03 out p04-p07in
            ld      P3M,#P3M_INIT               ; set port3 p30-p33 input analog mode
                                                ; p34-p37 outputs
            ld      P2M,#(P2M_INIT-3)           ; set port 2 mode setting the limits as
                                                ; outputs for fema of open

;*****************************************************************
;*          Internal RAM Test and Reset All RAM =    mS          *
;*****************************************************************
```

```
                srp     #0F0h                   ; point to control group use stack
                ld      r15,#4                  ;r15= pointer (minimum of RAM)
write_again:
                WDT                             ; KICK THE DOG
                ld      r14,#1
write_again1:
                ld      @r15,r14                ;write 1,2,4,8,10,20,40,80
                cp      r14,@r15                ;then compare
                jr      ne,system_error
                rl      r14
                jr      nc,write_again1
                clr     @r15                    ;write RAM(r5)=0 to memory
                inc     r15
                cp      r15,#240
                jr      ult,write_again

;*****************************************************************************
;               Checksum Test
;*****************************************************************************
CHECKSUMTEST:
                srp     #CHECK_GRP
                ld      test_adr_hi,#0FH
                ld      test_adr_lo,#0FFH       ;maximum address=fffh
add_sum:
                WDT                             ; KICK THE DOG
                ldc     rom_data,@test_adr      ;read ROM code one by one
                add     check_sum,rom_data      ;add it to checksum register
                decw    test_adr                ;increment ROM address
                jr      nz,add_sum              ;address=0 ?
                cp      check_sum,#check_sum_value
                jr      z,system_ok             ;check final checksum = 00 ?
system_error:
                and     ledport,#ledl           ; turn on the LED to indicate fault
                jr      system_error

                .byte   256-check_sum_value
system_ok:

                WDT                             ; kick the dog

                ld      STACKEND,#STACKTOP      ; start at the top of the stack
SETSTACKLOOP:
                ld      @STACKEND,#01H          ; set the value for the stack vector
                dec     STACKEND                ; next address
                cp      STACKEND,#STACKEND      ; test for the last address
                jr      nz,SETSTACKLOOP         ; loop till done

CLEARDONE:


                ld      STATE,#06d              ; set the state to stop
                ld      BSTATE,#06d             ;
                ld      STATUS,#CHARGE          ; set start to charge
```

```
ld      SWITCH_DELAY,#CMD_DEL_EX        ; set the delay time to cmd
ld      LIGHT_TIMER_HI,#SET_TIME_HI     ; set the light period
ld      LIGHT_TIMER_LO,#SET_TIME_LO     ; for the 4.5 min timer
ld      PRE_LIGHT,#SET_TIME_PRE         ;
ld      PULSEWIDTH,#MIN_COUNT   ; set init
ld      PWM_COUNT,#TOTAL_PWM_COUNT;
id      RPMONES,#244d                   ; set the hold off
id      RS232DOCOUNT,#11D               ; turn off the rs232 output
srp     #LEARNEE_GRP                    ;
ld      learndb,#0FFH                   ; set the learn debouncer
ld      zzwin,learndb                   ; turn off the learning
ld      CMD_DEB,learndb                 ; in case of shorted switches
ld      BCMD_DEB,learndb                ; in case of shorted switches
ld      VAC_DEB,learndb                 ;
ld      LIGHT_DEB,learndb               ;
ld      ERASET,learndb                  ; set the erase timer
ld      learnt,learndb                  ; set the learn timer
ld      RTO,learndb                     ; set the radio time out
ld      AUXLEARNSW,learndb              ; turn off the aux learn switch
ld      RRTO,learndb                    ; set the radio timer

;*****************************************************************
; STACK INITILIZATION
;*****************************************************************

        clr     254
        ld      255,#238D               ; set the start of the stack

;*****************************************************************
; TIMER INITILIZATION
;*****************************************************************

        ld      PRE0,#00001001B         ; set the prescaler to / 2 for 8Mhz
        ld      PRE1,#01000010B         ; one shot mode /16
        ld      T0,#000H                ; set the counter to count FF through 0
        ld      T1,MIN_COUNT            ; set init count
        ld      TMR,#00000011B          ; turn on the timer

;*****************************************************************
; PORT INITILIZATION
;*****************************************************************

        ld      P0,#P01S_INIT           ; RESET all ports
        id      P2,#P2S_INIT            ;
        ld      P3,#P3S_INIT            ;
        id      P01M,#P01M_INIT         ; set mode p00-p03 out p04-p07in
        ld      P3M,#P3M_INIT           ; set port3 p30-p33 input analog mode
                                        ; p34-p37 outputs
        ld      P2M,#(P2M_INIT+0)       ; set port 2 mode

;*****************************************************************
; READ THE MEMORY 2X AND GET THE VACFLAG
;*****************************************************************

        ld      SKIPRADIO,#0FFH         ;
        ld      ADDRESS,#1EH            ; set non vol address to the VAC flag
```

```
                call    READMEMORY              ; read the value 2X 1X INIT 2ND read
                call    READMEMORY              ; read the value
                ld      VACFLAG,MTEMPH          ; save into volital
                clr     SKIPRADIO

;*****************************************************************
; INITERRUPT INITILIZATION
;*****************************************************************
SETINTERRUPTS:
                ld      IPR,#00011010B          ; set the priority to timer
                ld      IMR,#ALL_ON_IMR         ; turn on the interrupt
                ld      IRQ,#01000000B          ; set the edge clear int
                ei                              ; enable interrupt

;*****************************************************************
; RESET SYSTEM REG
;*****************************************************************

                ld      RP,#WATCHDOG_GROUP
                ld      smr,#00100010B          ; reset the xtal / number
                ld      pcon,#01111110B         ; reset the pcon no comparator output
                                                ; no low emi mode
                ld      PRE0,#00001001B         ; set the prescaler to / 2 for 8Mhz
;               ld      RS232DO,#0BBH           ; set the rs232 data
;               ip      VACSWOPEN               ; start the transmission

;*****************************************************************
; MAIN LOOP
;*****************************************************************
MAINLOOP:
                clr     DOG2                    ; clear the second watchdog
                ld      P01M,#P01M_INIT         ; set mode p00-p03 out p04-p07in
                ld      P3M,#P3M_INIT           ; set port3 p30-p33 input analog mode
                                                ; p34-p37 outputs
                ld      P2M,#(P2M_INIT+0)       ; set port 2 mode
                cp      VACCHANGE,#0AAH         ; test for the vacation change flag
                jr      nz,NOVACCHG             ; if no change the skip
                cp      VACFLAG,#0FFH           ; test for in vacation
                jr      z,MCLEARVAC             ; if in vac clear
                ld      VACFLAG,#0FFH           ; set vacation
                jr      SETVACCHANGE            ; set the change
MCLEARVAC:
                clr     VACFLAG                 ; clear vacation mode
SETVACCHANGE:
                clr     VACCHANGE               ; one shot
                ld      SKIPRADIO,#0FFH         ; set skip flag
                ld      ADDRESS,#1EH            ; set the non vol address to the VAC flag
                ld      MTEMPH,VACFLAG          ; store the vacation flag
                ld      MTEMPL,VACFLAG          ;
                call    WRITEMEMORY             ; write the value
                clr     SKIPRADIO               ; clear skip flag
NOVACCHG:
```

```
                cp      STACKFLAG,#0FFH   ; test for the change flag
                jr      nz,NOCHANGEST     ; if no change skip updating

                srp     #LEARNEE_GRP      ; set the register pointer
                clr     STACKFLAG         ; clear the flag
                ld      SKIPRADIO,#0FFH   ; set skip flag
                ld      address,#1CH      ; set the non vol address to the cycle c
                call    READMEMORY        ; read the value
                inc     mtempl            ; increase the counter lower byte
                jr      nz,COUNTER1DONE   ;
                inc     mtemph            ; increase the counter high byte
                jr      nz,COUNTER2DONE   ;
                call    WRITEMEMORY       ; store the value
                inc     address           ; get the next bytes
                call    READMEMORY        ; read the data
                inc     mtempl            ; increase the counter low byte
                jr      nz,COUNTER2DONE   ;
                inc     mtemph            ; increase the vounter high byte
COUNTER2DONE:
                call    WRITEMEMORY       ; save the value
                ld      address,#1CH      ;
                call    READMEMORY        ; read the data

                and     mtemph,#00001111B ; find the force address
                or      mtemph,#30H       ;
                ld      ADDRESS,MTEMPH    ; set the address
                ld      mtempl,DNFORCE    ; read the forces
                ld      mtemph,UPFORCE    ;
                call    WRITEMEMORY       ; write the value
                jr      CDONE             ; done set the back trace
COUNTER1DONE:
                call    WRITEMEMORY       ; got the new address
CDONE:
                ld      address,#1CH      ; get the first byte
                call    READMEMORY        ;
                and     mtempl,#00001111b ; find the address
                ld      address,#20H      ;
                add     address,mtempl    ;
                ld      mtemph,STACKREASON        ;
                or      mtemph,STATE              ; or in the state
                call    WRITEMEMORY       ; write the value to stack
                clr     SKIPRADIO         ; clear skip flag

NOCHANGEST:
                call    LEARN             ; do the learn switch
                di
                cp      BRPM_COUNT,RPM_COUNT
                jr      z,TESTRPM
RESET:
                jp      START
TESTRPM:
                cp      BRPM_TIME_OUT,RPM_TIME_OUT
                jr      nz,RESET
                cp      BFORCE_IGNORE,FORCE_IGNORE
                jr      nz,RESET
                ei
```

```
                di
                cp      BAUTO_DELAY_HI,AUTO_DELAY_HI
                jr      nz,RESET
                cp      BAUTO_DELAY_LO,AUTO_DELAY_LO
                jr      nz,RESET
                cp      BCMD_DEB,CMD_DEB
                jr      nz,RESET
                cp      BSTATE,STATE
                jr      nz,RESET
                ei
TESTRS232:
                cp      RSSTART,#0FFH           ; test for starting a transmission
                jr      z,skiprs232             ; if starting a trans skip
                cp      RSCOMMAND,#0FFH         ; test for the off mode
                jr      z,skiprs232
                cp      RS232DOCOUNT,#11d       ; test for output done
                jr      nz,skiprs232            ; if not the skip
                cp      RSCOMMAND,#30H          ; test for switch data
                jr      nz,TEST31
                clr     RS232DO                 ; clear the data

                tm      p2,#UP_LIMIT            ; test for up limit
                jr      nz,UPLIMOPEN
                or      RS232DO,#00000001B      ; set the marking bit
UPLIMOPEN:
                tm      p2,#DN_LIMIT            ; test for the down limit
                jr      nz,DNLIMOPEN            ;
                or      RS232DO,#00000010B      ; set the marking bit
DNLIMOPEN:
                cp      CMD_DEB,#0FFH           ; test for the command set
                jr      nz,CMDSWOPEN
                or      RS232DO,#00000100B      ; set the marking bit
CMDSWOPEN:
                cp      LIGHT_DEB,#0FFH         ; test for the worklight set
                jr      nz,WLSWOPEN
                or      RS232DO,#00001000B      ; set the marking bit
WLSWOPEN
                cp      VAC_DEB,#0FFH           ; test fir the vacation set
                jr      nz,VACSWOPEN            ;
                or      RS232DO,#00010000B      ; set the marking bit
VACSWOPEN:
                dec     RSSTART                 ; set the start flag
                ld      RSCOMMAND,#0FFH         ; turn off command
                                                ; return
skiprs232:
                jp      SKIPRS232

TEST31:
                cp      RSCOMMAND,#31H          ; test for status data
                jr      nz,TEST32
                ld      RS232DO,STATE           ; read the state
                cp      LEARNT,#0FFH            ; test for learn mode
                jr      z,NOTINLEARN
                or      RS232DO,#00010000B      ;
NOTINLEARN:
                cp      VACFLAG,#00H            ; test the vacation flag
```

```
                jr      z,NOTINVACATION
                or      RS232DO,#00100000B      ;
NOTINVACATION:
                tm      p0,#WORKLIGHT           ; test for the light on
                jr      z,LIGHTISOFF
                or      RS232DO,#01000000B      ; mark the bit
LIGHTISOFF:
                tm      AOBSF,#00000001B        ; test for aobs error
                jr      z,AOBSFINE
                or      RS232DO,#10000000B      ;
AOBSFINE:
                jr      VACSWOPEN

TEST32:
                cp      RSCOMMAND,#32H          ; test for rpm data
                jr      nz,TEST33
                ld      RS232DO,RPM_PERIOD_LO   ;
                cp      RSCCOUNT,#01H           ; test for on transmitted last cycle
                jr      z,LASTRPM
                ld      RS232DO,RPM_PERIOD_HI   ;
STARTOUT:
                dec     RSSTART                 ; set the start flag
                inc     RSCCOUNT                ; increase the count
                jr      skiprs232               ; return
LASTRPM:        clr     RSCCOUNT                ; reset the counter
                jp      VACSWOPEN               ; return

TEST33:
                cp      RSCOMMAND,#33H          ; test for force data
                jr      nz,TEST34
                ld      RS232DO,UPFORCE         ;
                cp      RSCCOUNT,#00            ; test for the first byte
                jr      z,STARTOUT              ; output
                ld      RS232DO,DNFORCE
                jr      LASTRPM                 ; output

TEST34:
                cp      RSCOMMAND,#34H          ; test for radio page
                jr      nz,TEST35
                ld      RS232PAGE,#00H          ;
                jr      RS232PAGEOUT
TEST35:
                cp      RSCOMMAND,#35H          ; test for force page data
                jr      nz,TEST36
                ld      RS232PAGE,#10H          ;
                jr      RS232PAGEOUT
TEST36:
                cp      RSCOMMAND,#36H          ; test for history page 1data
                jr      nz,TEST37
                ld      RS232PAGE,#20H          ;
                jr      RS232PAGEOUT
TEST37:
                cp      RSCOMMAND,#37H          ; test for history page 2 data
                jr      nz,TEST38
```

```
                ld      RS232PAGE,#30H

RS232PAGEOUT:
                ld      SKIPRADIO,#0FFH         ; set the skip radio flag
                ld      ADDRESS,RSCCOUNT        ; find the address
                rcf
                rrc     ADDRESS                 ;
                or      ADDRESS,RS232PAGE       ;
                call    READMEMORY              ; read the data
                ld      RS232DO,MTEMPH
                tm      RSCCOUNT,#01H           ; test which byte
                jr      z,RPBYTE
                ld      RS232DO,MTEMPL
RPBYTE:
                clr     SKIPRADIO               ; turn off the skip radio
                cp      RSCCOUNT,#1FH           ; test for the end
                jp      z,LASTRPM
                jp      STARTOUT

TEST38:
                cp      RSCOMMAND,#38H          ; test memory
                jr      nz,TEST39
                ld      RS232DO,#0FFH           ; flag set to error to start
                ld      SKIPRADIO,#0FFH         ; set the skip radio flag
                ld      MTEMPH,#0FFH            ; set the data to write
                ld      MTEMPL,#0FFH            ;
                ld      ADDRESS,#00             ; start at address 00
WRITELOOP1:
                WDT
                call    WRITEMEMORY             ;
                inc     ADDRESS                 ; do the next address
                cp      ADDRESS,#40H            ; test for the last address
                jr      nz,WRITELOOP1
                ld      ADDRESS,#00             ; start at address 0
READLOOP1:
                WDT
                call    READMEMORY              ; read the data
                inc     MTEMPH                  ; test the high
                jr      nz,MEMORYERROR          ; if error mark
                inc     MTEMPL                  ; test the low
                jr      nz,MEMORYERROR          ; if error mark
                inc     ADDRESS                 ; set the next address
                cp      ADDRESS,#40H            ; test for the last address
                jr      nz,READLOOP1

                ld      MTEMPH,#000H            ; set the data to write
                ld      MTEMPL,#000H            ;
                ld      ADDRESS,#00             ; start at address 00
WRITELOOP2:
                WDT
                call    WRITEMEMORY             ;
                inc     ADDRESS                 ; do the next address
                cp      ADDRESS,#40H            ; test for the last address
                jr      nz,WRITELOOP2
                ld      ADDRESS,#00             ; start at address 0
READLOOP2:
```

```
                WDT
                call    READMEMORY              ; read the data
                cp      MTEMPH,#00              ; test the high
                jr      nz,MEMORYERROR          ; if error mark
                cp      MTEMPL,#00              ; test the low
                jr      nz,MEMORYERROR          ; if error mark
                inc     ADDRESS                 ; set the next address
                cp      ADDRESS,#40H            ; test for the last address
                jr      nz,READLOOP2
                call    CLEARCODES
                clr     SKIPRADIO               ; clear the skip radio flag
                clr     RS232DO                 ; flag all ok
MEMORYERROR:
                jp      VACSWOPEN
TEST39:
                cp      RSCOMMAND,#39H          ; test memory
                jr      nz,SKIPRS232
                ld      RSCOMMAND,#0FFH         ; turn off command
                call    SETLEARN
SKIPRS232:
                cp      R_DEAD_TIME,#20     ; test for too long dead
                jp      nz,MAINLOOP         ; if not loop
                clr     RADIOC              ; clear the radio counter
                clr     RFLAG               ; clear the radio flag
                jp      MAINLOOP            ; loop forever


;*****************************************************************
; Radio interrupt from a edge of the radio signal
;*****************************************************************

RADIO_INT:
                push    RP                  ; save the radio pair
                srp     #RADIO_GRP          ; set the register pointer

                ld      rtemph,T0EXT        ; read the upper byte
                ld      rtempl,T0           ; read the lower byte
                tm      IRQ,#00010000B      ; test for pending int
                jr      z,RTIMEOK           ; if not then ok time
                tm      rtempl,#10000000B   ; test for timer reload
                jr      z,RTIMEOK           ; if not reloaded then ok
                dec     rtemph              ; if reloaded then dec high for sync
RTIMEOK:
                clr     R_DEAD_TIME         ; clear the dead time
                and     IMR,#11111110B      ; turn off the radio interrupt
                ld      rtimedh,rtimeph     ; find the difference
                ld      rtimedl,rtimepl     ;
                sub     rtimedl,rtempl      ;
                sbc     rtimedh,rtemph      ; in the past time and the past time in temp
                tm      rtimedh,#10000000B  ; test for a negitive number
                jr      z,RTIMEDONE         ; if the number is not negitive then done
                ld      rtimedh,rtemph      ; find the difference
                ld      rtimedl,rtempl      ;
```

```
                sub     rtimedl,rtimepl         ;
                sbc     rtimedh,rtimeph         ; in the past time and the past time in temp
RTIMEDONE:
                tm      P3,#00000100B           ; test the port for the edge
                jr      nz,ACTIVETIME           ; if it was the active time then branch
INACTIVETIME:
                cp      RINFILTER,#0FFH         ; test for active last time
                jr      z,GOINACTIVE            ; if so continue
                jr      RADIO_EXIT              ; if not the return
GOINACTIVE:
                or      IRQ,#01000000B          ; set the bit setting direction to pos edge
                clr     RINFILTER               ; set flag to inactive
                ld      rtimeih,rtimedh         ; transfer difference to inactive
                ld      rtimeil,rtimedl         ;
                ld      rtimeph,rtemph          ; transfer temp into the past
                ld      rtimepl,rtempl          ;
                jr      RADIO_EXIT              ; return
ACTIVETIME:
                cp      RINFILTER,#00H          ; test for active last time
                jr      z,GOACTIVE              ; if so continue
                jr      RADIO_EXIT              ; if not the return
GOACTIVE:
                and     IRQ,#00111111B          ; clear the bit setting direction to neg edge
                ld      RINFILTER,#0FFH         ;
                ld      rtimeah,rtimedh         ; transfer difference to active
                ld      rtimeal,rtimedl         ;
                ld      rtimeph,rtemph          ; transfer temp into the past
                ld      rtimepl,rtempl          ;
                ei
                cp      radioc,#00H             ; test for blank time
                jr      nz,INSIGNAL             ; if the count is not zero then we are in signal
MEASUREBLANK:
                cp      rtimeih,#110D           ; test the timer for > 55mS
                jp      ugt,CLEARRADIO          ; if > 55 then clear the radio
                cp      rtimeih,#40D            ; test the timer for < 20mS
                jp      ult,CLEARRADIO          ; if < 20mS then clear the radio
                cp      rtimeah,#03H            ; test the sync pulse for a 3mS period first > 1
                jr      ugt SETREC3MS           ; if 2mS or greater then 3mS sync code
                jr      nz,SETREC1MS            ; if less then 1 then it is a 1mS sync code
                cp      rtimeal,#09DH           ; test for 1.85 "middle value 2"
                jr      ugt,SETREC3MS           ; if greater then set a 3
SETREC1MS:
                tm      RFLAG,#00010000B        ; test for the reception of the 1mS code
                jr      z,SETFIRST1MS           ; if the bit is not set then this is the first 1ms
                and     RFLAG,#10111111B        ; clear the flag so writing into 3mS word
                or      RFLAG,#00100000B        ; set the flag saying 2nd 1mS word
                clr     radio3h                 ; clear the last reception
                clr     radio3l                 ;
                jr      INCCOUNT                ; then inc the count for insignal
SETFIRST1MS:
                or      RFLAG,#01000000B        ; set the flag for the first 1mS word
                clr     radio1h                 ; clear the last reception
                clr     radio1l                 ;
                jr      INCCOUNT                ; then inc the count for insignal
SETREC3MS:
                and     RFLAG,#10111111B        ; clear the flag so writing into 3mS word
```

```
                clr     radio3h         ; clear the last reception
                clr     radio3l         ;
INCCOUNT:
                inc     radioc          ; set the counter to the next word
                jr      RADIO_EXIT

RADIO_EXIT:     pop     RP              ; reset the register pair
                iret

INSIGNAL:
                cp      rtimeah,#9D     ; test the radio pulse width for 4.5mS
                jp      ugt,CLEARRADIO  ; if greater then 4.5 then clear the radio
PULSEWOK:
                cp      rtimeih,#9D     ; test the radio blank width for 4.5mS
                jp      ugt,CLEARRADIO  ; if greater then 4.5 then clear the radio
BLANKWOK:
                ld      rtemph,rtimeih  ; transfer pulse time to temp reg
                ld      rtempl,rtimeil  ;
                sub     rtempl,rtimeal  ; subtract the pulse from the blank
                sbc     rtemph,rtimeah  ;
                jr      c,NEGDIFF       ; if the difference is negitive then branch
                cp      rtemph,#01H     ; test for a number 1
                jr      ugt,SETTO0      ; if greater then set 0
                jr      ult,SETTO1      ; if less then 1 set to 1
                tm      rtempl,#10000000B ; test for 80 or greater
                jr      z,SETTO1        ; if the diff is less then 80h
                jr      SETTO0          ; else set to a zero
NEGDIFF:
                ld      rtemph,rtimeah  ; transfer pulse time to temp reg
                ld      rtempl,rtimeal  ;
                sub     rtempl,rtimeil  ; subtract the pulse from the blank
                sbc     rtemph,rtimeih  ;
                cp      rtemph,#01H     ; test for a number 1
                jr      ugt,SETTO2      ; if greater then set 2
                jr      ult,SETTO1      ; if less then 1 set to 1
                tm      rtempl,#10000000B ; test for 80 or greater
                jr      z,SETTO1        ; if the diff is less then 80h one
                jr      SETTO2          ; else set to a two
SETTO0:
                ld      RTEMP,#00D      ; set the bit value to a 00
                jr      INCRECORD       ; goto adding into the record
SETTO1:
                ld      RTEMP,#01D      ; set the bit value to a 01
                jr      INCRECORD       ; goto adding into the record
SETTO2:
                ld      RTEMP,#02D      ; set the bit value to a 10
                jr      INCRECORD       ; goto adding into the record

INCRECORD:
                tm      RFLAG,#01000000B ; test the radio flag for the area to be modifing
                jr      z,MS3RECORD     ; if the bit is cleared then working the 3ms
                ld      rtemph,radio1h  ; transfer the record to temp
                ld      rtempl,radio1l  ;
                add     radio1l,rtempl  ; add the number to it self 2* for for base 3
                adc     radio1h,rtemph  ;
                add     radio1l,rtempl  ;
```

4-36

```
                adc     radio1h,rtemph      ;
                add     radio1l,rtemp       ;
                adc     radio1h,#00h        ;
                inc     radioc              ; increase the radio counter
                cp      radioc,#11D         ; test for the last bit
                jr      z,GOTAWORD          ; if so we got a word
                jp      ugt,CLEARRADIO      ; else garbage
                jr      RADIO_EXIT          ; else return till the next bit comes along
MS3RECORD:
                ld      rtemph,radio3h      ; transfer the record to temp
                ld      rtempl,radio3l      ;
                add     radio3l,rtempl      ; add the number to it self 2* for for base 3
                adc     radio3h,rtemph      ;
                add     radio3l,rtempl      ;
                adc     radio3h,rtemph      ;
                add     radio3l,rtemp       ; add in the new value
                adc     radio3h,#00D        ;
                inc     radioc              ; increase the radio counter
                cp      radioc,#11D         ; test for the last bit
                jr      z,GOTAWORD          ; if so we got a word
                jp      RADIO_EXIT          ; else return till the next bit comes along
GOTAWORD:
                tm      RFLAG,#01000000B    ; test the radio flag for the area we just modifing
                jr      z,MARK3REC          ; if the bit is cleared then the 3ms is filled
                or      RFLAG,#00010000B    ; set the flag
                jr      TESTFORTWO          ; jump to test for two codes
MARK3REC:
                or      RFLAG,#00001000B    ; set the flag
                jr      TESTFORTWO          ; jump to test for two codes
DONEONE:
                clr     radioc              ; clear the radio counter
                jp      RADIO_EXIT          ; return
TESTFORTWO:
                tm      RFLAG,#00010000B    ; test for the 1mS word
                jr      z,DONEONE           ; we just have one code done
                tm      RFLAG,#00001000B    ; test for the 3mS word
                jr      z,DONEONE           ; we just have one code done
                tm      RFLAG,#00100000B    ; test the flag for BC
                jr      z,KNOWCODE          ; if A code we do nothing
                or      RFLAG,#00000010B    ; set the B and C flag
                cp      rtemp,#00           ; test word 10 for a 0 "C" code
                jp      z,KNOWCODE          ; if a C code were done
                or      RFLAG,#00000100B    ; set the B code flag
brec:
                cp      ZZWIN,#64D          ; test for 8 seconds from known B code
                jr      ugt,KNOWCODE        ; if not skip test
                cp      STATE,#6            ; test for the stopped state
                jr      z,timezzwin         ; if stopped test zzwin
                cp      STATE,#5            ; test for the down limit
                jr      z,timezzwin         ; if at the down limit
                cp      STATE,#2            ; test for at up limit,
                jr      z,timezzwin         ; if at the limit jump
                jr      KNOWCODE            ; else no way
timezzwin:
```

```
                cp      radio3h,#90H        ; test for the 00 code
                jr      nz,KNOWCODE         ;
                cp      radio3l,#29H        ; test for the 00 code
                jr      nz,KNOWCODE         ;
;SETFB:
                push    RP
                srp     #LEARNEE_GRP
                call    SETLEARN
                pop     RP
                jp      CLEARRADIO
KNOWCODE:
                clr     RRTO                ; clear the got a radio flag
                cp      SKIPRADIO,#0FFH     ; test for the skip flag
                jp      z,CLEARRADIO        ; if skip flag is active then donot look at EE mem

                ld      ADDRESS,#1EH        ; set the non vol address to the VAC flag
                call    READMEMORY          ; read the value
                ld      VACFLAG,MTEMPH      ; save into volital
                cp      LEARNT,#0FFH        ; test for in learn mode
                jr      z,TESTCODE          ; if out of learn mode then test for matching
STORECODE:
                cp      PRADIO1H,radio1h    ; test for the match
                jr      nz,STORENOTMATCH    ; if not a match then loop again
                cp      PRADIO1L,radio1l    ; test for the match
                jr      nz,STORENOTMATCH    ; if not a match then loop again
                cp      PRADIO3H,radio3h    ; test for the match
                jr      nz,STORENOTMATCH    ; if not a match then loop again
                cp      PRADIO3L,radio3l    ; test for the match
                jr      nz,STORENOTMATCH    ; if not a match then loop again
                call    TESTCODES           ; test the code to see if in memory now
                cp      ADDRESS,#0FFH       ;
                jr      nz,NOWRITESTORE     ; if there is a match pretend to store

STOREMATCH:
                tm      RFLAG,#00000100B    ; test for the b code
                jr      nz,BCODE            ; if a B code jump
                tm      RFLAG,#00000010B    ; test for a C code
                jr      nz,CCODE            ; if a C code jump
ACODE:
                ld      ADDRESS,#1FH        ; set the address to read the last written
                call    READMEMORY          ; read the memory
                inc     MTEMPH              ; add 2 to the last written
                inc     MTEMPH              ;
                and     MTEMPH,#11111110B   ; set the address on a even number
                cp      MTEMPH,#17H         ; test for the last address
                jr      ult,GOTAADDRESS     ; if not the last address jump
                ld      MTEMPH,#00D         ; set the address to 0
GOTAADDRESS:
                ld      ADDRESS,#1FH        ; set the address to write the last written
                ld      RTEMP,MTEMPH        ; save the address
                LD      MTEMPL,MTEMPH       ; both bytes same
                call    WRITEMEMORY         ; write it
                ld      ADDRESS,rtemp       ; set the address
                jr      READYTOWRITE        ;
BCODE:
                cp      radio3h,#90H        ; test for the 00 code
```

```
                jr      nz,BCODEOK          ;
                cp      radio3l,#29H        ; test for the 00 code
                jr      nz,BCODEOK          ;
                jp      CLEARRADIO          ; SKIP MAGIC NUMBER
BCODEOK:
                ld      ADDRESS,#18H        ; set the address for the B code
                jr      READYTOWRITE        ;
CCODE:
                ld      ADDRESS,#1AH        ; set the address for the C code
READYTOWRITE:
                call    WRITECODE           ; write the code in radio1 and radio3
NOWRITESTORE:
                xor     p0,#WORKLIGHT       ; toggle light
                or      ledport,#ledh       ; turn off the LED for program mode
                ld      LIGHT1S,#244D       ; turn on the 1 second blink
                ld      LEARNT,#0FFH        ; set learnmode timer
                clr     RTO                 ; disallow cmd from learn
                jp      CLEARRADIO          ; return
STORENOTMATCH:
                ld      PRADIO1H,radio1h    ; transfer radio into past
                ld      PRADIO1L,radio1l    ;
                ld      PRADIO3H,radio3h    ;
                ld      PRADIO3L,radio3l    ;
                jp      CLEARRADIO          ; get the next code


TESTCODE:
                cp      FAULTFLAG,#0FFH     ; test for a active fault
                jr      z,FS1               ; if a avtive fault skip led set and reset
                and     ledport,#ledl       ; turn on the LED for flashing from signal
FS1:
                call    TESTCODES           ; test the codes
                cp      FAULTFLAG,#0FFH     ; test for a active fault
                jr      z,FS2               ; if a avtive fault skip led set and reset
                or      ledport,#ledh       ; turn off the LED for flashing from signal
FS2:
                cp      ADDRESS,#0FFH       ; test for the not matching state
                jr      nz,GOTMATCH         ; if matching the send a command if needed
                jp      CLEARRADIO          ; else clear the radio
GOTMATCH:
                or      RFLAG,#00000001B    ; set the flag for recieving without error
                cp      RTO,#101D           ; test for the timer time out
                jr      ult,NOTNEWMATCH     ; if the timer is active then donot reissue cmd
TESTVAC:
                cp      VACFLAG,#00B        ; test for the vacation mode
                jr      z,TSTSDISABLE       ; if not in vacation mode test the system disable

                cp      ADDRESS,#19H        ; test for the B code
                jr      nz,NOTNEWMATCH      ; if not a B not a match
TSTSDISABLE:
                cp      SDISABLE,#32D       ; test for 4 second
                jr      ult,NOTNEWMATCH     ; if 6 s not up not a new code
                clr     RTO                 ; clear the radio timeout
                cp      ONEP2,#00           ; test for the 1.2 second time out
                jr      nz,NOTNEWMATCH      ; if the timer is active then skip the command
```

```
RADIOCOMMAND:
                clr     RTO                     ; clear the radio timeout
                cp      ADDRESS,#19H            ; test for a B code
                jr      nz,BDONTSET             ; if not a b code donot set flag
zzwinclr:
                clr     ZZWIN                   ; flag got matching B code

                ld      BCODEFLAG,#077H         ; flag for aobs bypass
BDONTSET:

                clr     LAST_CMD                ; mark the last command as radio
                ld      RADIO_CMD,#0AAH         ; set the radio command
                jr      CLEARRADIO              ; return
TESTCODES:
                clr     ADDRESS                 ; start address is 0
NEXTCODE:
                call    READMEMORY              ; read the word at this address
                cp      MTEMPH,radio1h          ; test for the match
                jr      nz,NOMATCH              ; if not matching then do next address
                cp      MTEMPL,radio1l          ; test for the match
                jr      nz,NOMATCH              ; if not matching then do next address
                inc     ADDRESS                 ; set the second half of the code
                call    READMEMORY              ; read the word at this address
                cp      MTEMPH,radio3h          ; test for the match
                jr      nz,NOMATCH2             ; if not matching then do the next address
                cp      MTEMPL,radio3l          ; test for the match
                jr      nz,NOMATCH2             ; if not matching then do the next address
                ret                             ; return with the address of the match
NOMATCH:
                inc     ADDRESS                 ; set the address to the next code
NOMATCH2:
                inc     ADDRESS                 ; set the address to the next code
                cp      ADDRESS,#1CH            ; test for the last address
                jr      ult,NEXTCODE            ; if not the last address then try again
GOTNOMATCH:
                ld      ADDRESS,#0FFH           ; set the no match flag
                ret                             ; and return

NOTNEWMATCH:
                clr     RTO                     ; reset the radio time out
                and     RFLAG,#00000001B        ; clear radio flags leaving recieving w/o error
                clr     radioc                  ; clear the radio bit counter
                ld      LEARNT,#0FFH            ; set the learn timer "turn off" and backup
                jp      RADIO_EXIT              ; return
CLEARRADIO:
                and     IRQ,#00111111B          ; clear the bit setting direction to neg edge
                ld      RINFILTER,#0FFH         ; set flag to active
CLEARRADIOA:
                tm      RFLAG,#00000001B        ; test for receiving without error
                jr      z,SKIPRTO               ; if flag not set then donot clear timer
                clr     RTO                     ; clear radio timer
SKIPRTO:
```

```
                clr     radioc          ; clear the radio counter
                clr     RFLAG           ; clear the radio flag
                jp      RADIO_EXIT      ; return

;*****************************************************************
; LEARN DEBOUNCES THE LEARN SWITCH 80mS
; TIMES OUT THE LEARN MODE 30 SECONDS
; DEBOUNCES THE LEARN SWITCH FOR ERASE 6 SECONDS
;*****************************************************************
;
LEARN:
                srp     #LEARNEE_GRP    ; set the register pointer
                cp      STATE,#DN_POSITION ; test for motor stoped
                jr      z,TESTLEARN     ;
                cp      STATE,#UP_POSITION ; test for motor stoped
                jr      z,TESTLEARN     ;
                cp      STATE,#STOP     ; test for motor stoped
                jr      z,TESTLEARN     ;
                ld      learnt,#0FFH    ; set the learn timer
                cp      learnt,#240D    ; test for the learn 30 second timeout
                jr      nz,ERASETEST    ; if not then test erase
                jr      learnoff        ; if 30 seconds then turn off the learn mode
TESTLEARN:
                cp      learndb,#236D   ; test for the debounced release
                jr      nz,LEARNNOTRELEASED ; if the debouncer not released then jump

                clr     learndb         ; clear the debouncer

                ret                     ; return

LEARNNOTRELEASED:
                cp      learnt,#0FFH    ; test for learn mode
                jr      nz,INLEARN      ; if in learn jump
                cp      learndb,#20D    ; test for debounce period
                jr      nz,ERASETEST    ; if not then test the erase period
SETLEARN:
                clr     learnt          ; clear the learn timer
                ld      learndb,#0FFH   ; set the debouncer
                and     ledport,#ledi   ; turn on the led
                clr     VACFLAG         ; clear vacation mode
                ld      address,#1EH    ; set the non vol address for vacation
                clr     mtemph          ; clear the data for cleared vacation
                clr     mtempl          ;
                ld      skipradio,#0FFH ; set the flag
                call    WRITEMEMORY     ; write the memory
                clr     skipradio       ; clear the flag
ERASETEST:
                cp      learndb,#0FFH   ; test for learn button active
                jr      nz,ERASERELEASE ; if button released set the erase timer
                cp      eraset,#0FFH    ; test for timer active
                jr      nz,ERASETIMING  ; if the timer active jump
                clr     eraset          ; clear the erase timer
ERASETIMING:
                cp      eraset,#48D     ; test for the erase period
                jr      z,ERASETIME     ; if timed out the erase
                ret                     ; else we return
```

67

68

```
ERASETIME.
                or      ledport,#ledh           ; turn off the led
                ld      skipradio,#0FFH         ; set the flag to skip the radio read
                call    CLEARCODES              ; clear all codes in memory
                clr     skipradio               ; reset the flag to skip radio

                ld      learnt,#0FFH            ; set the learn timer
                ret                             ; return

ERASERELEASE:
                ld      erasel,#0FFH            ; turn off the erase timer
                ret                             ; return

INLEARN.
                cp      learndb,#20D            ; test for the debounce period
                jr      nz,TESTLEARNTIMER       ; if not then test the learn timer for time out
                ld      learndb,#0FFH           ; set the learn db
TESTLEARNTIMER:
                cp      learnt,#240D            ; test for the learn 30 second timeout
                jr      nz,ERASETEST            ; if not then test erase
learnoff:
                or      ledport,#ledh           ; turn off the led
                ld      learnt,#0FFH            ; set the learn timer
                ld      learndb,#0FFH           ; set the learn debounce
                jr      ERASETEST               ; test the erase timer


;*****************************************************************
; WRITE WORD TO MEMORY
; ADDRESS IS SET IN REG ADDRESS
; DATA IS IN REG MTEMPH AND MTEMPL
; RETURN ADDRESS IS UNCHANGED
;*****************************************************************
WRITEMEMORY:
                push    RP                      ; SAVE THE RP
                srp     #LEARNEE_GRP            ; set the register pointer

                call    STARTB                  ; output the start bit
                ld      serial,#00110000B       ; set byte to enable write
                call    SERIALOUT               ; output the byte
                and     csport,#csl             ; reset the chip select
                call    STARTB                  ; output the start bit
                ld      serial,#01000000B       ; set the byte for write
                or      serial,address          ; or in the address
                call    SERIALOUT               ; output the byte
                ld      serial,mtemph           ; set the first byte to write
                call    SERIALOUT               ; output the byte
                ld      serial,mtempl           ; set the second byte to write
                call    SERIALOUT               ; output the byte
                call    ENDWRITE                ; wait for the ready status
                call    STARTB                  ; output the start bit
                ld      serial,#00000000B       ; set byte to disable write
                call    SERIALOUT               ; output the byte
                and     csport,#csl             ; reset the chip select
```

```
                pop     RP                      ; reset the RP
                ret
;*****************************************************************
; READ WORD FROM MEMORY
; ADDRESS IS SET IN REG ADDRESS
; DATA IS RETURNED IN REG MTEMPH AND MTEMPL
; ADDRESS IS UNCHANGED
;*****************************************************************
READMEMORY:
                push    RP              ;
                srp     #LEARNEE_GRP    ; set the register pointer

                call    STARTB          ; output the start bit
                ld      serial,#10000000B ; preamble for read
                or      serial,address  ; or in the address
                call    SERIALOUT       ; output the byte
                call    SERIALIN        ; read the first byte
                ld      mtemph,serial   ; save the value in mtemph
                call    SERIALIN        ; read teh second byte
                ld      mtempl,serial   ; save the value in mtempl
                and     csport,#csl     ; reset the chip select
                pop     RP              ;
                ret
;*****************************************************************
; WRITE CODE TO 2 MEMORY ADDRESS
; CODE IS IN RADIO1H RADIO1L RADIO3H RADIO3L
;*****************************************************************
WRITECODE:
                push    RP              ;
                srp     #LEARNEE_GRP    ; set the register pointer
                ld      mtemph,RADIO1H  ; transfer the data from radio 1 to the temps
                ld      mtempl,RADIO1L  ;
                call    WRITEMEMORY     ; write the temp bits
                inc     address         ; next address
                ld      mtemph,RADIO3H  ; transfer the data from radio 3 to the temps
                ld      mtempl,RADIO3L  ;
                call    WRITEMEMORY     ; write the temps
                pop     RP              ;
                ret                     ; return
;*****************************************************************
; CLEAR ALL RADIO CODES IN THE MEMORY
;*****************************************************************

CLEARCODES:
                push    RP              ;
                srp     #LEARNEE_GRP    ; set the register pointer
                ld      RADIO1H,#0FFH   ; set the codes to illegal codes
                ld      RADIO1L,#0FFH   ;
                ld      RADIO3H,#0FFH   ;
                ld      RADIO3L,#0FFH   ;
                ld      address,#00H    ; clear address 0
CLEARC:
                call    WRITECODE       ; "A0"
```

4-32a

```
        inc     address         ; set the next address
        cp      address,#1BH    ; test for the last address of radio
        jr      ult CLEARC
        clr     mtemph          ; clear data
        clr     mtempl
        ld      address,#1FH    ; clear address F
        call    WRITEMEMORY     ;
        pop     RP              ;
        ret                     ; return

;*****************************************************************
; START BIT FOR SERIAL NONVOL
; ALSO SETS DATA DIRECTION AND AND CS
;*****************************************************************
STARTB:
        and     csport,#csl     ;
        and     clkport,#clockl ; start by clearing the bits
        and     dioport,#dol    ;
        ld      P2M,#(P2M_INIT+0) ; set port 2 mode forcing output mode data
        or      csport,#csh     ; set the chip select
        or      dioport,#doh    ; set the data out high
        or      clkport,#clockh ; set the clock
        and     clkport,#clockl ; reset the clock low
        and     dioport,#dol    ; set the data low
        ret                     ; return

;*****************************************************************
; END OF CODE WRITE
;*****************************************************************
ENDWRITE:
        and     csport,#csl     ; reset the chip select
        nop                     ; delay
        or      csport,#csh     ; set the chip select
        ld      P2M,#(P2M_INIT+4) ; set port 2 mode forcing input mode data
ENDWRITELOOP:
        ld      temph,dioport   ; read the port
        and     temph,#doh      ; mask
        jr      z,ENDWRITELOOP  ; if the bit is low then loop till we are done
        and     csport,#csl     ; reset the chip select
        ld      P2M,#(P2M_INIT+0) ; set port 2 mode forcing output mode
        ret

;*****************************************************************
; SERIAL OUT
; OUTPUT THE BYTE IN SERIAL
;*****************************************************************
SERIALOUT:
        ld      P2M,#(P2M_INIT+0) ; set port 2 mode forcing output mode data
        ld      templ,#8H       ; set the count for eight bits
SERIALOUTLOOP:
        rlc     serial          ; get the bit to output into the carry
        jr      nc,ZEROOUT      ; output a zero if no carry
ONEOUT:
        or      dioport,#doh    ; set the data out high
```

73

74

```
                or      clkport,#clockh         ; set the clock high
                and     clkport,#clockl         ; reset the clock low
                and     dioport,#dol            ; reset the data out low
                djnz    templ,SERIALOUTLOOP
                                                ; loop till done
                ret                             ; return
ZEROOUT:
                and     dioport,#dol            ; reset the data out low
                or      clkport,#clockh         ; set the clock high
                and     clkport,#clockl         ; reset the clock low
                and     dioport,#dol            ; reset the data out low
                djnz    templ,SERIALOUTLOOP
                                                ; loop till done
                ret                             ; return

;*****************************************************************
; SERIAL IN
; INPUTS A BYTE TO SERIAL
;*****************************************************************
SERIALIN:
                ld      P2M,#(P2M_INIT+4)       ; set port 2 mode forcing input mode data
                ld      templ,#8H               ; set the count for eight bits
SERIALINLOOP:
                or      clkport,#clockh         ; set the clock high
                rcf                             ; reset the carry flag
                ld      temph,dioport           ; read the port
                and     temph,#don              ; mask out the bits
                jr      z,DONTSET
                scf                             ; set the carry flag
DONTSET:
                rlc     serial                  ; get the bit into the byte
                and     clkport,#clockl         ; reset the clock low
                djnz    templ,SERIALINLOOP
                                                ; loop till done
                ret                             ; return

;*****************************************************************
; TIMER UPDATE FROM INTERUPT EVERY 1mS
;*****************************************************************
TIMERUD:
                dec     T0EXT                   ; decrement the T0 extension
                inc     TASKSWITCH              ; set to the next switch
                and     TASKSWITCH,#00000111B   ; 0-7
                tm      TASKSWITCH,#00000001B   ; test for odd
                jr      nz,TK1357               ; if so then jump
                cp      TASKSWITCH,#2d          ; test for 2
                jr      z,TASK2
                cp      TASKSWITCH,#4d          ; test for 4
                jr      z,TASK4
                cp      TASKSWITCH,#6d          ; test for 6
                jr      z,TASK6
TASK0:
                or      IMR,#RETURN_IMR         ; turn on the interrupt
                ei
                push    rp                      ; save the rp
```

```
                    srp     #TIMER_GROUP    ; set the rp for the switches
                    call    switches        ; test the switches
                    pop     rp
                    iret

TASK2:
                    or      IMR,#RETURN_IMR ; turn on the interrupt
                    ei
                    push    rp              ; save the rp
                    srp     #TIMER_GROUP    ;
                    call    STATEMACHINE    ; do the motor function
                    pop     rp              ; return the rp
                    iret

TASK4:
                    or      IMR,#RETURN_IMR ; turn on the interrupt
                    ei
                    push    rp              ; save the rp
                    srp     #TIMER_GROUP    ; set the rp for the switches
                    call    switches        ; test the switches
                    pop     rp
                    iret


TK1357:
                    cp      TASKSWITCH,#05D ; test for task 5
                    jp      nz,TASK1357EXIT ;

TASK5:
                    cp      PWM_STATUS,#0FFH
                    jr      ne,enable_t1    ;
                    dec     PWM_OFF         ; discharge for at least 2x
                    jr      nz,continue     ;
                    ld      PWM_STATUS,#00H
enable_t1:
                    ld      PWM_OFF,#14H    ;
                    or      p3,#PWM_HI      ; take pwm pin high
                    or      tmr,#TIMER_1_EN ; enable t1
continue:
                    jp      TASK1357EXIT    ; EXIT UPDATING TIMERS

TASK6:
                    or      IMR,#RETURN_IMR ; turn on the interrupt
                    ei
                    push    rp              ; save the rp
                    srp     #TIMER_GROUP    ;
                    call    STATEMACHINE    ; do the motor function
                    pop     rp              ; return the rp
                    iret

TASK1357EXIT
                    push    RP
```

```
                or      IMR,#RETURN_IMR     ; turn on the interrupt
                ei
                call    RS232               ; do the rs232 buss
                tm      TASKSWITCH,#00000001B   ; test for state a 1 in b0
                jr      z,ONEMS
                tm      TASKSWITCH,#00000010B   ; test for state a 1 in b1
                jr      z,ONEMS
                srp     #TIMER_GROUP        ; if a 3 or 7 then do the auxlight
                call    AUXLIGHT            ;
ONEMS:
                srp     #LEARNEE_GRP        ; set the register pointer
                dec     AOBSTEST            ; decrease the aobs test timer
                jr      nz,NOFAIL           ; if the timer not at 0 then it didnot fail
                ld      AOBSTEST,#11d       ; if it failed reset the timer
                or      AOBSF,#00000001b    ; set the failed flag bit
NOFAIL:
                inc     t4ms                ; increment the 4mS timer
                inc     t125ms              ; increment the 125 mS timer
                cp      t4ms,#4D            ; test for the time out
                jp      nz,TEST125          ; if not true then jump
FOURMS:
                clr     t4ms                ; reset the timer
                cp      RPMONES,#00H        ; test for the end of the one sec timer
                jr      z,TESTPERIOD        ; if one sec over then test the pulses
                                            ; over the period
                dec     RPMONES             ; else decrease the timer
                di
                clr     RPM_COUNT           ; start with a count of 0
                clr     BRPM_COUNT          ; start with a count of 0
                ei
                jr      RPMTDONE
TESTPERIOD:
                cp      RPMCLEAR,#00H       ; test the clear test timer for 0
                jr      nz,RPMTDONE         ; if not timed out then skip
                ld      RPMCLEAR,#122d      ; set the clear test time for next cycle .5
                cp      RPM_COUNT,#50d      ; test the count for too many pulses
                jr      ugt,FAREV           ; if too man pulses then reverse
                di
                clr     RPM_COUNT           ; clear the counter
                clr     BRPM_COUNT_         ; clear the counter
                ei
;               clr     FAREVFLAG           ; clear the flag  temp test
                jr      RPMTDONE            ; continue
FAREV:
                ld      FAULTCODE,#06h      ; set the fault flag
                ld      FAREVFLAG,#088H     ; set the forced up flag
                and     p0,#^LB ^C WORKLIGHT ; turn off light
                ld      REASON,#80H         ; rpm forcing up motion
                call    SET_AREV_STATE      ; set the autorev state
RPMTDONE:
                dec     RPMCLEAR            ; decrement the timer
                cp      LIGHT1S,#00         ; test for the end
                jr      z,SKIPLIGHTE
                dec     LIGHT1S             ; down count the light time
SKIPLIGHTE:
```

```
                inc     R_DEAD_TIME
                cp      RTO,#101D       ; test for the radio time out
                jr      ult,DONOTCB     ; if not timed out donot clear b
                clr     BCODEFLAG       ; else clear the b code flag
DONOTCB:
                inc     RTO             ; increment the radio time out
                jr      nz,RTOOK        ; if the radio timeout ok then skip
                dec     RTO             ; back turn
RTOOK:
                cp      RRTO,#0FFH      ; test for roll
                jr      z,SKIPRRTO      ; if so then skip
                inc     RRTO
SKIPRRTO
                ;
                ld      temp,psport     ; read the program switch
                and     temp,#psmask    ; mask for switch
                jr      z,PRSWCLOSED    ; if the switch is closed count up
                cp      learndb,#00     ; test for the non decrement point
                jr      z,LEARNDBOK     ; if at end skip dec
                dec     learndb         ;
                jr      LEARNDBOK       ;
PRSWCLOSED
                inc     learndb         ; increase the learn debounce timer
                cp      learndb,#0H     ; test for overflow
                jr      nz,LEARNDBOK    ; if not 0 skip back turning
                dec     learndb         ;
LEARNDBOK:
TEST125:
                cp      t125ms,#125D    ; test for the time out
                jr      z,ONE25MS       ; if true the jump
                cp      t125ms,#63D     ; test for the other timeout
                jr      nz,N125
                call    FAULTB
N125:
                pop     RP
                iret
ONE25MS:
                cp      AUXLEARNSW,#0FFh ; test for the rollover position
                jr      z,SKIPAUXLEARNSW ; if so then skip
                inc     AUXLEARNSW      ; increase
SKIPAUXLEARNSW:
                cp      ZZWIN,#0FFH     ; test for the roll position
                jr      z,TESTFA        ; if so skip
                inc     ZZWIN           ; if not increase the counter
TESTFA:
                call    FAULTB          ; call the fault blinker
                clr     t125ms          ; reset the timer
                inc     DOG2            ; incrwease the second watch dog
                di
                inc     SDISABLE        ; count off the system disable timer
                jr      nz,DO12         ; if not rolled over then do the 1.2 sec
                dec     SDISABLE        ; else reset to FF
DO12:
                cp      ONEP2,#00       ; test for 0
                jr      z,INCLEARN      ; if counted down then increment learn
```

81

82

```
                dec     ONEP2           ; else down count
INCLEARN:
                inc     learnt          ; increase the learn timer
                cp      learnt,#0H      ; test for overflow
                jr      nz,LEARNTOK     ; if not 0 skip back turning
                dec     learnt          ;
LEARNTOK:
                ei
                inc     eraset          ; increase the erase timer
                cp      eraset,#0H      ; test for overflow
                jr      nz,ERASETOK     ; if not 0 skip back turning
                dec     eraset          ;
ERASETOK:
                pop     RP
                iret

;       fault blinker

FAULTB:
                inc     FAULTTIME       ; increase the fault timer
                cp      FAULTTIME,#80h  ; test for the end
                jr      nz,FIRSTFAULT   ; if not timed out
                clr     FAULTTIME       ; reset the clock
                clr     FAULT           ; clear the last
                cp      FAULTCODE,#05h  ; test for call dealer code
                jr      UGE,GOTFAULT    ; set the fault
                cp      CMD_DEB,#0FFH   ; test the debouncer
                jr      nz,TESTAOBSM    ; if not set test aobs
                cp      FAULTCODE,#03h  ; test for command shorted
                jr      z,GOTFAULT      ; set the error
                ld      FAULTCODE,#03h  ; set the code
                jr      FIRSTFAULT      ;
TESTAOBSM:
                tm      AOBSF,#00000001b ; test for the skiped aobs pulse
                jr      z,NOAOBSFAULT   ; if no skips then no faults
                tm      AOBSF,#00000010b ; test for any pulses
                jr      z,NOPULSE       ; if no pulses find if hi or low
                                        ; else we are intermittent
                ld      FAULTCODE,#04h  ; set the fault
                jr      GOTFAULT        ; if same got fault
                cp      FAULTCODE,#04h  ; test the last fault
                jr      z,GOTFAULT      ; if same got fault
                ld      FAULTCODE,#04h  ; set the fault
                jr      FIRSTFC         ;
NOPULSE:        tm      P3,#00000001b   ; test the input pin
                jr      z,AOBSSH        ; jump if aobs is stuck hi
                cp      FAULTCODE,#01h  ; test for stuck low in the past
                jr      z,GOTFAULT      ; set the fault
                ld      FAULTCODE,#01h  ; set the fault code
                jr      FIRSTFC         ;
AOBSSH:         cp      FAULTCODE,#02h  ; test for stuck high in past
                jr      z,GOTFAULT      ; set the fault
                ld      FAULTCODE,#02h  ; set the code
                jr      FIRSTFC         ;

GOTFAULT:       ld      FAULT,FAULTCODE ; set the code
```

```
                    swap    FAULT               ;
                    jr      FIRSTFC             ;
NOAOBSFAULT:

                    clr     FAULTCODE           ; clear the fault code
FIRSTFC:            clr     AOBSF               ; clear flags

FIRSTFAULT:

                    cp      FAULT,#00           ; test for no fault
                    jr      z,NOFAULT
                    ld      FAULTFLAG,#0FFH     ; set the fault flag
                    cp      LEARNT,#0FFH        ; test for not in learn mode
                    jr      nz,TESTSDI          ; if in learn then skip setting
                    cp      FAULT,FAULTTIME     ;
                    jr      ULE,TESTSDI

                    tm      FAULTTIME,#00001000b        ; test the 1 sec bit
                    jr      nz,BITONE
                    and     ledport,#ledl       ; turn on the led
                    ret

BITONE:

                    or      ledport,#ledh       ; turn off the led
TESTSDI:
                    ret

NOFAULT:            clr     FAULTFLAG           ; clear the flag
                    ret

;-------------------------------------------------------------------
; MOTOR STATE MACHINE
;-------------------------------------------------------------------

STATEMACHINE:
                    call    RS232
                    xor     p0,#00001000b       ; toggle aux output
                    dec     FORCE_PRE           ; dec the prescaler
                    cp      DOG2,#8d            ; test the 2nd watchdog for problem
                    jp      ugt,START           ; if problem reset
                    cp      STATE,#06d          ; test for legal number
                    jp      ugt,start           ; if not the reset
                    jp      z,stop              ; stop motor            6
                    cp      STATE,#03d          ; test for legal number
                    jp      z,start             ; if not the reset
                    cp      STATE,#00d          ; test for autorev
                    jp      z,auto_rev          ; auto reversing        0
                    cp      STATE,#01d          ; test for up
                    jp      z,up_direction      ; door is going up      1
                    cp      STATE,#02d          ; test for autorev
                    jp      z,up_position       ; door is up            2
                    cp      STATE,#04d          ; test for autorev
                    jp      z,dn_direction      ; door is going down    4
                    jp      dn_position         ; door is down          5

;-------------------------------------------------------------------
; AUX OBSTRUCTION OUTPUT AND LIGHT FUNCTION
```

```
;-----------------------------------------------------------------------

AUXLIGHT.
test_light_on:
                cp      LIGHT_FLAG,#LIGHT
                jr      z,dec_pre_light
                cp      LIGHT1S,#00             ; test for no flash
                jr      z,NO1S                  ; if not skip
                cp      LIGHT1S,#01d            ; test for timeout
                jr      nz,NO1S                 ; if not skip
                xor     p0,#WORKLIGHT           ; toggle light
                clr     LIGHT1S                 ; oneshoted
NO1S:
                cp      FLASH_FLAG,#FLASH
                jr      nz,dec_pre_light
                decw    FLASH_DELAY             ; 250 ms period
                jr      nz,dec_pre_light
                xor     p0,#WORKLIGHT           ; toggle light
                ld      FLASH_DELAY_HI,#FLASH_HI
                ld      FLASH_DELAY_LO,#FLASH_LO
                dec     FLASH_COUNTER
                jr      nz,dec_pre_light
                clr     FLASH_FLAG
dec_pre_light:
                cp      LIGHT_TIMER_HI,#0FFH    ; test for the timer ignore
                jr      z,exit_light            ; if set then ignore
                dec     PRE_LIGHT               ;  dec 3 byte light timer
                jr      nz,exit_light
                decw    LIGHT_TIMER
                jr      nz,exit_light           ; if timer 0 turn off the light
                and     p0,#^C LIGHT_ON         ; turn off the light
exit_light:
                ret                             ; return
;-----------------------------------------------------------------------
;               AUTO_REV ROUTINE
;-----------------------------------------------------------------------

auto_rev:
                cp      FAREVFLAG,#088H         ; test for the forced up flag
                jr      nz,LEAVEREV
                and     p0,#^LB ^C WORKLIGHT    ; turn off light
                clr     FAREVFLAG               ; one shot temp test
LEAVEREV:
                WDT                             ; kick the dog
                call    HOLDFREV                ; hold off the force reverse
                ld      LIGHT_FLAG,#LIGHT       ; force the light on no blink
                and     p0,#^LB ^C MOTOR_UP ^& #^C MOTOR_DN   ; disable motor
                di
                decw    AUTO_DELAY              ; wait for .5 second
                decw    BAUTO_DELAY             ; wait for .5 second
                ei
                jr      nz,arswitch             ; test switches


                or      p0,#00001000b           ; set aux output for FEMA
```

```
                tm      p2.#UP_LIMIT            ; test the limit
                jr      nz,NOUPLIM              ; if limit set stop
                LD      REASON,#60H             ; set the reason as early limit
                jp      SET_STOP_STATE          ; set stop
NOUPLIM
                ld      REASON,#40H             ; set the reason for the change
                jp      SET_UP_DIR_STATE        ; set the state
arswitch
                ld      REASON,#00H             ; set the reason to command
                cp      SW_DATA,#CMD_SW         ; test for a command
                jp      z,SET_STOP_STATE        ; if so then stop
                ld      REASON,#10H             ; set the reason as radio command
                cp      RADIO_CMD,#0AAH         ; test for a radio command
                jp      z,SET_STOP_STATE        ; if so the stop
exit_auto_rev
                ret                             ; return

HOLDFREV
                ld      RPMONES,#244d           ; set the hold off
                ld      RPMCLEAR,#122d          ; clear rpm reverse .5 sec
                di
                clr     RPM_COUNT               ; start with a count of 0
                clr     BRPM_COUNT              ; start with a count of 0
                ei
                ret

;-----------------------------------------------------------------------
                DOOR GOING UP
;-----------------------------------------------------------------------

up_direction
                WDT                             ; kick the dog
                call    HOLDFREV                ; hold off the force reverse
                ld      LIGHT_FLAG,#LIGHT       ; force the light on no blink
                and     p0,#^LB ^C MOTOR_DN     ; disable down relay

                cp      MOTDEL,#0FFH            ; test for done
                jr      z,UPON                  ; if done skip delay
                inc     MOTDEL                  ; increase the delay timer
                or      p0,#LIGHT_ON            ; turn on the light
                cp      MOTDEL,#20d             ; test for 40 seconds
                jr      ule,UPOFF               ; if not timed
UPON
                or      p0,#MOTOR_UP ^| #LIGHT_ON ; turn on the motor and light
UPOFF
                cp      FORCE_IGNORE,#01        ; test fro the end of the force ignore
                jr      nz,SKIPUPRPM            ; if not donot test rpmcount
                cp      RPM_ACOUNT,#02H         ; test for less the 2 pulses
                jr      ugt,SKIPUPRPM           ;
                ld      FAULTCODE,#05h
SKIPUPRPM:
                cp      FORCE_IGNORE,#00        ; test timer for done
                jr      nz,test_up_sw_pre       ; if timer not up do not test force
```

```
TEST_UP_FORCE
                di
                dec     RPM_TIME_OUT                    ; decrease the timeout
                dec     BRPM_TIME_OUT                   ; decrease the timeout
                ei
                jr      z,failed_up_rpm
                di                                      ; turn off the interrupt
                ld      RPM_SET_DIFF_LO,UP_FORCE_LO
                ld      RPM_SET_DIFF_HI,UP_FORGE_HI
                sub     RPM_SET_DIFF_LO,RPM_PERIOD_LO
                sbc     RPM_SET_DIFF_HI,RPM_PERIOD_HI
                tm      RPM_SET_DIFF_HI,#10000000B      ; test high bit for sign
                jr      z,test_up_sw                    ; if the rpm period is ok then switch
failed_up_rpm
                ld      REASON,#20H                     ; set the reason as force
                jp      SET_STOP_STATE
test_up_sw_pre
                tm      FORCE_PRE,#00000001B            ; test for odd /2
                jr      nz,test_up_sw                   ; if odd skip
                di
                dec     FORCE_IGNORE
                dec     BFORCE_IGNORE
test_up_sw
                ei                                      ; enable interrupt
                tm      p2,#UP_LIMIT                    ; have we reached the limit?
                jr      z,up_limit_dec                  ;
                ld      limit,#LIMIT_COUNT              ;
                jr      get_sw                          ;
up_limit_dec
                djnz    limit,get_sw                    ; dec debounce count
                ld      REASON,#50H                     ; set the reason as limit
                jp      SET_UP_POS_STATE                ;
get_sw
                ld      REASON,#10H                     ; set the radio command reason
                cp      RADIO_CMD,#0AAH                 ; test for a radio command
                jp      z,SET_STOP_STATE                ; if so stop
                ld      REASON,#00H                     ; set the reason as a command
                cp      SW_DATA,#CMD_SW                 ; test for a command condition
                jr      ne,test_up_time                 ;
                jp      SET_STOP_STATE                  ;
test_up_time:
                ld      REASON,#70H                     ; set the reason as a time out
                decw    MOTOR_TIMER                     ; decrement motor timer
                jp      z,SET_STOP_STATE                ;
exit_up_dir:
                ret                                     ; return to caller
;---------------------------------------------------------------------
;               DOOR UP
;---------------------------------------------------------------------

up_position:
                WDT                                     ; kick the dog
                cp      FAREVFLAG,#088H                 ; test for the forced up flag
                jr      nz,LEAVELIGHT
                and     p0,#^LB ^C WORKLIGHT            ; turn off light
                jr      UPNOFLASH                       ; skip clearing the flash flag
```

```
LEAVELIGHT:
                ld      LIGHT_FLAG,#00H             ; allow blink
UPNOFLASH:
                ld      limit,#LIMIT_COUNT          ;
                and     p0,#^LB ^C MOTOR_UP ^& #^C MOTOR_DN   ; disable motor
                cp      SW_DATA,#LIGHT_SW           ; light sw debounced?
                jr      z,work_up                   ;
                ld      REASON,#10H                 ; set the reason as  a radio command
                cp      RADIO_CMD,#0AAH             ; test for a radio cmd
                jr      z,SETDNDIRSTATE             ; if so start down
                ld      REASON,#00H                 ; set the reason as a command
                cp      SW_DATA,#CMD_SW             ; command sw debounced?
                jr      z,SETDNDIRSTATE             ; if command
                ret
SETDNDIRSTATE:
                ld      ONEP2,#10D                  ; set the 1.2 sec timer
                jp      SET_DN_DIR_STATE

work_up:
                xor     p0,#WORKLIGHT               ; toggle work light
                ld      LIGHT_TIMER_HI,#0FFH        ; set the timer ignore
up_pos_ret:
                ret                                 ; return
;---------------------------------------------------------------
;               DOOR GOING DOWN
;---------------------------------------------------------------

dn_direction:
                WDT                                 ; kick the dog
                call    HOLDFREV                    ; hold off the force reverse
                clr     FLASH_FLAG                  ; turn off the flash
                ld      LIGHT_FLAG,#LIGHT           ; force the light on no blink
                and     p0,#^LB ^C MOTOR_UP         ; turn off motor up
                cp      MOTDEL,#0FFH                ; test for done
                jr      z,DNON                      ; if done skip delay
                inc     MOTDEL                      ; increase the delay timer
                or      p0,#LIGHT_ON                ; turn on the light
                cp      MOTDEL,#20d                 ; test for 40 seconds
                jr      ule,DNOFF                   ; if not timed
DNON:

                or      p0,#MOTOR_DN ^| #LIGHT_ON   ; turn on the motor and light
DNOFF:
                cp      FORCE_IGNORE,#01            ; test fro the end of the force ignore
                jr      nz,SKIPDNRPM                ; if not donot test rpmcount
                cp      RPM_ACOUNT,#02H             ; test for less the 2 pulses
                jr      ugt,SKIPDNRPM               ;
                ld      FAULTCODE,#05h
SKIPDNRPM:
                cp      FORCE_IGNORE,#00            ; test timer for done
                jr      nz,test_dn_sw_pre           ; if timer not up do not test force
                cp      ForcedDown,#1h              ; test the flag to skip rpm if forcing down
                jr      z,test_dn_sw_pre

TEST_DOWN_FORCE:
                di
```

```
                dec     RPM_TIME_OUT                    ; decrease the timeout
                dec     BRPM_TIME_OUT                   ; decrease the timeout
                ei
                jr      z,failed_dn_rpm
                di                                      ; turn off the interrupt
                ld      RPM_SET_DIFF_LO,DN_FORCE_LO
                ld      RPM_SET_DIFF_HI,DN_FORCE_HI
                sub     RPM_SET_DIFF_LO,RPM_PERIOD_LO
                sbc     RPM_SET_DIFF_HI,RPM_PERIOD_HI
                tm      RPM_SET_DIFF_HI,#10000000B      ; test high bit for sign
                jr      z,test_dn_sw                    ; if the rpm period is ok then switch
failed_dn_rpm:
                ld      REASON,#20H                     ; set the reason as force
                jp      SET_AREV_STATE                  ; set the state
test_dn_sw_pre:
                tm      FORCE_PRE,#00000001B            ; test for odd /2
                jr      nz,test_dn_sw                   ; if odd skip
                di
                dec     FORCE_IGNORE
                dec     BFORCE_IGNORE
test_dn_sw:
                ei                                      ; turn on the interrupt
                tm      p2,#DN_LIMIT                    ; are we at down limit?
                jr      z,dn_limit_dec                  ;
                ld      limit,#LIMIT_COUNT              ; reset the limit
                jr      call_sw_dn                      ;
dn_limit_dec:
                djnz    limit,call_sw_dn                ; dec debounce counter
                ld      REASON,#50H                     ; set the reason as a limit
                cp      CMD_DEB,#0FFH                   ; test for the switch still held
                jr      nz,TESTRADIO                    ;
                ld      REASON,#90H                     ; closed with the control held
                jr      TESTFORCEIG
TESTRADIO:
                cp      LAST_CMD,#00                    ; test for the last command being radio
                jr      nz,TESTFORCEIG                  ; if not test force
                cp      BCODEFLAG,#077H                 ; test for the b code flag
                jr      nz,TESTFORCEIG                  ;
                ld      REASON,#0A0H                    ; set the reason as b code to limit
TESTFORCEIG:
                cp      ForcedDown,#00                  ; test for force down action
                jr      nz,NOAREVDN                     ; if set skip early limits
                cp      FORCE_IGNORE,#00H               ; test the force ignore for done
                jr      z,NOAREVDN                      ; a rev if limit before force enabled
                ld      REASON,#60h                     ; early limit
                jp      SET_AREV_STATE                  ; set autoreverse
NOAREVDN:
                and     p0,#^LB ^C MOTOR_DN             ;
                jp      SET_DN_POS_STATE                ; set the state
call_sw_dn:
                ld      REASON,#10H                     ; set the reason as radio command
                cp      RADIO_CMD,#0AAH                 ; test for a radio command
                jp      z,SET_AREV_STATE                ; if so arev
                ld      REASON,#00H                     ; set the reason as command
                cp      SW_DATA,#CMD_SW                 ; test for command
```

```
                jp      z,SET_AREV_STATE        ;
test_dn_time:
                ld      REASON,#70H             ; set the reason as timeout
                decw    MOTOR_TIMER             ; decrement motor timer
                jp      z,SET_AREV_STATE        ;
dec_obs_count:
                djnz    obs_count,exit_dn_dir   ; dec aux obs count
                cp      LAST_CMD,#00            ; test for the last command from radio
                jr      z,OBSTESTB              ; if last command was a radio test b
                cp      CMD_DEB,#0FFH           ; test for the command switch holding
                jr      nz,OBSAREV              ; if the command switch is not holding
                                                ; do the autorev
                ret                             ; otherwise skip
OBSAREV:
                ld      FLASH_FLAG,#0FFH        ; set flag
                ld      FLASH_COUNTER,#20       ; set for 10 flashes
                ld      FLASH_DELAY_HI,#FLASH_HI; set for .5 Hz period
                ld      FLASH_DELAY_LO,#FLASH_LO
                ld      REASON,#30H             ; set the reason as autoreverse
                jp      SET_AREV_STATE          ;
OBSTESTB:
                cp      BCODEFLAG,#077H         ; test for the b code flag
                jr      nz,OBSAREV              ; if not b code then arev
exit_dn_dir:
;               ld      REASON,#0B0H            ; set the reason as command not held
;               cp      FAREVFLAG,#088H         ; test forced up flag
;               jr      nz,exit_2_dn            ; if the forced up flag clear skip
;               cp      CMD_DEB,#0FFH           ; test for a held command
;               jr      z,exit_2_dn             ; if the command is held keep going
;               cp      LAST_CMD,#00            ; test for the last command being radio
                jr      nz,do_reverse           ; if not do reverse
;               cp      BCODEFLAG,#077H         ; test for the b code flag
;               jr      z,exit_2_dn             ; if set skip till either is released
do_reverse:
;               jp      SET_AREV_STATE          ; set the autoreverse state
exit_2_dn:
                ret                             ; return

;---------------------------------------------------------------------
;               DOOR DOWN
;---------------------------------------------------------------------

dn_position:
                WDT                             ; kick the dog
;               cp      FAREVFLAG,#088H         ; test for the forced up flag
;               jr      nz,DNLEAVEL             ;
;               and     p0,#^LB ^C WORKLIGHT    ; turn off light
;               jr      DNNOFLASH               ; skip clearing the flash flag


                cp      ForcedDown,#01d         ; test for force in past
                jr      z,TestMotorRev          ; if so the test motor motion
                cp      MOTOR_TIMER,#00d        ; test for timed out
                jr      z,TestMotorRev          ; if timed out then test rev.
                decw    MOTOR_TIMER             ; decrement motor timer
                clr     RPM_ACOUNT              ; clear the rpm counter
```

```
                jr      SkipLock                ; skip the lock till 27 sec timeout
TestMotorRev:
                tm      p2,#DN_LIMIT            ; is the down limit still set
                jr      z,SkipLock              ; then skip the lock down
                cp      RPM_ACOUNT,#10d         ; test for 2 rev
                jr      ule,SkipLock            ; if less skip the lock down
                ld      ForcedDown,#1h          ; set the flag to skip early limits
                jp      SET_DN_DIR_STATE        ; force the door down to lim
SkipLock
DNLEAVEL:
                ld      LIGHT_FLAG,#00H         ; allow blink
DNNOFLASH:
                ld      limit,#LIMIT_COUNT      ;
                and     p0,#^LB ^C MOTOR_UP ^&-#^C MOTOR_DN   ; disable motor
                cp      SW_DATA,#LIGHT_SW       ; debounced? light
                jr      z,work_dn               ;
                ld      REASON,#10H             ; set the reason as a radio command
                cp      RADIO_CMD,#0AAH         ; test for a radio command
                jr      z,SETUPDIRSTATE         ; if so go up
                ld      REASON,#00H             ; set the reason as a command
                cp      SW_DATA,#CMD_SW         ; command sw pressed?
                jr      z,SETUPDIRSTATE         ; if so go up
                ret
SETUPDIRSTATE:
                ld      ONEP2,#10D              ; set the 1.2 sec timer
                jp      SET_UP_DIR_STATE

work_dn:
                xor     p0,#WORKLIGHT           ; toggle work light
                ld      LIGHT_TIMER_HI,#0FFH    ; set the timer ignore
dn_pos_ret:
                ret                             ; return
;---------------------------------------------------------------
;               STOP
;---------------------------------------------------------------

stop:
                WDT                             ; kick the dog
                cp      FAREVFLAG,#088H         ; test for the forced up flag
                jr      nz,LEAVESTOP
                and     p0,#^LB ^C WORKLIGHT    ; turn off light
LEAVESTOP:
                ld      LIGHT_FLAG,#00H         ; allow blink
                and     p0,#^LB ^C MOTOR_UP ^& #^C MOTOR_DN   ; disable motor
                cp      SW_DATA,#LIGHT_SW       ; debounced? light
                jr      z,work_stop             ;
                ld      REASON,#10H             ; set the reason as radio command
                cp      RADIO_CMD,#0AAH         ; test for a radio command
                jp      z,SET_DN_DIR_STATE      ; if so go down
                ld      REASON,#00H             ; set the reason as a command
                cp      SW_DATA,#CMD_SW         ; command sw pressed?
                jp      z,SET_DN_DIR_STATE      ; if so go down
                ret
work_stop:
                xor     p0,#WORKLIGHT           ; toggle work light
```

```
                ld      LIGHT_TIMER_HI,#0FFH    ; set the timer ignore
stop_ret:
                ret                             ; return

;-------------------------------------------------------------------------
;       SET THE AUTOREV STATE
;-------------------------------------------------------------------------
SET_AREV_STATE:
                di                              ;
                ld      STATE,#AUTO_REV         ; if we got here, then reverse motor
                jr      SET_ANY

;-------------------------------------------------------------------------
;       SET THE STOPPED STATE
;-------------------------------------------------------------------------
SET_STOP_STATE:
                di
                ld      STATE,#STOP             ;
                jr      SET_ANY

;-------------------------------------------------------------------------
;       SET THE DOWN DIRECTION STATE
;-------------------------------------------------------------------------
SET_DN_DIR_STATE:
                di
                ld      STATE,#DN_DIRECTION     ; energize door
                clr     FAREVFLAG               ; one shot the forced reverse
                tm      p2,#DN_LIMIT            ; are we at down limit?
                jr      nz,SET_ANY              ; if not at limit set dn
                                                ; else set the dn position
;-------------------------------------------------------------------------
;       SET THE DOWN POSITION STATE
;-------------------------------------------------------------------------
SET_DN_POS_STATE:
                di
                ld      STATE,#DN_POSITION      ; load new state
                jr      SET_ANY

;-------------------------------------------------------------------------
;       SET THE UP DIRECTION STATE
;-------------------------------------------------------------------------
SET_UP_DIR_STATE:
                di
                clr     ForcedDown              ; clear the flag for skiping early limit
                ld      STATE,#UP_DIRECTION     ;
                tm      p2,#UP_LIMIT            ; have we reached the limit?
                jr      nz,SET_ANY              ; if not set the state
                                                ; else fall throught and set pos state
;-------------------------------------------------------------------------
;       SET THE UP POSITION STATE
;-------------------------------------------------------------------------
SET_UP_POS_STATE:
                di
                ld      STATE,#UP_POSITION      ;
```

```
;       SET ANY STATE
;-------------------------------------------------------------------
SET_ANY
                ld      BSTATE,STATE                    ; set the backup state
                di
                clr     RPM_COUNT                       ; clear the rpm counter
                clr     BRPM_COUNT                      ;
                ld      AUTO_DELAY_HI,#AUTO_HI          ; set the .5 second auto rev timer
                ld      AUTO_DELAY_LO,#AUTO_LO          ;
                ld      BAUTO_DELAY_HI,#AUTO_HI         ; set the .5 second auto rev timer
                ld      BAUTO_DELAY_LO,#AUTO_LO         ;
                ld      FORCE_IGNORE,#ONE_SEC           ; set the force ignore timer to one sec
                ld      BFORCE_IGNORE,#ONE_SEC          ; set the force ignore timer to one sec
                ei
                clr     RADIO_CMD                       ; one shot
                clr     RPM_ACOUNT                      ; clear the rpm active counter
                ld      LIMIT,#LIMIT_COUNT              ;
                ld      MOTOR_TIMER_HI,#MOTOR_HI
                ld      MOTOR_TIMER_LO,#MOTOR_LO
                ld      STACKREASON,REASON                      ; save the temp reason
                ld      STACKFLAG,#0FFH                         ; set the flag
TURN_ON_LIGHT:
                ld      LIGHT_TIMER_HI,#SET_TIME_HI     ; set the light period
                ld      LIGHT_TIMER_LO,#SET_TIME_LO     ;
                ld      PRE_LIGHT,#SET_TIME_PRE         ;
                ld      LIGHTS,P0                       ; read the light state
                and     LIGHTS,#WORKLIGHT               ;
                jr      nz,lighton                      ; if the light is on skip clearing
lightoff:
                clr     MOTDEL                          ; clear the motor delay
lighton:
                ret

;-------------------------------------------------------------------
;               THIS THE AUXILARY OBSTRUCTION INTERRUPT ROUTINE
;-------------------------------------------------------------------

AUX_OBS:
                ld      OBS_COUNT,#6D           ; reset pulse counter (no obstruction)
                and     imr,#11110111b          ; turn off the interupt for up to 500uS
                ld      AOBSTEST,#11D           ; reset the test timer
                or      AOBSF,#00000010B        ; set the flag for got a aobs
                iret                            ; return from int .

;-------------------------------------------------------------------
;               THIS IS THE MOTOR RPM INTERRUPT ROUTINE
;-------------------------------------------------------------------
RPM:
                push    rp                      ; save current pointer
                srp     #RPM_GROUP              ;point to these reg
                ld      rpm_temp_hi,T0EXT       ; read the timer extension
                ld      rpm_temp_lo,T0          ; read the timer
                tm      IRQ,#00010000B          ; test for a pending interrupt
                jr      z,RPMTIMEOK             ; if not then time ok
RPMTIMEERROR:
```

```
                tm      rpm_temp_lo,#10000000B      ; test for timer reload
                jr      z,RPMTIMEOK                 ; if no reload time is ok
                dec     rpm_temp_hi                 ; if reloaded then dec the hi to resync
RPMTIMEOK:
                and     imr,#11111011b              ; turn off the interupt for up to 500uS

                ld      rpm_2past_hi,rpm_past_hi    ; save the past for testing
                ld      rpm_2past_lo,rpm_past_lo    ;
                ld      rpm_past_hi,rpm_temp_hi     ; transfer the present into the past
                ld      rpm_past_lo,rpm_temp_lo     ;
                ld      rpm_diff_hi,rpm_2past_hi    ; transfer the past into the difference
                ld      rpm_diff_lo,rpm_2past_lo    ;
                sub     rpm_diff_lo,rpm_past_lo     ; find the difference
                sbc     rpm_diff_hi,rpm_past_hi     ;
                tm      rpm_diff_hi,#10000000b      ; test for neg number
                jr      z,RPM_TIME_FOUND            ; if the time is correct then jump
                ld      rpm_diff_hi,rpm_past_hi     ; transfer the temp into the difference
                ld      rpm_diff_lo,rpm_past_lo     ;
                sub     rpm_diff_lo,rpm_2past_lo    ; find the difference
                sbc     rpm_diff_hi,rpm_2past_hi    ;
RPM_TIME_FOUND:
                ld      rpm_period_hi,rpm_diff_hi   ; transfer the difference to the period
                ld      rpm_period_lo,rpm_diff_lo   ;
                ei
                di
                cp      rpm_period_hi,#12D          ; test for a period of at least 6.144mS
                jr      ult,SKIPC                   ; if the period is less then skip counting
                cp      STATE,#05h                  ; test for the down limit state
                jr      z,CLRC                      ; if set clear the counter
TULS:
                cp      STATE,#02H                  ; test for the up limit state
                jr      nz,INCRPM                   ; if not then increment the rpm state
                tm      P2,#UP_LIMIT                ; test for the up limit still set
                jr      nz,INCRPM                   ; if not then set
CLRC:
                clr     RPM_COUNT                   ; clear the rpm counter
                clr     BRPM_COUNT                  ;
                ei
                jr      SKIPC                       ;
INCRPM:
                inc     RPM_COUNT                   ; increase the rpm count
                inc     BRPM_COUNT                  ; increase the rpm count
                inc     RPM_ACOUNT                  ; increase the rpm count
SKIPC:
                inc     RPM_ACOUNT                  ; increase the rpm count
                di
                ld      rpm_time_out,#15D           ; set the rpm max period as 30mS
                ld      BRPM_TIME_OUT,#15D          ; set the rpm max period as 30mS
                                                    ; if rpm not updated by then reverse
                ei
SKIPPEDGE:
                pop     rp                          ; return the rp
                iret                                ; return
```

```
                THIS IS THE SWITCH TEST SUBROUTINE

        STATUS
        0 => COMMAND TEST
        1 => WORKLIGHT TEST
        2 => VACATION TEST
        3 => CHARGE

        SWITCH DATA
        0 => OPEN
        1 => COMMAND        CMD_SW
        2 => WORKLIGHT      LIGHT_SW
        4 => VACATION       VAC_SW

switches:
                call    RS232
                ei
                clr     SW_DATA                 ; set the default to open "idle"
                cp      STATUS,#03d             ; test for illegal number
                jp      ugt,start               ; if so reset
                jp      z,charge                ; if it is 3 then goto charge
                cp      STATUS,#02d             ; test for vacation
                jp      z,VACATION_TEST         ; if so then jump
                cp      STATUS,#01d             ; test for worklight
                jp      z,WORKLIGHT_TEST        ; if so then jump
                                                ; else it id command
COMMAND_TEST:
                cp      VACFLAG,#00H            ; test for vacation mode
                jr      z,COMMAND_TEST1         ; if not vacation skip flash

                inc     VACFLASH                ; increase the vacation flash timer
                cp      VACFLASH,#10            ; test the vacation flash period
                jr      ult,COMMAND_TEST1       ; if lower period skip flash
                and     p3,#CCHARGE_SW          ; turn off wall switch
                or      p3,#DIS_SW              ; enable discharge
                cp      VACFLASH,#60d           ; test the time delay for max
                jr      nz,NOTFLASHED           ; if the flash is not done jump and ret
                clr     VACFLASH                ; restart the timer
NOTFLASHED:
                ret                             ; return


COMMAND_TEST1:
                tm      p0,#SWITCHES            ; command sw pressed?
                jr      nz,CMDOPEN              ; open command
                tm      P0,#10000000B           ; test the second command input
                jr      nz,CMDOPEN
CMDCLOSED:
                call    DECVAC                  ; closed command
                call    DECLIGHT                ; decrease vacation debounce
                cp      CMD_DEB,#0FFH           ; decrease light debounce
                                                ; test for the max number
```

```
                jr      z,SKIPCMDINC            ; if at the max skip inc
                di
                inc     CMD_DEB                 ; increase the debouncer
                inc     BCMD_DEB                ; increase the debouncer
                ei
SKIPCMDINC:
                cp      CMD_DEB,#CMD_MAKE       ;
                jr      nz,CMDEXIT              ; if not made then exit
GOT_A_CMD:
                di
                ld      LAST_CMD,#055H          ; set the last command as command
cmd             ld      SW_DATA,#CMD_SW         ; set the switch data as command
                cp      AUXLEARNSW,#100d        =  ; test the time
                jr      ugt,SKIP_LEARN
                push    RP
                srp     #LEARNEE_GRP
                call    SETLEARN                ; set the learn mode
                clr     SW_DATA                 ; clear the cmd
                pop     RP
                or      p0,#LIGHT_ON            ; turn on the light
                call    TURN_ON_LIGHT           ; turn on the light
SKIP_LEARN:
                ld      CMD_DEB,#0FFH           ; set the debouncer to ff one shot
                ld      BCMD_DEB,#0FFH          ; set the debouncer to ff one shot
CMDEXIT.
                ei
                or      p3,#CHARGE_SW           ; turn on the charge system
                and     p3,#CDIS_SW             ;
                ld      SWITCH_DELAY,#CMD_DEL_EX        ; set the delay time to 8mS
                ld      STATUS,#CHARGE          ; charge time
CMDDELEXIT:
                ret                             ;


CMDOPEN:                                        ; command switch open
                and     p3,#^LB ^C CHARGE_SW    ; turn off charging sw
                or      p3,#DIS_SW              ; enable discharge
                ld      DELAYC,#16d             ; set the time delay
DELLOOP:
                dec     DELAYC
                jr      nz,DELLOOP              ; loop till delay is up
                tm      p0,#SWITCHES            ; command line still high
                jr      nz,TESTWL               ; if so return later
                call    DECVAC                  ; if not open line dec all debouncers
                call    DECLIGHT                ;
                call    DECCMD                  ; •
                ld      AUXLEARNSW,#0FFH        ; turn off the aux learn switch
                jr      CMDEXIT                 ; and exit

TESTWL:
                ld      STATUS,#WL_TEST         ; set to test for a worklight
                ret                             ; return


WORKLIGHT_TEST:
                tm      p0,#SWITCHES            ; command line still high
```

5.780.987

109 110

```
                jr      nz,TESTVAC2             ; exit setting to test for vacation
                call    DECVAC                  ; decrease the vacation debouncer
                call    DECCMD                  ; and the command debouncer
                cp      LIGHT_DEB,#0FFH         ; test for the max
                jr      z,SKIPLIGHTINC          ; if at the max skip inc
                inc     LIGHT_DEB               ; inc debouncer
SKIPLIGHTINC:
                cp      LIGHT_DEB,#LIGHT_MAKE   ; test for the light make
                jr      nz,CMDEXIT              ; if [illegible] then recharge delay
GOT_A_LIGHT:
                ld      LIGHT_DEB,#0FFH         ; set the debouncer to max
                ld      SW_DATA,#LIGHT_SW       ; set the data as worklight
                cp      RRTO,#101d              ; test for code reception
                jr      ugt,CMDEXIT             ; if not then skip the seting of flag
                clr     AUXLEARNSW              ; start the learn timer
                jr      CMDEXIT                 ; then recharge

TESTVAC2:
                ld      STATUS,#VAC_TEST        ; set the next test as vacation
                ld      switch_delay,#VAC_DEL   ; set the delay
LIGHTDELEXIT:
                ret                             ; return

VACATION_TEST:
                djnz    switch_delay,VACDELEXIT ;

                tm      p0,#SWITCHES            ; command line still high
                jr      nz,EXIT_ERROR           ; exit with a error setting open state
                call    DECLIGHT                ; decrease the light debouncer
                call    DECCMD                  ; decrease the command debouncer
                cp      VAC_DEB,#0FFH           ; test for the max
                jr      z,VACINCSKIP            ; skip the incrementing
                inc     VAC_DEB                 ; inc vacation debouncer
VACINCSKIP:
                cp      VACFLAG,#00H            ; test for vacation mode
                jr      z,VACOUT                ; if not vacation use out time
VACIN:
                cp      VAC_DEB,#VAC_MAKE_IN    ; test for the vacation make point
                jr      nz,VACATION_EXIT        ; exit if not made
                jr      GOT_A_VAC               ;
VACOUT:
                cp      VAC_DEB,#VAC_MAKE_OUT   ; test for the vacation make point
                jr      nz,VACATION_EXIT        ; exit if not made
GOT_A_VAC:
                ld      VACCHANGE,#0AAH         ; set the toggle data
                ld      VAC_DEB,#0FFH           ; set vacation debouncer to max
VACATION_EXIT:
                ld      SWITCH_DELAY,#VAC_DEL_EX ; set the delay
                ld      STATUS,#CHARGE          ; set the next test as charge
VACDELEXIT:
                ret

EXIT_ERROR:
                call    DECCMD                  ; decrement the debouncers
                call    DECVAC                  ;
```

111 112

111 112

```
                call    DECLIGHT                ;
                ld      SWITCH_DELAY,#VAC_DEL_EX ; set the delay
                ld      STATUS,#CHARGE          ; set the next test as charge
                ret

charge:
                or      p3,#CHARGE_SW           ;
                and     p3,#CDIS_SW             ;
                dec     SWITCH_DELAY            ;
                jr      nz,charge_ret           ;
                ld      STATUS,#CMD_TEST        ;
charge_ret:
                ret                             -

DECCMD:
                cp      CMD_DEB,#00H            ; test for the min number
                jr      z,SKIPCMDDEC            ; if at the min skip dec
                di
                dec     CMD_DEB                 ; decrement debouncer
                dec     BCMD_DEB                ; decrement debouncer
                ei
SKIPCMDDEC:
                cp      CMD_DEB,#CMD_BREAK      ; if not at break then exit
                jr      nz,DECCMDEXIT           ; if not break then exit
                di
                clr     CMD_DEB                 ; reset the debouncer
                clr     BCMD_DEB                ; reset the debouncer
                ei
DECCMDEXIT:
                ret                             ; and exit

DECLIGHT:
                cp      LIGHT_DEB,#00H          ; test for the min number
                jr      z,SKIPLIGHTDEC          ; if at the min skip dec
                dec     LIGHT_DEB               ; decrement debouncer
SKIPLIGHTDEC:
                cp      LIGHT_DEB,#LIGHT_BREAK  ; if not at break then exit
                jr      nz,DECLIGHTEXIT         ; if not break then exit
                clr     LIGHT_DEB               ; reset the debouncer
DECLIGHTEXIT:
                ret                             ; and exit

DECVAC:
                cp      VAC_DEB,#00H            ; test for the min number
                jr      z,SKIPVACDEC            ; if at the min skip dec
                dec     VAC_DEB                 ; decrement debouncer
SKIPVACDEC:
                cp      VACFLAG,#00H            ; test for vacation mode
                jr      z,DECVACOUT             ; if not vacation use out time
DECVACIN:
                cp      VAC_DEB,#VAC_BREAK_IN   ; test for the vacation break point
```

```
                jr      nz,DECVACEXIT           ; exit if not
                jr      CLEARVACDEB             ;
DECVACOUT:
                cp      VAC_DEB,#VAC_BREAK_OUT  ; test for the vacation break point
                jr      nz,DECVACEXIT           ; exit if not
CLEARVACDEB:
                clr     VAC_DEB                 ; reset the debouncer
DECVACEXIT:
                ret                             ; and exit


;-------------------------------------------------------------------
;               THIS ROUTINE GENERATES THE RAMP FOR THE COMPARATORS
;-------------------------------------------------------------------

PWM:
                push    rp                      ; save current pointer
                srp     #PWM_GROUP              ;
                and     p3,#^C PWM_HI           ; take pwm output low
                tm      p0,#DOWN_COMP           ; was it down force?
                jr      nz,test_up              ; no, test up force
                ld      dn_temp,pulsewidth      ; save setting
test_up:
                tm      p0,#UP_COMP             ; up force trip?
                jr      nz,update_pwm           ; should be high
                ld      up_temp,pulsewidth      ; save setting
update_pwm:
                add     pulsewidth,#4           ; increase pulsewidth
                djnz    pwm_count,pwm_exit      ;

GOT_FORCE_ADDRESS:
                ei                              ; turn on stacked interrupts
                rcf                             ;
                rrc     dn_temp                 ; /2
                rcf                             ;
                rrc     dn_temp                 ; /2
                rcf                             ;
                rrc     up_temp                 ; /2
                rcf                             ;
                rrc     up_temp                 ; /2
                ld      DNFORCE,dn_temp         ; save the values
                ld      UPFORCE,up_temp

                cp      dn_temp,#064d           ; test the last address
                jr      ult,DN_ADDRESS_OK       ; if in the range ok
                ld      dn_temp,#064d           ; if out of the range set to the top
DN_ADDRESS_OK:

                ld      force_add_hi,dn_temp    ; REVERSE THE ROTATION
                ld      dn_temp,#64d            ;
                sub     dn_temp,force_add_hi

                ld      force_add_hi,#^hb force_table_60
                ld      force_add_lo,#^lb force_table_60
```

5.780.987

```
                tm      p2.#00100000b           ; test the 50/60 bit
                jr      nz,DN60
                ld      force_add_hi,#^hb force_table_50
                ld      force_add_lo,#^lb force_table_50
DN60.
                add     force_add_lo,dn_temp    ; calculate the address add 2X temp
                adc     force_add_hi,#00h       ;
                add     force_add_lo,dn_temp    ; calculate the address add 2X temp
                adc     force_add_hi,#00h       ;

                di
                ldc     dn_force_hi,@force_add  ; get hi byte
                incw    force_add               ; get low byte
                ldc     dn_force_lo,@force_add  ;
                ei

                cp      up_temp,#064d           ; test the last address
                jr      ult,UP_ADDRESS_OK       ; if in the range ok
                ld      up_temp,#064d           ; if out of the range set to the top
UP_ADDRESS_OK:

                ld      force_add_hi,up_temp    ; REVERSE THE ROTATION
                ld      up_temp,#64d            ;
                sub     up_temp,force_add_hi

                ld      force_add_hi,#^hb force_table_60
                ld      force_add_lo,#^lb force_table_60
                tm      p2,#00100000b           ; test the 50/60 bit
                jr      nz,UP60
                ld      force_add_hi,#^hb force_table_50
                ld      force_add_lo,#^lb force_table_50
UP60:

                add     force_add_lo,up_temp    ; calculate the address add 2X temp
                adc     force_add_hi,#00h       ;
                add     force_add_lo,up_temp    ; calculate the address add 2X temp
                adc     force_add_hi,#00h       ;

                di
                ldc     up_force_hi,@force_add  ; get hi byte
                incw    force_add               ; get low byte
                ldc     up_force_lo,@force_add  ;
                ei

GOT_FORCE:

                ld      PWM_STATUS,#0FFH        ;
                ld      pwm_count,#TOTAL_PWM_COUNT  ; max count
                ld      pulsewidth,#MIN_COUNT   ; set initial pulsewidth
                ld      dn_temp,#MIN_COUNT      ; start initial pw
                ld      up_temp,#MIN_COUNT      ;
pwm_exit:
                ld      t1,pulsewidth           ; load timer with pulse
                pop     rp                      ; restore pointer
                iret                            ; return from int
```

```
;----------------------------------------------------------------------
: 66                FORCE TABLE
;----------------------------------------------------------------------
force_table_60:
S_0:            .word           0DACH
S_1:            .word           0DACH
S_2:            .word           0DC5H
S_3:            .word           0DDEH
S_4:            .word           0DF7H
S_5:            .word           0E10H
S_6:            .word           0E29H
S_7:            .word           0E42H
S_8             .word           0E5BH
S_9:            .word           0E6DH
S_10            .word           0E7FH
S_11:           .word           0E91H
S_12:           .word           0E9BH
S_13:           .word           0EA5H
S_14:           .word           0EAFH
S_15:           .word           0EB9H
S_16:           .word           0EC3H
S_17:           .word           0ECDH
S_18:           .word           0ED7H
S_19            .word           0EE1H
S_20            .word           0EEBH
S_21:           .word           0EF5H
S_22:           .word           0EFFH
S_23            .word           0F09H
S_24:           .word           0F13H
S_25:           .word           0F1DH
S_26            .word           0F27H
S_27:           .word           0F31H
S_28:           .word           0F3BH
S_29:           .word           0F45H
S_30:           .word           0F4FH
S_31:           .word           0F59H
S_32:           .word           0F63H
S_33:           .word           0F6DH
S_34:           .word           0F86H
S_35:           .word           0F9FH
S_36:           .word           0FB8H
S_37:           .word           0FD0H
S_38:           .word           0FEAH
S_39:           .word           1003H
S_40            .word           101CH
S_41:           .word           1035H
S_42:           .word           104EH
S_43:           .word           1067H
S_44:           .word           1099H
S_45:           .word           10CBH
S_46:           .word           10FDH
S_47:           .word           112FH
S_48:           .word           1161H
```

```
S_49:       .word       1193H
S_50:       .word       11C5H
S_51:       .word       1229H
S_52:       .word       125BH
S_53:       .word       12BFH
S_54:       .word       1323H
S_55:       .word       13C1H
S_56:       .word       14FCH
S_57:       .word       16D6H
S_58:       .word       194DH
S_59:       .word       1C62H
S_60        .word       2014H
S_61        .word       2465H
S_62:       .word       2954H
S_63:       .word       2EE0H
S_64:       .word       2EE0H

            FILL
            FILL
            FILL
            FILL
            FILL
            FILL
            FILL
            FILL
            FILL
            FILL
            FILL

            .end
```

What is claimed is:

1. A barrier operator for opening and closing a movable barrier, comprising:

a barrier drive;

means for detecting motion of the movable barrier;

means for detecting when a barrier command signal has been given to the barrier drive;

means for storing a commanded state of the barrier drive;

means for comparing the commanded state with the motion indicated by said barrier motion detection means, and for indicating if the motion conflicts with the commanded state; and

means for generating an alarm signal in response to the conflict indication of said comparing means.

2. A barrier operator for opening and closing a movable barrier according to claim **1**, further comprising means for enabling the alarm signal generating means a preselected time interval following closure of the barrier.

3. A barrier operator for opening and closing a movable barrier according to claim **2**, further comprising means for optically detecting the presence of an obstacle adjacent the barrier and producing an obstacle detection signal in response thereto, said obstacle detection means being inhibited in response to the means for enabling alarm signal generation.

4. A barrier operator for opening and closing a movable barrier according to claim **1**, further comprising a barrier position detection switch for generating a barrier closure signal when the barrier is substantially closed and providing the barrier closure signal to the means for generating the alarm signal indicative of the fact that the barrier has been closed.

5. A barrier operator for opening and closing a movable barrier according to claim **1**, further comprising means for causing the barrier drive to supply a closing force to the movable barrier in response to the alarm signal from the means for generating the alarm signal.

6. A barrier operator for opening and closing a movable barrier according to claim **5**, further comprising means for the barrier drive to cease supplying a closing force after a predetermined time interval.

7. A barrier operator for controlling a movable barrier, comprising,

a down limit detector disposed to indicate whether said barrier is at a closed position or not;

memory means for storing one of a set of states of said barrier, the set of states including a CLOSED state indicating said barrier is closed;

alarm generation means, responsive to the barrier state stored by said memory means and said down limit detector, for generating an alarm signal when the stored barrier state is CLOSED and said down limit detector indicates said barrier is not at a closed position; and

alarm enabling means for enabling said alarm generation means a preselected time interval after said barrier is closed.

8. A barrier operator according to claim **7**, wherein said alarm enabling means is responsive to an indication from said down limit detector that said barrier is closed for initiating the preselected time interval.

9. A barrier operator according to claim **7**, further comprising:

down motor signal means, for providing a down motor signal in response to said alarm signal; and

a barrier drive responsive to said down motor signal for closing said barrier.

10. A barrier operator according to claim **9**, further comprising:

obstacle detector for detecting an obstacle to movement of said barrier, and for generating an obstacle signal in response thereto; and

means for disabling said barrier drive in response to the obstacle signal.

11. A barrier operator according to claim **10**, wherein said obstacle detector comprises:

an optical light emitter for emitting light; and

an optical light detector for receiving the light from said emitter, and generating a signal indicative of whether light is received from said emitter or not.

12. A barrier operator according to claim **9**, wherein said alarm enabling means is disposed to continuously enable without a preselected time delay said alarm generation means after said alarm generation means has generated an alarm signal, and after said barrier drive has closed said barrier in response to said alarm signal.

13. A barrier operator according to claim **9**, further comprising:

a barrier drive motion detector for detecting actual motion of said barrier drive and generating a motion signal indicative thereof; wherein

said alarm generation means receives the motion signal and generates the alarm signal when the stored barrier state is CLOSED, said down limit detector indicates said barrier is not at a closed position, and said motion detector indicates motion of said barrier drive.

14. A barrier operator according to claim **9**, further comprising:

a command signal receiver for receiving a signal commanding said barrier to open, and generating an indication thereof; and

means for providing an up motor signal in response to the receiver indication; wherein

said barrier drive responds to the up motor signal by opening said barrier; and

said memory means stores a state selected from the set of barrier states, other than the CLOSED state, in response to the receiver indication.

15. A garage door operator for opening and dosing a garage door, comprising:

a motor for moving the garage door;

a down limit detector, for indicating when the garage door is moved to a closed position by said motor;

timer means enabled by the indication from said down limit detector that the garage door is closed, disposed to indicate when a preselected interval has expired;

command signal means for receiving a commanded state of the garage door; and

a microprocessor responsive to said command signal means for causing said motor to move the garage door to the commanded state, disposed to cause the motor to close the garage door when said timer means indicates the preselected interval has expired, said down limit detector indicates the garage door is not closed, and said command signal means has not received a new commanded state.

16. A garage door operator according to claim **15**, further comprising:

a tachometer for detecting rotation of said motor, and for providing an indication thereof to said microprocessor, wherein

said microprocessor is disposed to cause said motor to close the garage door when said timer means indicates the preselected interval has expired, said tachometer indicates said motor has rotated beyond a preselected threshold, and said command signal means has not received a new commanded state.

17. A garage door operator according to claim **15**, further comprising:

an optical obstacle detector, for optically detecting the presence of an obstacle adjacent the garage door and producing an obstacle detection signal in response thereto, wherein

said microprocessor is responsive to the obstacle detection signal to cease causing said motor to close the garage door.

18. A garage door operator according to claim **15**, wherein said command signal means comprises a radio frequency receiver.

19. A barrier operator for opening and closing a movable barrier, comprising:

a barrier drive;

a motion detector for detecting motion of the movable barrier;

a command signal detector for detecting when a barrier command signal has been given to the barrier drive;

circuitry for storing a commanded state of the barrier drive;

a controller for comparing the commanded state with the motion indicated by said barrier motion detector, and for indicating if the motion conflicts with the commanded state; and

a signal generator for generating an alarm signal in response to the conflict indication of said controller.

20. A barrier operator for opening and closing a movable barrier according to claim 19, further comprising apparatus for enabling the alarm signal generator a preselected time interval following closure of the barrier.

21. A barrier operator for opening and closing a movable barrier according to claim 20, further comprising an obstacle detector for optically detecting the presence of an obstacle adjacent the barrier and producing an obstacle detection signal in response thereto, said obstacle detector being inhibited in response to the signal generator for enabling alarm signal generation.

22. A barrier operator for opening and closing a movable barrier according to claim 19, further comprising a barrier position detection switch for generating a barrier closure signal when the barrier is substantially closed and providing the barrier closure signal to the signal generator indicative of the fact that the barrier has been closed.

23. A barrier operator for opening and closing a movable barrier according to claim 19, further comprising apparatus for enabling the barrier drive to supply a closing force to the movable barrier in response to the alarm signal from the signal generator for generating the alarm signal.

24. A barrier operator for opening and closing a movable barrier according to claim 23, wherein the barrier drive ceases supplying a closing force after a predetermined time interval.

25. A barrier operator for controlling a movable barrier, comprising:

a down limit detector disposed to indicate whether said barrier is at a closed position or not;

memory for storing one of a set of states of said barrier, the set of states including a CLOSED state indicating said barrier is closed;

an alarm generator, responsive to the barrier state stored by said memory and said down limit detector, for generating an alarm signal when the stored barrier state is CLOSED and said down limit detector indicates said barrier is not at a closed position; and

an alarm enabler for enabling said alarm signal generator a preselected time interval after said barrier is closed.

26. A barrier operator according to claim 25, wherein said alarm enabler is responsive to an indication from said down limit detector that said barrier is closed for initiating the preselected time interval.

27. A barrier operator according to claim 25, further comprising:

down motor circuitry, for providing a down motor signal in response to said alarm signal; and

barrier drive responsive to said down motor signal for closing said barrier.

28. A barrier operator according to claim 27, further comprising:

obstacle detector for detecting an obstacle to movement of said barrier, and for generating an obstacle signal in response thereto; and for disabling said barrier drive in response to the obstacle signal.

29. A barrier operator according to claim 28, wherein said obstacle detector comprises:

an optical light emitter for emitting light; and

an optical light detector for receiving the light from said emitter, and generating a signal indicative of whether light is received from said emitter or not.

30. A barrier operator according to claim 27, wherein said alarm enabler is disposed to continuously enable without a preselected time delay said alarm generator after said alarm generator has generated an alarm signal, and after said barrier drive has closed said barrier in response to said alarm signal.

31. A barrier operator according to claim 27, further comprising:

a barrier drive motion detector for detecting actual motion of said barrier drive and generating a motion signal indicative thereof;

wherein said alarm generator receives the motion signal and generates the alarm signal when the stored barrier state is CLOSED, said down limit detector indicates said barrier is not at a closed position and said motion detector indicates motion of said barrier drive.

32. A barrier operator according to claim 27, further comprising:

a command signal receiver for receiving a signal commanding said barrier to open, and generating an indication thereof; and

circuitry for providing an up motor signal in response to the receiver indication: wherein

said barrier drive responds to the up motor signal by opening said barrier; and

said memory stores a state selected from the set of barrier states, other than the CLOSED state, in response to the receiver indication.

33. A garage door operator for opening and closing a garage door comprising:

a motor for moving the garage door;

a down limit detector, for indicating when the garage door is moved to a closed position by said motor;

a timer enabled by the indication from said down limit detector that the garage door is closed, disposed to indicate when a preselected interval has expired;

a command signal receiver for receiving a commanded state of the garage door; and

a microprocessor responsive to said command signal receiver for causing said motor to move the garage door to the commanded state, disposed to cause the motor to close the garage door when said timer indicates the preselected interval has expired, said down limit detector indicates the garage door is not closed, and said command signal receiver has not received a new commanded state.

34. A garage door operator according to claim 33, further comprising:

a tachometer for detecting rotation of said motor, and for providing an indication thereof to said microprocessor; wherein

said microprocessor is disposed to cause said motor to close the garage door when said timer indicates the preselected interval has expired, said tachometer indicates said motor has rotated beyond a preselected threshold, and said command signal receiver has not received a new commanded state.

35. A garage door operator according to claim 33, further comprising:

an optical obstacle detector, for optically detecting the presence of an obstacle adjacent the garage door and producing an obstacle detection signal in response thereto, wherein

said microprocessor is responsive to the obstacle detection signal to cease causing said motor to close the garage door.

36. A garage door operator according to claim 33, wherein said command signal receiver comprises a radio frequency receiver.

37. A barrier operator for opening and closing a barrier comprising:

a command signal receiver for receiving barrier open and barrier close signals directing the opening or closing respectively of the barrier;

a barrier drive responsive to barrier open and barrier close signals for opening and closing the barrier, respectively;

a closed limit detector for sensing the closed state of the barrier; and

a barrier controller responsive to received command signals and the closed limit detector for generating an alarm signal when the barrier has been in the closed position and an attempt is made to raise the door when no door open command has been received.

38. A barrier operator according to claim 37 comprising a timer enabled by the closed limit detector for indicating that a predetermined period of time has passed.

39. A barrier operator according to claim 37 wherein the barrier drive responds to the alarm signal by applying a closing force to the barrier.

40. A method of controlling a movable barrier for movement between an open position and a closed position comprising:

receiving barrier movement commands including barrier open commands directing opening movement of the barrier and barrier close commands directing a closing movement of the barrier;

moving the barrier to the closed position in response to a barrier close command;

sensing that the barrier has been moved to the closed position; and

generating an alarm signal when the sensing step indicates that the barrier has moved from the closed position, and the receiving step does not indicate that a barrier open command has been received.

41. The method of claim 40 comprising directing closing movement of the barrier in response to the alarm signal.

* * * * *