

No. 834,220.






PATENTED OCT. 23, 1906.

E. L. AIKEN.

METHOD OF MAKING COILS FOR ELECTRICAL APPARATUS.

APPLICATION FILED AUG. 13, 1902.

2 SHEETS—SHEET 1.

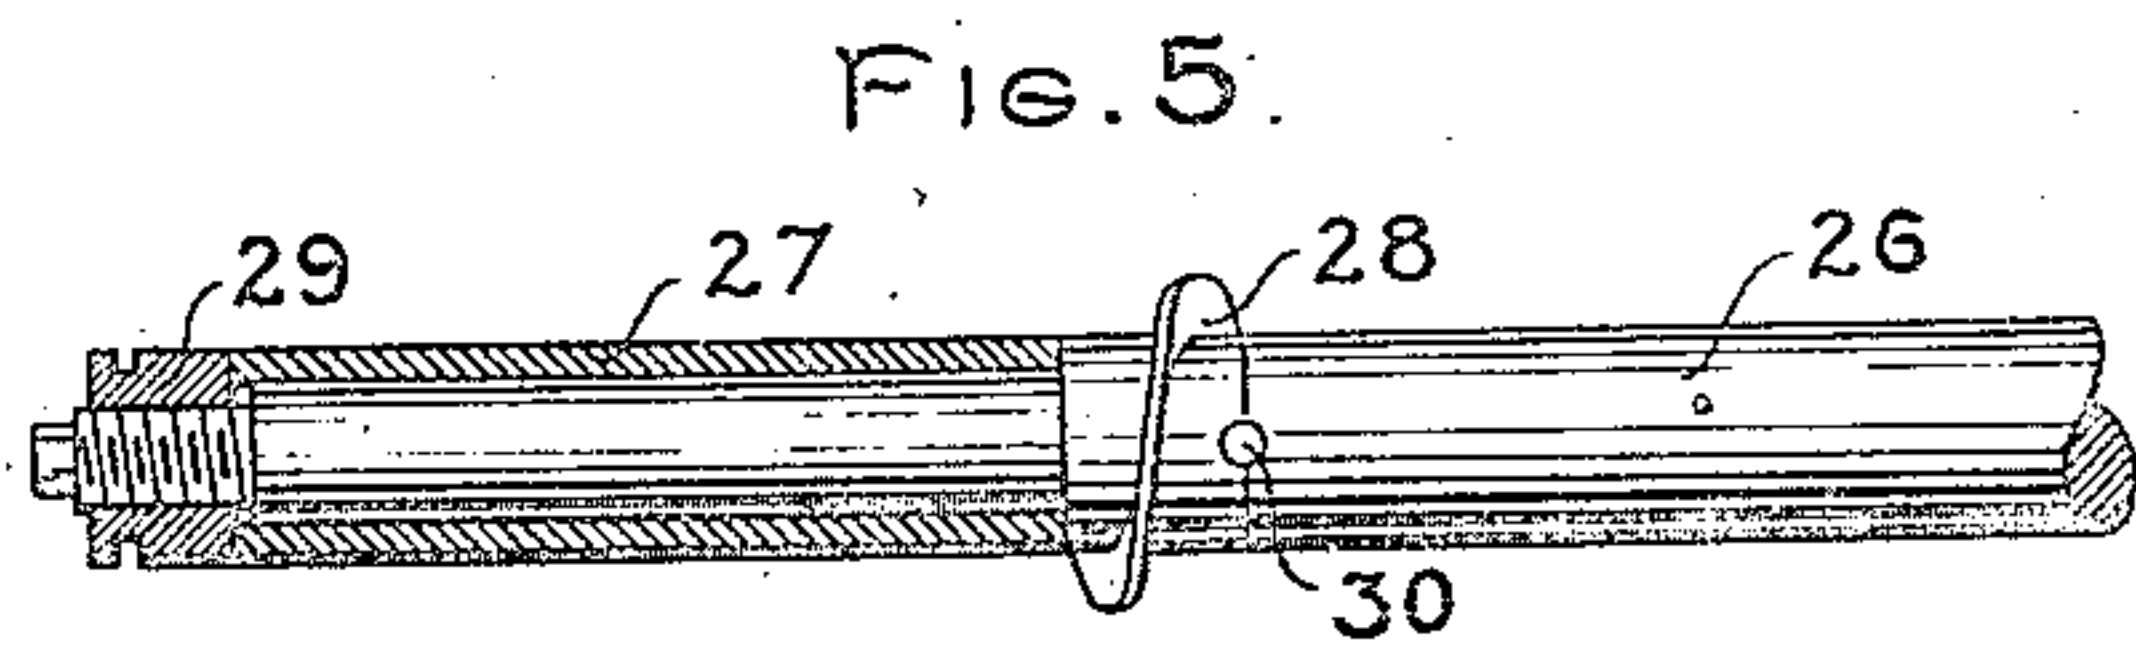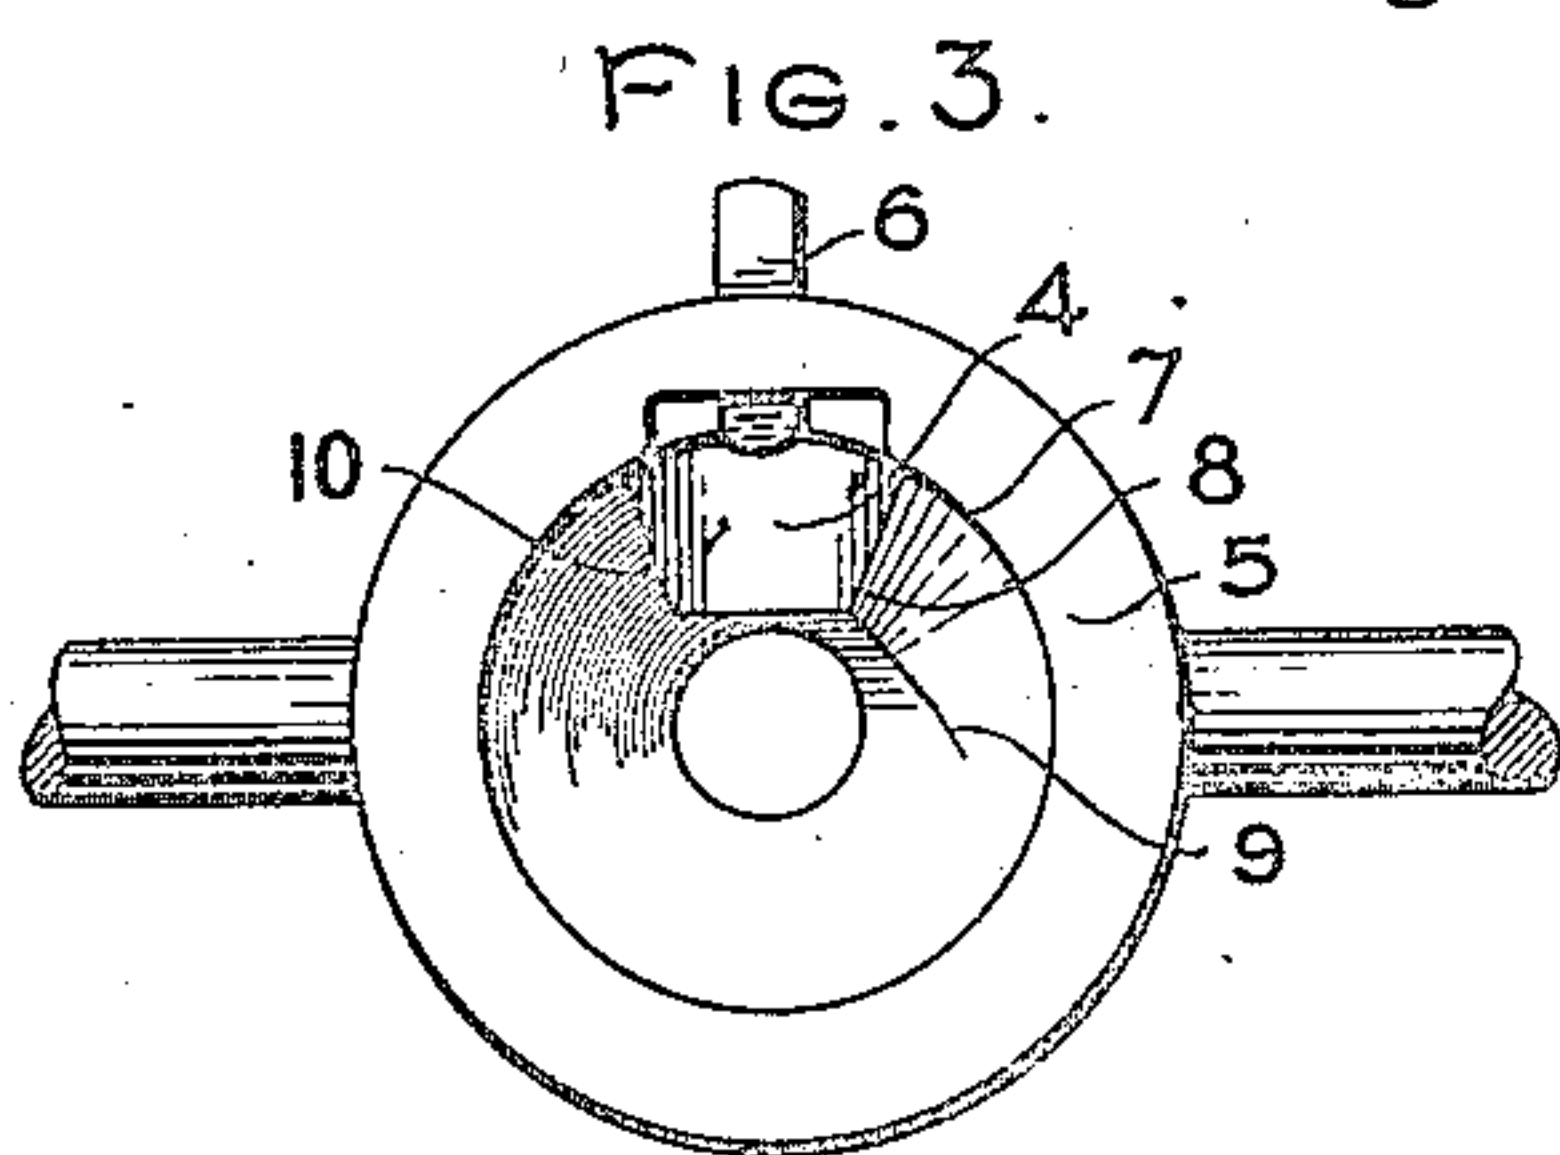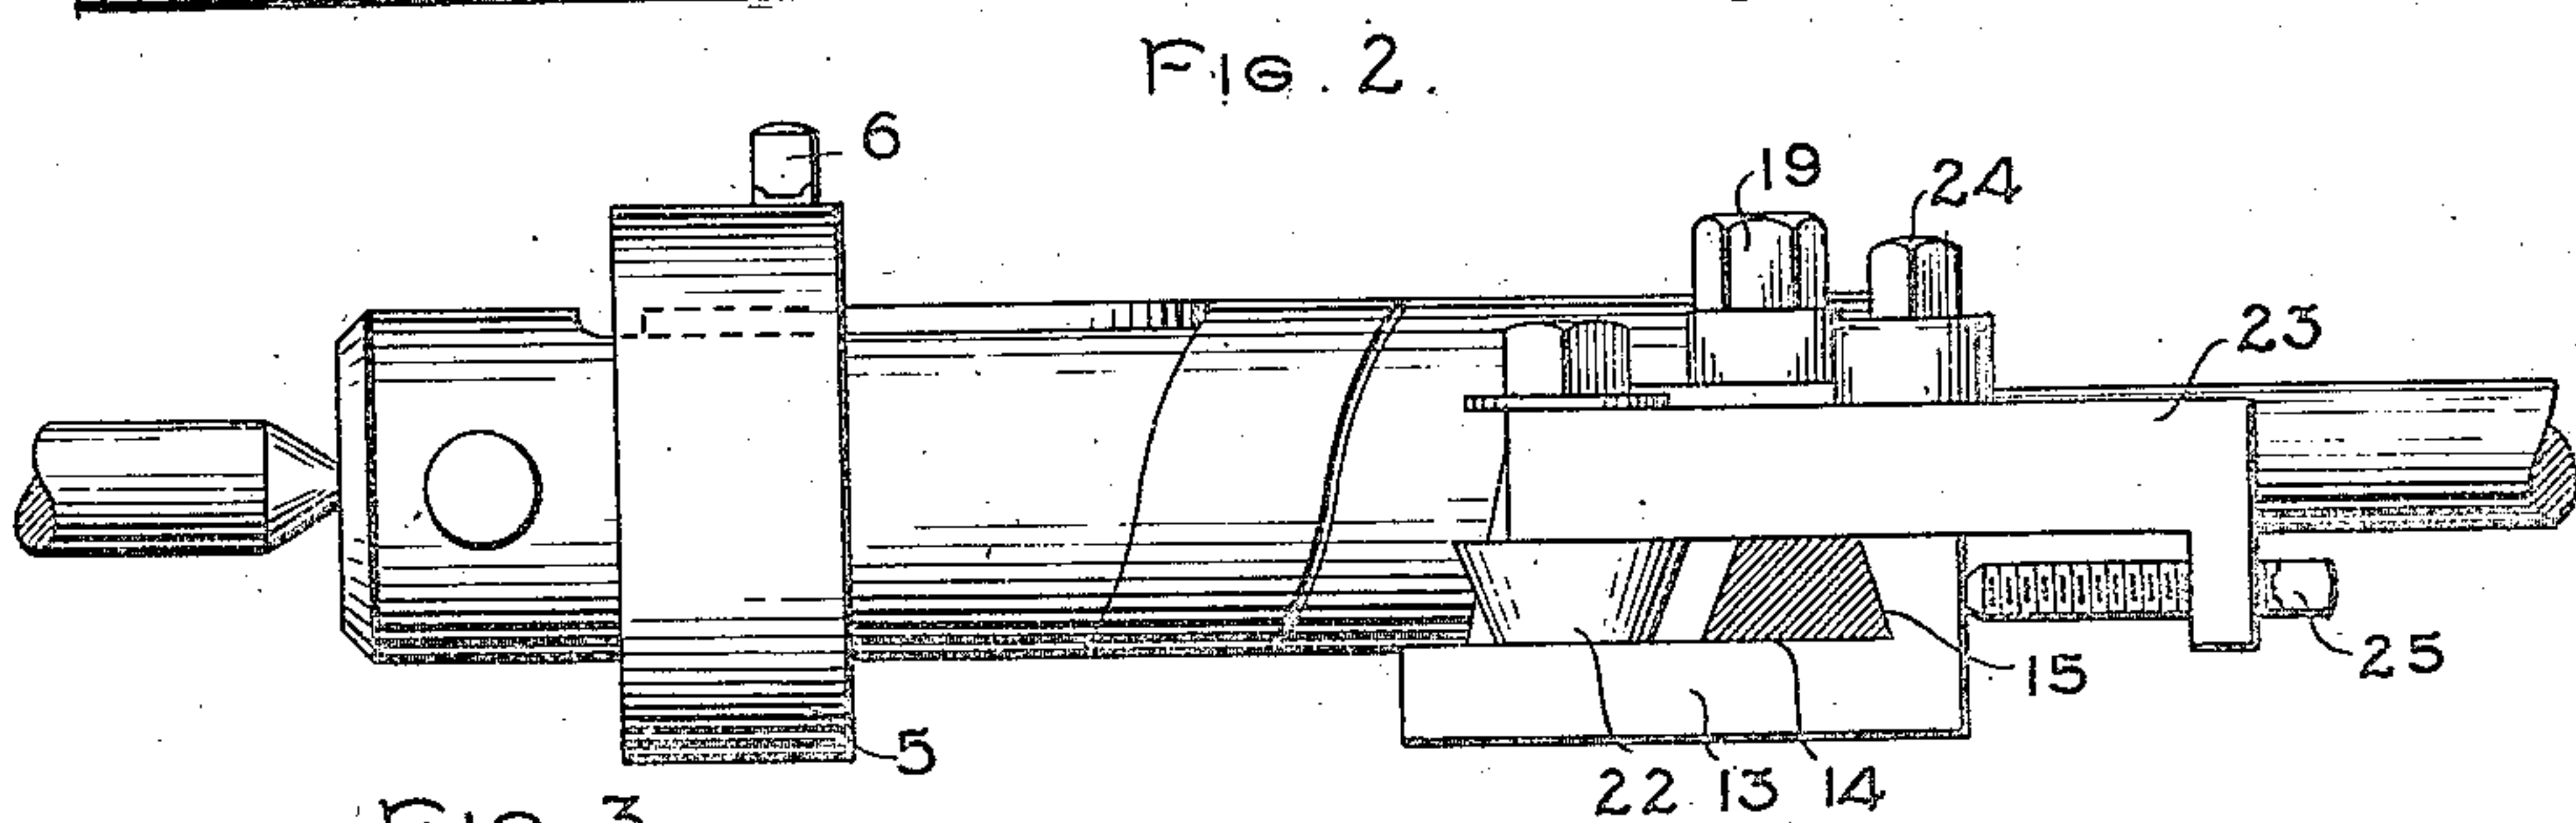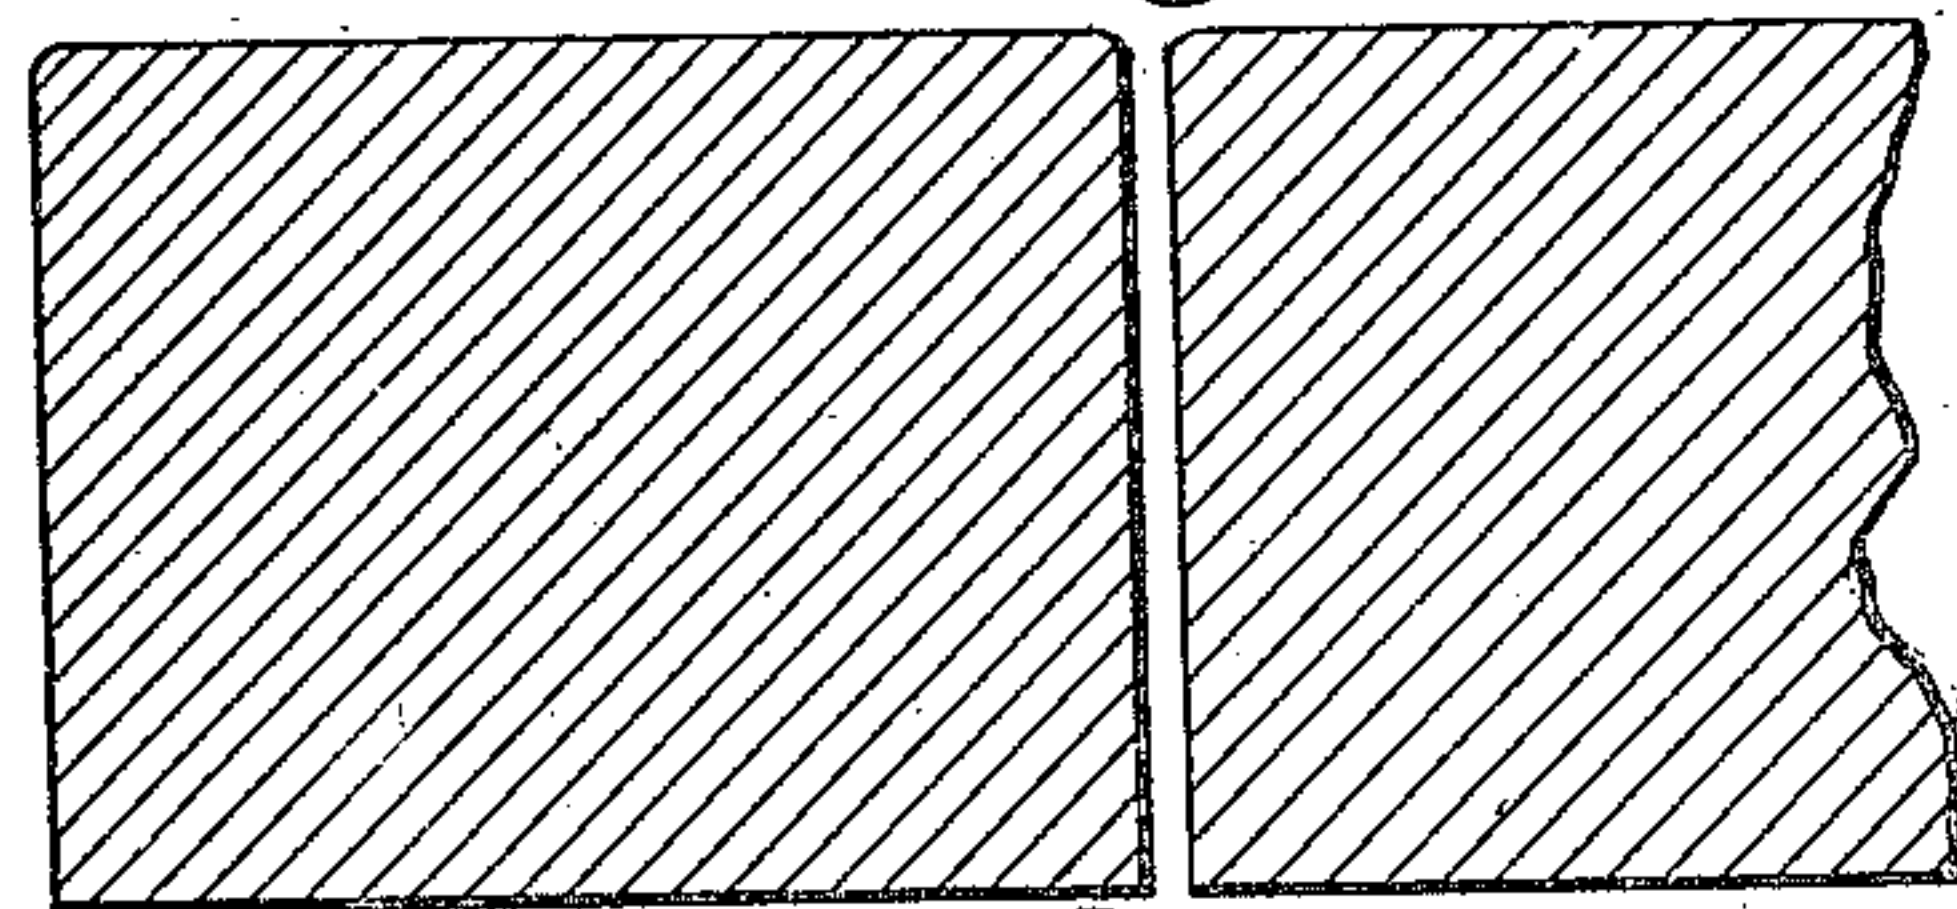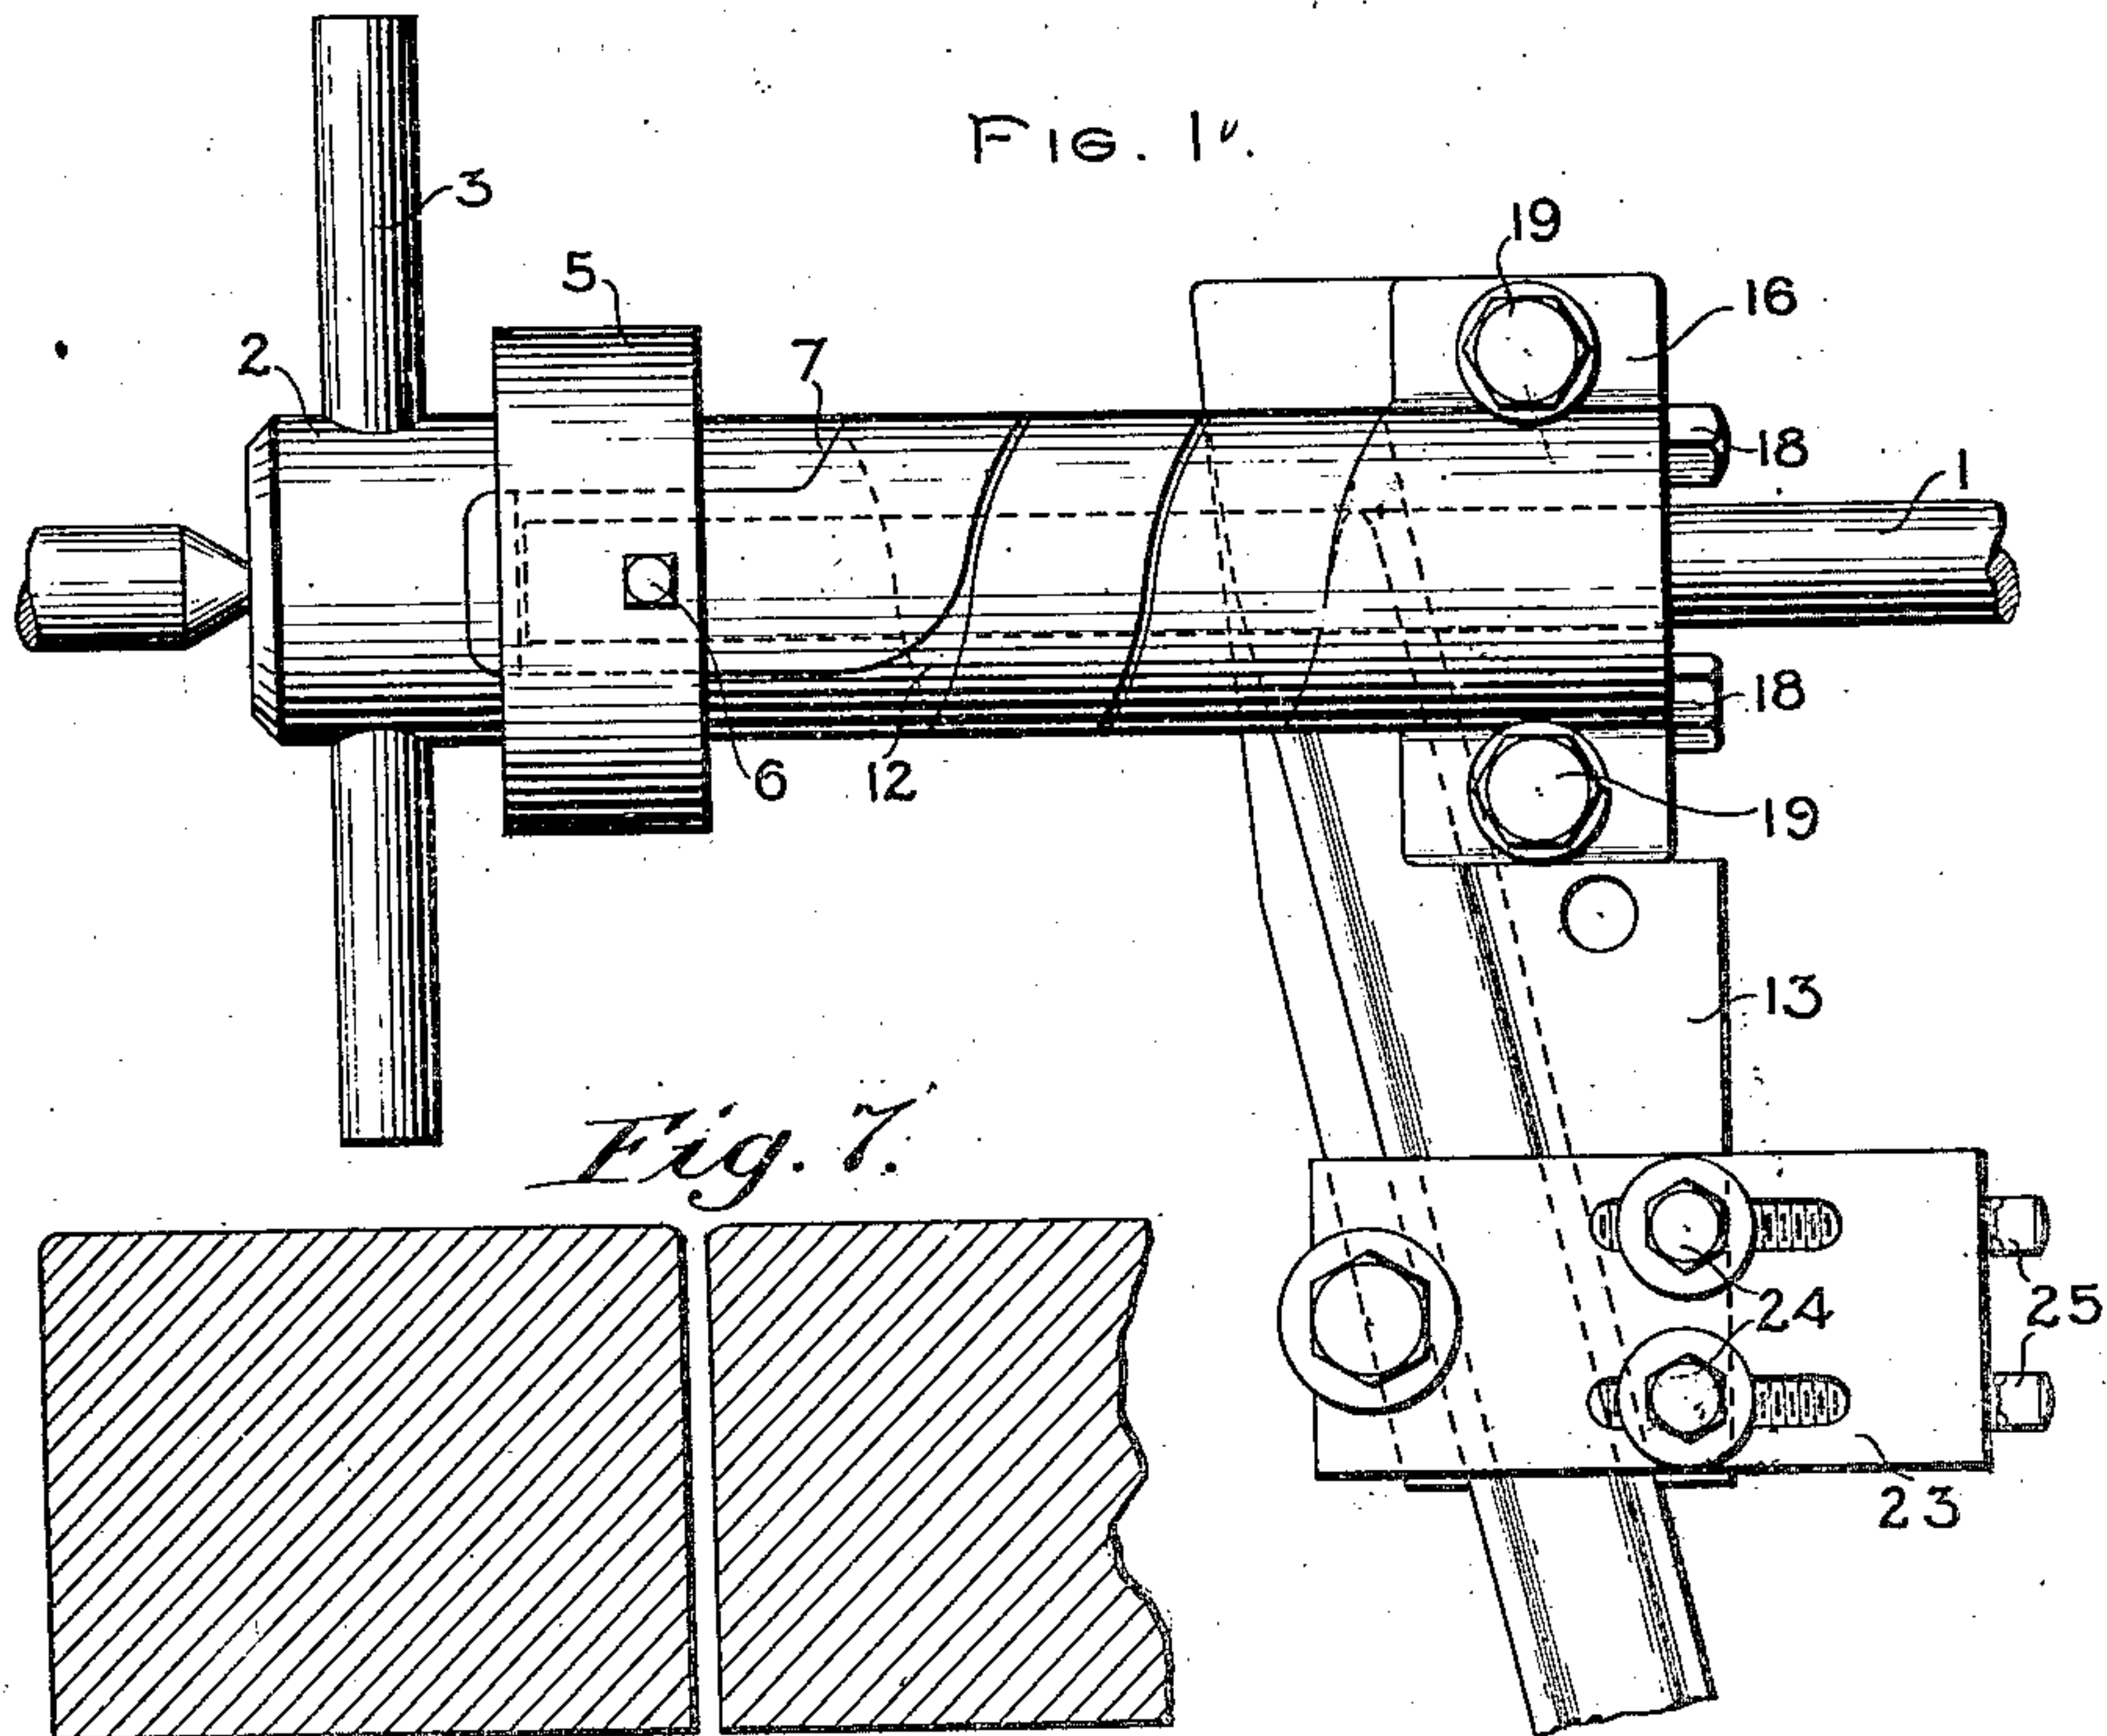

WITNESSES :

Harry H. Tilden
Benjamin B. Price

INVENTOR :

Edward L. Aiken.
by *Albert G. Davis*
ATTY.

No. 834,220.

PATENTED OCT. 23, 1906.

E. L. AIKEN.

METHOD OF MAKING COILS FOR ELECTRICAL APPARATUS.

APPLICATION FILED AUG. 13, 1902.

2 SHEETS—SHEET 2.

FIG. 4.

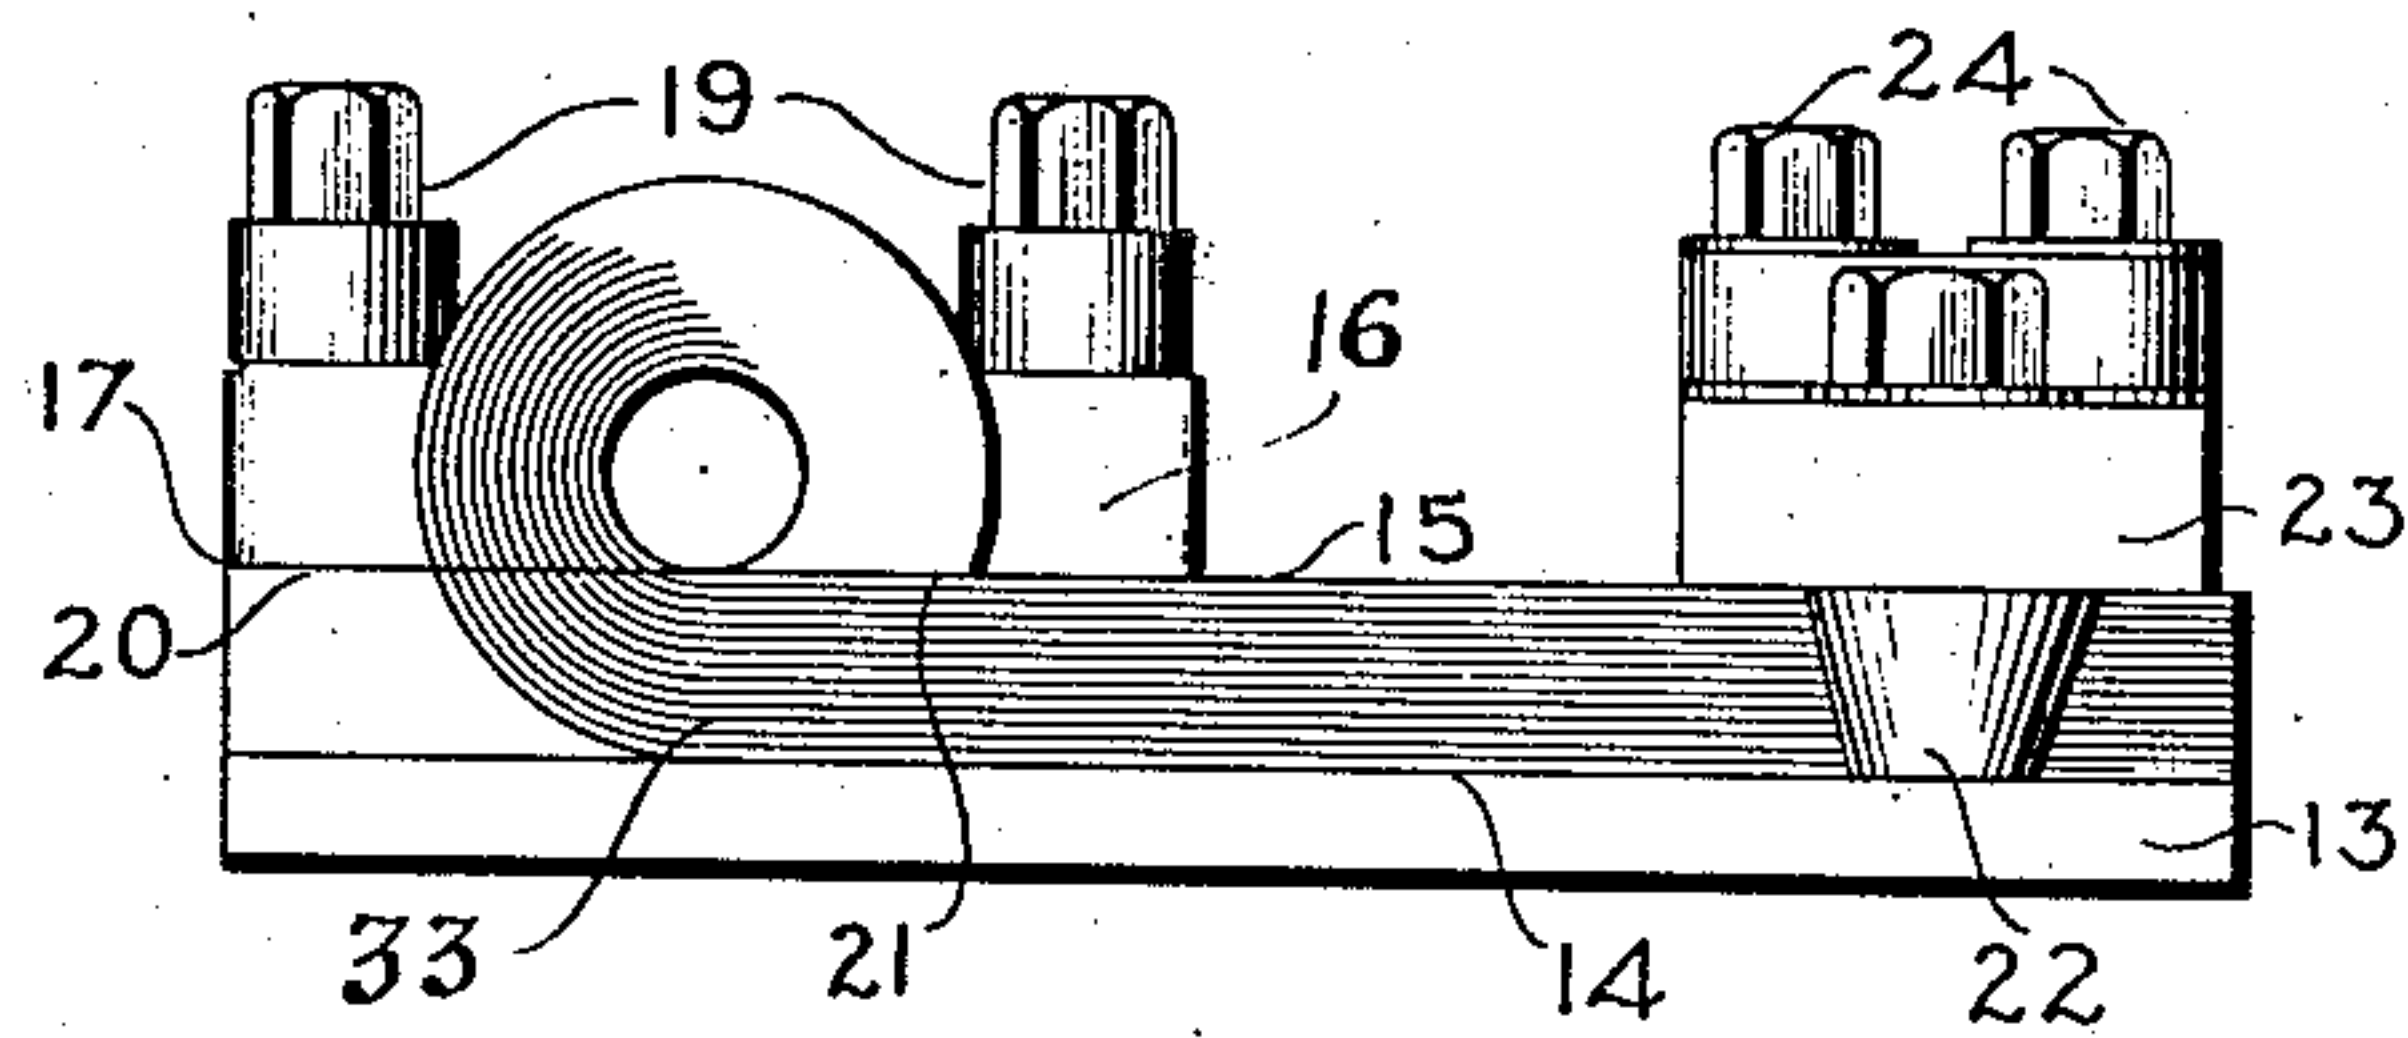


FIG. 6.


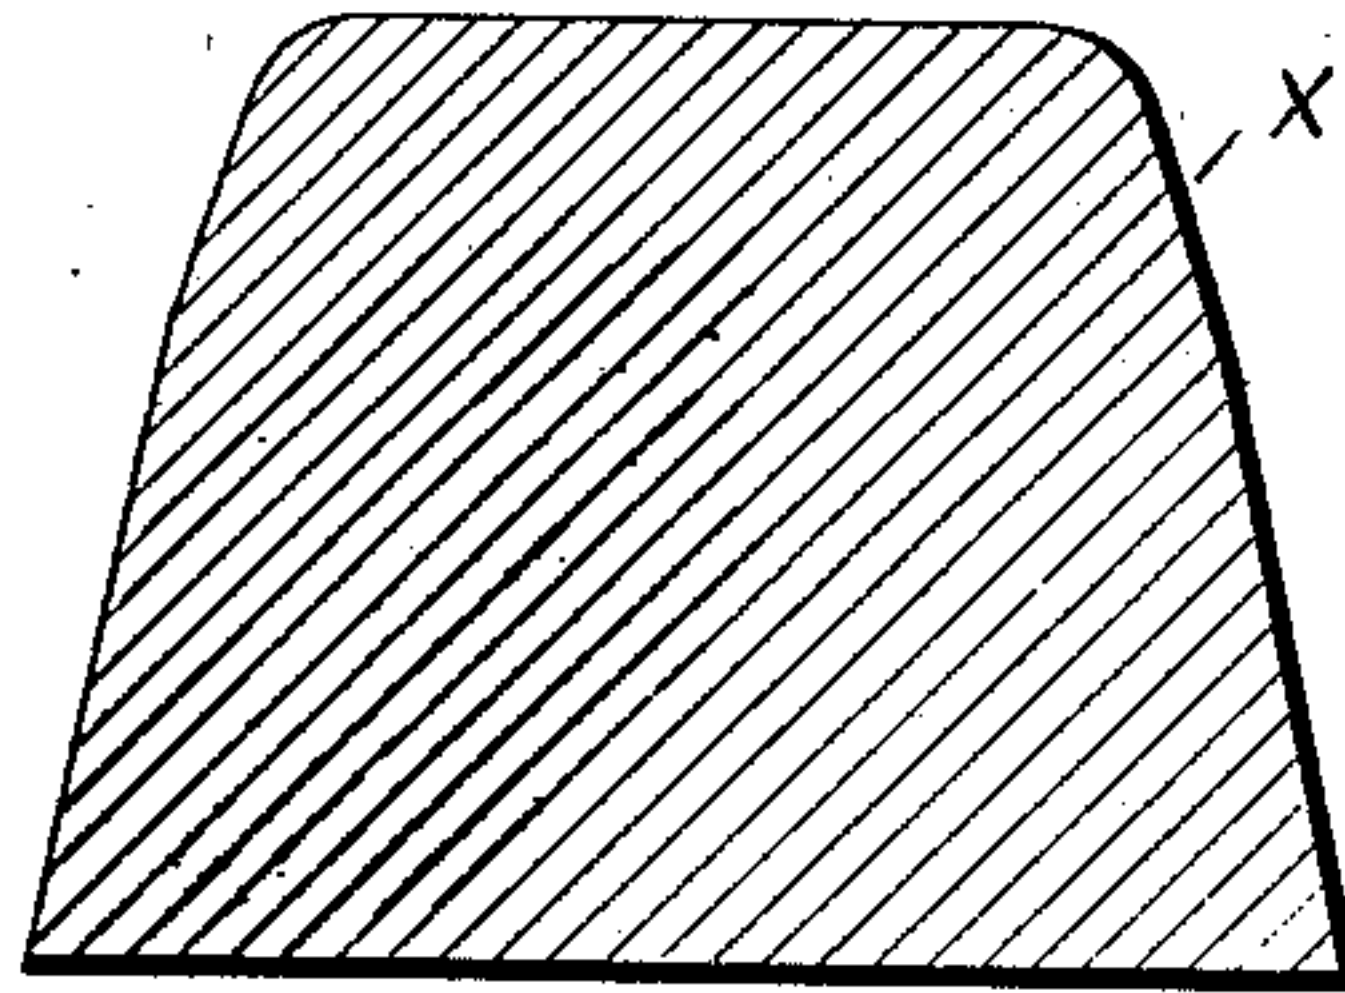


FIG. 8.

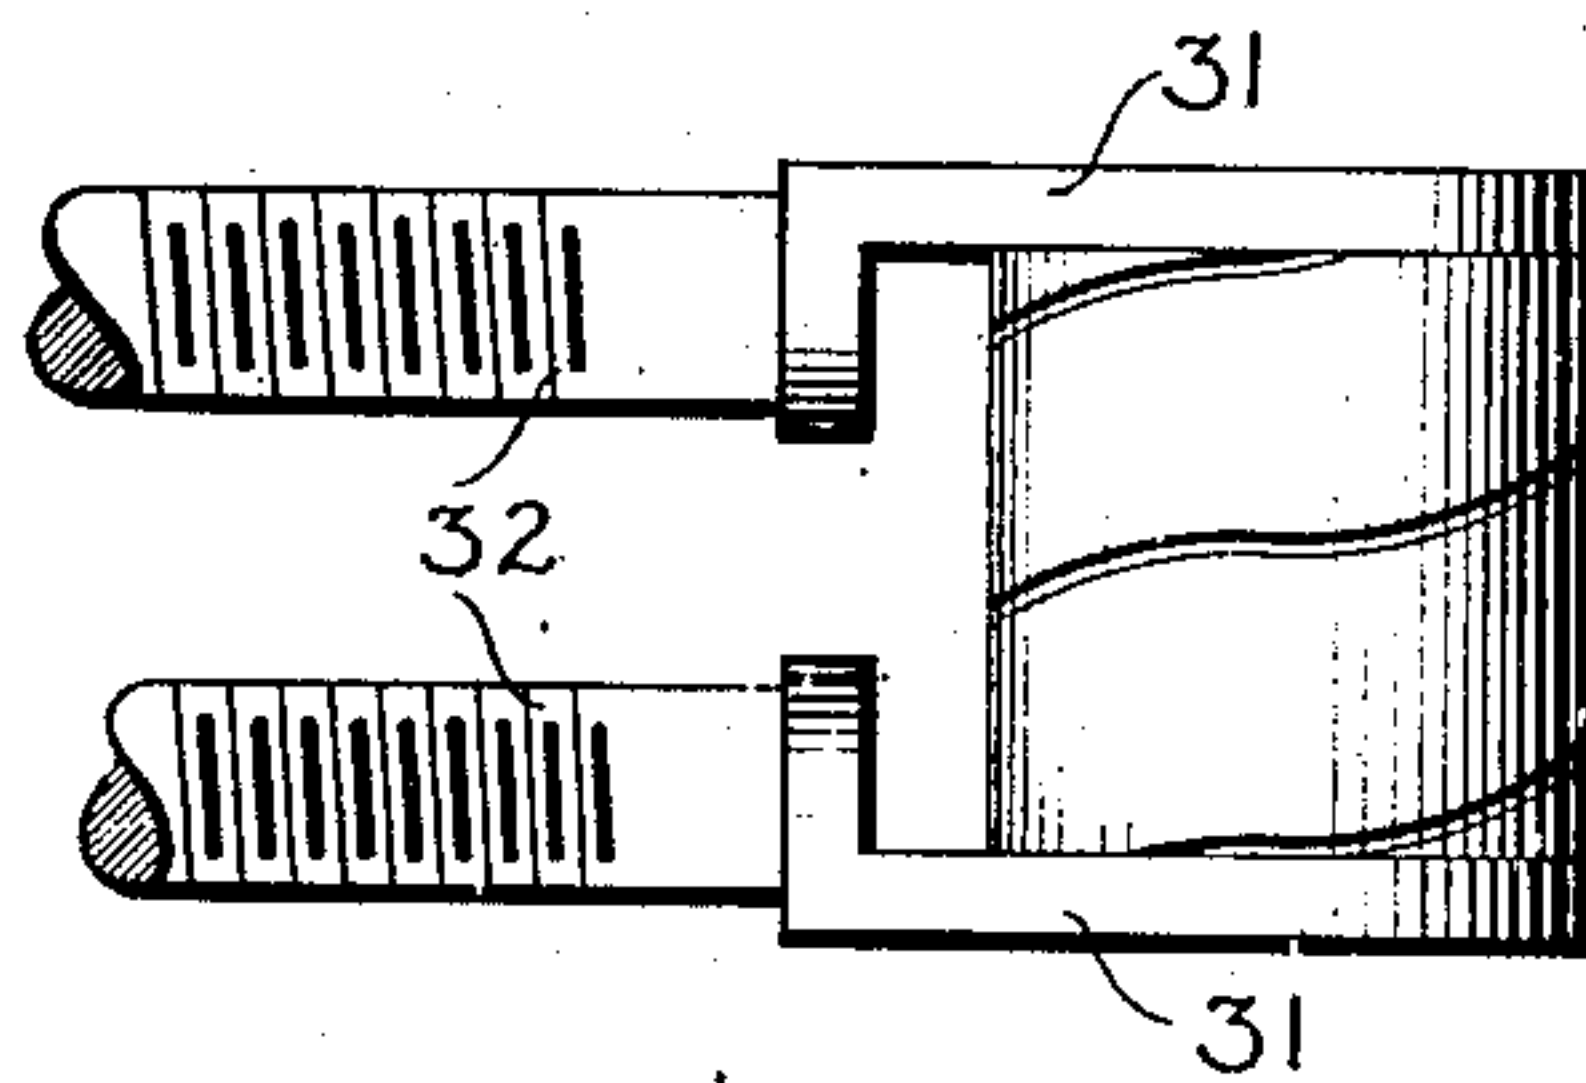

WITNESSES:

Harry A. Tilden
Benjamin B. Hill

INVENTOR

Edward L. Aiken.
by *Allen S. Bann*
att'y.

UNITED STATES PATENT OFFICE.

EDWARD L. AIKEN, OF SCHENECTADY, NEW YORK, ASSIGNOR TO GENERAL ELECTRIC COMPANY, A CORPORATION OF NEW YORK.

METHOD OF MAKING COILS FOR ELECTRICAL APPARATUS.

No. 834,220.

Specification of Letters Patent.

Patented Oct. 23, 1906.

Original application filed December 5, 1898, Serial No. 698,244, patented February 10, 1903, No. 720,092. Divided and application filed January 31, 1901, Serial No. 45,477. Again divided and this application filed August 13, 1902. Serial No. 119,522.

To all whom it may concern:

Be it known that I, EDWARD L. AIKEN, a citizen of the United States, residing at Schenectady, in the county of Schenectady, State of New York, have invented certain new and useful Improvements in Methods of Making Coils for Electrical Apparatus, (being a division of my prior application, Serial No. 45,477, filed January 31, 1901,) of which the following is a specification.

In certain forms of electromagnetically-actuated apparatus in which currents of large volume are utilized it is common to form the actuating-coils of but a small number of turns, but with the individual turns of large cross-sectional area in order to carry the currents employed without being unduly heated thereby. Heretofore these coils have been fashioned out of solid metal by operating upon a blank in the shape of a hollow cylinder. This blank was cut into the required form by the use of a traversing cutter in a screw-cutting lathe, or, if preferred, by the employment of a saw or milling-cutter in a milling-machine. The finished article resulting from this operation was open to several objections. Not only was the article thus formed expensive, but it possessed in addition the drawback due to the fact that the turns of the helix or coil were separated from each other by a considerable space, as was inevitable from the mode of manufacture employed. In order properly to carry out its function, the turns of the helix or coil need to be separated from each other only by a distance just sufficient to maintain them out of contact with each other. Where this distance is greater, as was the case in the coil resulting from the mode of manufacture above described, the length of the coil required to obtain a given magnetizing effect was increased, thus requiring the size of the parts operating in immediate conjunction therewith to be increased correspondingly, and so producing a bulky and cumbersome article. A further disadvantage of the old method was the resultant waste metal, which could only be scrapped.

It is the object of the present invention to obviate the disadvantages above set forth by producing a coil in which the turns are of comparatively large cross-sectional area and

are separated from each other by a space of a width just sufficient to allow the turns of the coil by their inherent rigidity to be maintained out of contact with each other. Instead of cutting the coil out of solid metal I produce a coil free from the disadvantages of the method of manufacture described by winding a rod, strip, or bar of suitable cross-sectional area about a mandrel while at a temperature below that of the softening-point of the metal. In carrying out this operation I make use of a guide having suitably-shaped working surfaces and movable longitudinally along the mandrel as the rod, bar, or strip is wound thereon, motion being communicated to the guide by reason of the pressure against its working surfaces of the coil as it is being wound. The pitch of the coil is thus determined by the particular character and curvature of the guiding-surfaces and is not due to any external means for feeding the carriage carrying the guide.

Broadly considered, my invention embraces the idea of winding a bar, rod, or strip of metal—such, for instance, as copper or an alloy of copper—on a mandrel of suitable diameter while at a temperature below the softening-point of the metal and preferably cold. In the particular method to be described the metal is forced into the required shape by passing it along the surface of a suitable guide or die.

Other aspects of my invention, including those more limited than that above set forth, will be more apparent from an inspection of the following description, taken in connection with the accompanying drawings, while the scope of the invention, both in its broad and its limited aspects, will be clearly and particularly pointed out in the appended claims.

In the drawings, Figure 1 is a plan view, and Fig. 2 is a side elevation, of an apparatus employed in carrying out my invention. Fig. 3 is an end view of a twisting-head forming part of the apparatus; and Fig. 4 is a side elevation of the guide, also forming part of the apparatus. Fig. 5 represents an adjunctive device used for separating the turns of a coil when the coil is closely wound. Fig. 6 is a full-sized cross-sectional outline of the rod employed in forming coils having turns of

large cross-sectional area. Fig. 7 is a cross-sectional outline of the rod after it is bent and also shows its spaced relation to the adjacent convolution, and Fig. 8 is a view of a coil as completely finished and ready to be assembled in some electrical apparatus.

The winding apparatus shown in the drawings comprises three essential features—first, the mandrel on which the coil is wound; second, the twisting-head or other device for winding the rod on the mandrel, and, third, the guide through which the rod passes as it is being wound and by which the pitch of the coil is determined. Such in its general nature is the apparatus used for winding the coils. As to its details reference must be had to the various figures of the drawings.

The mandrel about which the coil is wound is a plain cylindrical metallic rod of any desired diameter and is designated in the drawings as 1. In general the diameter of this rod is comparatively small, and it has been found by experience that if the force necessary to wind the coil on the mandrel were transmitted directly through the mandrel itself the mandrel would be twisted and broken off. For this reason one end of the mandrel is mounted so as to be freely rotatable within a cylindrical opening in the twisting-head 2, the diameter and the depth of the opening being indicated in Fig. 1 by the dotted lines, which represent the mandrel projecting into the body of the twisting-head. The mandrel 1 and the twisting-head 2 are mounted so as to rotate, and this rotation is secured by applying force to either or both ends of the bar 3, which projects through and is secured to the twisting-head. This twisting moment may be obtained in any desired manner other than in the way described. Although, if desired, a special machine may be constructed for this purpose, I find it convenient instead of so doing to mount the mandrel 1 and the twisting-head 2 between the head and tail centers of a sufficiently powerful engine-lathe. A center is drilled in the twisting-head in a line with the axis of the mandrel and another center is drilled in the free end of the mandrel. (Not shown.) The twisting-head is mounted on the head-center of the engine-lathe, and the bar or dog 3 engages a suitable projection or projections secured to the face-plate of the lathe.

The twisting-head already referred to and shown in detail in Fig. 3 has that end which surrounds the end of the mandrel cut away so as to form a helicoidal surface of less than one complete turn, the pitch of the helicoid being the same as that desired in the finished coil. In order to secure to the twisting-head the end of the rod which is to be wound upon the mandrel, a recess is formed in the twisting-head parallel to the axis of the hole or opening drilled therein and of a depth such that the bottom is practically tangent to such

opening or hole. The depth of this recess is shown at 4, Fig. 3. The width and cross-sectional shape correspond to the shape of the rod before being wound, and the recess itself extends along the twisting-head parallel with the axis a sufficient distance so that the twisting-head may obtain a firm grip on the end of the rod which is inserted in this recess. In order to hold the end of the rod in place after it has been inserted in this recess, a sleeve 5 is slipped over the twisting-head, and a set-screw 6 carried thereby serves to clamp the end of the rod in place. At the point where one side of the recess in the twisting-head cuts the helicoidal surface of the same the metal is cut away so as to form a rounded corner 7. The edge of this recess (shown at 8 in Fig. 3) is gradually merged into the helicoidal surface already referred to and is best shown at 9. The object of this formation is to prevent the presentation of sharp corners to the rod after it has been inserted under and clamped down by the set-screw 6 and with its free end bent around into the position for winding on the mandrel. From the point 7 the generatrix of the helicoidal surface of the twisting-head revolves about the axis of the mandrel and moves along the axis uniformly from left to right, as will be readily understood. Where this helicoidal surface intersects the wall 10 of the recess 4, an angular projection is formed, as shown, perhaps best at 12 in Fig. 1.

In winding a rod, bar, or strip on the mandrel the pitch at which the same is wound is determined, not by feeding the rod to the mandrel through the instrumentality of a positively-traversed guide, but by feeding it through a guide having surfaces such that the pressure of the rod against the guiding-surfaces as it is being wound forces the guide to traverse the mandrel longitudinally, the guiding-surfaces being such that the rod is wound on the mandrel at a pitch predetermined by the formation and relation of the guiding-surfaces referred to. In order to permit of this mode of operation, the guide is mounted in such a manner as to be free to move parallel with the axis of the mandrel, but restrained from rotation about it. Where the operation of winding is carried on in an engine-lathe, the guide may be mounted on the slide-rest of the lathe, the longitudinal and cross feeds of the slide-rest being disconnected, so as to allow the same free motion along the ways of the lathe resisted only by the friction incident to such motion.

In matter of detail, the guide may either be cut out of solid metal or built up from separate pieces for convenience in mechanical construction and operation. Owing to the difficulty, however, of forming the required guiding-surfaces out of a solid block of metal, I find it more convenient to fashion the same out of separate pieces, the pieces being bolted

together in proper relation when finished. In the drawings I have shown the guide as made in two parts, which I find it convenient to designate as a "base" and a "cap" piece. The base is indicated at 13 and has formed thereon straight guiding-surfaces, along which the rod or the like is passed as it is fed to the mandrel. These straight guiding-surfaces consist of two intersecting planes, one of which is parallel to the axis of the mandrel and is approximately tangent to the coil after it is wound on the mandrel, sufficient space, however, being left between this surface and the surface of the coil to allow for clearance. The other surface of the straight guide is formed by a plane which intersects the plane guiding-surface already mentioned, and is inclined thereto at an angle less than a right angle. This angle is such as to coincide with the angle made by the base of one side of the rod or bar as it passes to the mandrel. The line formed by the intersection of these two guiding-surfaces is inclined to the axis of the mandrel at an angle corresponding to the pitch of the coil to be wound, as will readily be understood. The two guiding-surfaces spoken of are perhaps best indicated at 14 and 15 in Figs. 2 and 4, and the rod to be bent is shown in cross-section adjoining these surfaces in Fig. 2. The top surface of the base of the guide is planed away parallel to the surface 14, so as to be on a level with the top of the rod when placed in position against the guiding-surfaces, the construction being best shown in Fig. 2. The cap-piece 16, which forms the other part of the guide, consists of a block of metal having a hole drilled therethrough of such diameter as to make a working fit with the mandrel. For a portion of its length parallel to the axis of this hole the cap-piece is planed away tangent to the hole, thus leaving the cap-piece with a downwardly-projecting lip, which makes a right angle with the flat cut-away portion. The plane along which the cap-piece is cut away is clearly shown at 17 in Fig. 4. The cap-piece is fitted over one edge of the base 13 and is secured thereto by bolts 18, which pass through the downwardly-projecting lip of the cap-piece into one side of the base, and by bolts 19, which pass down through the cap-piece into the base-piece. That side of the cap-piece which is nearest to the plane guiding-surfaces 14 and 15, already described, is cut into a guiding-surface in the form of a helicoid, the generatrix of which makes a right angle with the axis of the hole in the cap-piece and the pitch of which corresponds to the pitch of the coil to be wound. Owing to the fact that the guiding-surface 15 (shown in Fig. 4) is inclined to the axis of the opening in the cap-piece at an angle different from the inclination to such axis of the generatrix of the helicoidal surface formed on such cap-piece it is evident that the two sur-

faces can never be so related as to pass smoothly from one into the other. The angle which would otherwise be formed when this condition is obtained, as nearly as possible, is therefore cut and smoothed away, so as to merge one surface into the other. The point at which this merger takes place is indicated approximately at 33, Fig. 4. The helicoidal surface proper of the cap-piece commences along the line indicated at 20 and terminates along the line 21, which indicates the outer edge of the projecting angle of the cap-piece, under which passes the rod to be wound, as will be seen from Figs. 1 and 4.

It is of course to be understood that the guide as a whole is bolted or otherwise secured to the slide-rest of the lathe, so that the hole in the cap-piece has its axis in common with the axis of the mandrel, and so that the mandrel as a whole is free to rotate and slide in the opening in the cap-piece.

The rod or bar which is to be wound is maintained in contact with the straight guiding-surfaces by means of a roller 22, carried by an adjustable plate 23, held down by bolts 24 to the top surface of the base 13. The guide or antifrictional roller 22 is in the form of a truncated cone, of such nature as to bear against one of the sides of the trapezoidal-shaped rod or bar to be next described, the opposite side of which is by the pressure of this roller maintained in contact with the guiding-surface 15, all of which is best shown in Fig. 2. The securing-plate 23 serves to hold down the rod or bar against the flat guiding-surface 14. The position of the guiding-roller 22 may be adjusted by means of the adjusting-screws 25 passing through the downward projection of the plate 23 and bearing against the side of the base 13.

In winding a rod of any appreciable thickness about a mandrel the outer circumference of the finished coil is greater than the inner circumference, and it consequently follows that the metal on the outer circumference of the coil is stretched, while that on the inner is condensed or compressed. As a result of this action the cross-section of a turn of the finished coil is different from the cross-section of the rod or bar before being wound, the width of the outer dimension of a turn of the coil being less than the corresponding dimension of the bar from which the turn is formed. In order, therefore, to obtain a coil in which the turns have a cross-section substantially rectangular, it is necessary to employ in making the coil a rod or bar the cross-section of which is trapezoidal, the rod or bar being fed to the mandrel with its shorter parallel side in contact therewith. If the trapezoidal section of the rod or bar properly corresponds to the diameter of the mandrel and the pitch of the finished coil, the trapezoidal section will be changed to a rectangular section during the process of winding. A

bar of the trapezoidal section referred to is shown in Figs. 1 and 2 in the operation of being wound on a mandrel.

Where rods or bars of large cross-sectional area are wound, it has been found in practice that the edge of the coil in contact with the mandrel bulges out under the longitudinal and radial compression, so as to cause the turns in a closely-wound coil to make contact with each other along their inner edges. In order to allow for and prevent the metal from flowing in this manner, I chamfer or cut away the corners formed by the intersection of the non-parallel sides with the shorter of the two parallel sides of the rod or bar which is to be wound. Fig. 6 indicates in outline the general form of the cross-section of a bar fashioned in this manner. The corners of the trapezoid are cut away, as indicated at *x*. I consider this formation of the blank from which the coil is formed as novel and important, especially in cases where a closely-wound coil of large cross-sectional area is to be produced.

Little remains to be said as to the operation of the mechanism described. The end of the bar to be wound is bent nearly to a right angle and is inserted in the twisting-head 2, in which it is secured by the set-screw 6, carried by the sleeve 5. The guide 13 is brought up and the straight guiding-surfaces thereof placed in contact with the rod or bar as it projects from the twisting-head. The antifriction-roller 22 and its carrying-plate 23 are then secured in position and the operation of winding upon the mandrel 1 is then ready to commence. As the twisting-head is turned the rod or bar is gradually drawn into the guide and is forced to traverse the straight and the helicoidal surfaces thereof and in so doing is bent into a helicoid the pitch of which corresponds to the pitch of the helicoidal surface of the guide. By properly proportioning the width of the bar or rod to be wound to the pitch of the helicoidal surface of the guide a coil may be obtained with any desired distance between the turns. For the purpose for which I intend to employ then coils made by this apparatus this proportion may be made such as to leave just sufficient distance between the turns of the coil to maintain them out of contact, although it is obvious that any other desired proportions may be employed without departing from my invention.

In some cases where the turns of the coil are not of unduly large cross-section the turns are wound closely together and are afterward separated by screwing through the coil and between its turns a small section of fin-like screw-thread. Such a screw-

thread, together with its carrying-mandrel, is shown in Fig. 5, in which 26 indicates the mandrel proper, 27 the sleeve forced by means of the nut 29 against the short sleeve carrying the screw-thread 28. The pin 30, engaging with the mandrel and with the sleeve bearing the integrally-formed screw-thread 28, prevents the screw-thread from turning about the mandrel 26.

In Fig. 8 is shown a view of the coil in its finished condition and ready to be assembled in an electrical apparatus. This coil consists of a small number of turns cut from the long length of coil ordinarily wound in one operation of the mechanism above described. To the ends of this short length of coil angle-pieces 31 are secured by sweating and brazing or in any other manner to give good electrical connection. Bolts 32 are secured to the projecting ends of the angle-pieces and serve both as mechanical supports for the coil and as conductors for conveying the current supplied thereto.

Although the coil of the nature described and the method and apparatus for manufacturing the same as above set forth are peculiarly applicable in connection with the manufacture of electrical apparatus, it will of course be evident that my invention as regards these features is not to be limited in its scope to any particular utilization of the product which is the result of my invention.

What I claim as new, and desire to secure by Letters Patent of the United States, is—

1. The method of forming helical coils with uniform spaces between the adjacent edges of the respective turns, which consists in forcing a strip of metal of large trapezoidal cross-section into the shape of a helix with its respective turns in contact and thereafter separating said turns by causing a spreader to pass therebetween to produce a permanent set in said turns.

2. The method of forming an electromagnetic-coil consisting in giving a bar of metal a substantially trapezoidal section and with the inner corners chamfered, and winding said bar about a mandrel whereby the innermost parts are compressed longitudinally and radially, and the outermost parts are extended longitudinally and contracted transversely so that the respective turns of the coil may be separated by spaces of uniform width.

In witness whereof I have hereunto set my hand this 8th day of August, 1902.

EDWARD L. AIKEN.

Witnesses:

BENJAMIN B. HULL,
ALMA L. MEUSCHKE.