
W. BAXTER, Jr. GOVERNOR FOR ELECTRIC MOTORS.


No. 384,117.

Patented June 5, 1888.

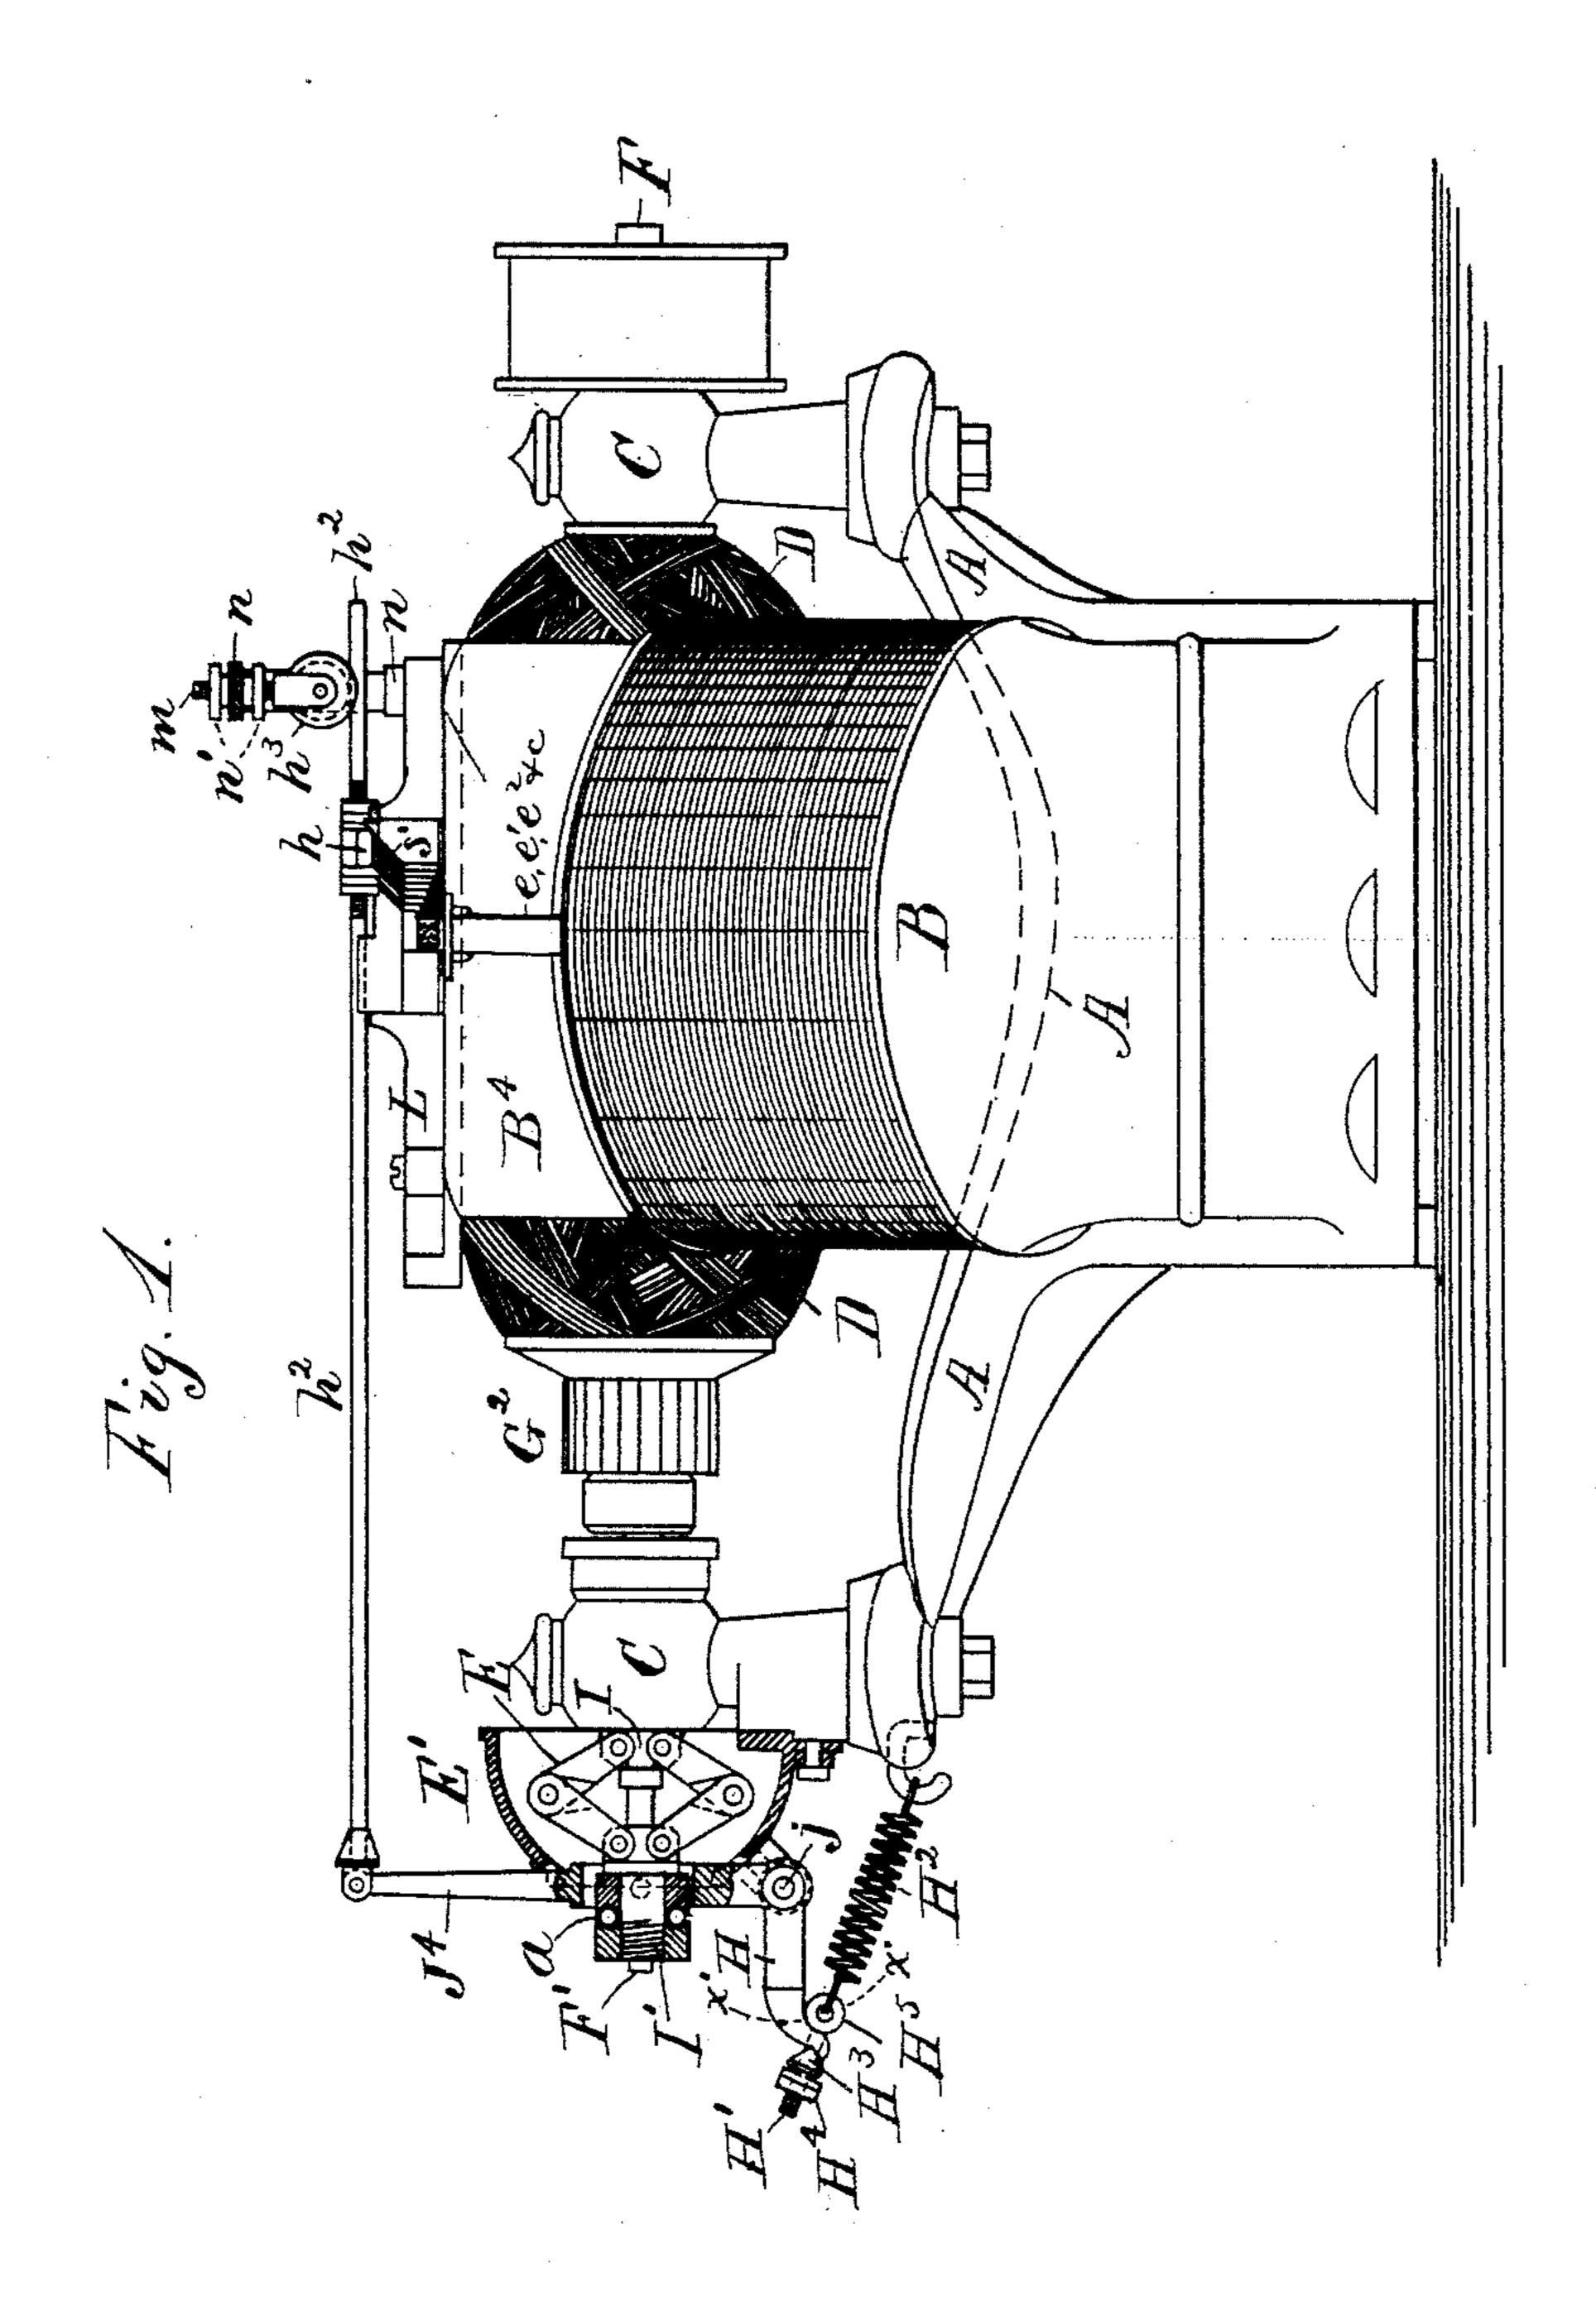

Attest: L. Love. F. Hischer, In ventor. William Baxter, Tr. per brane Muiller, Attys.


W. BAXTER, Jr. GOVERNOR FOR ELECTRIC MOTORS.

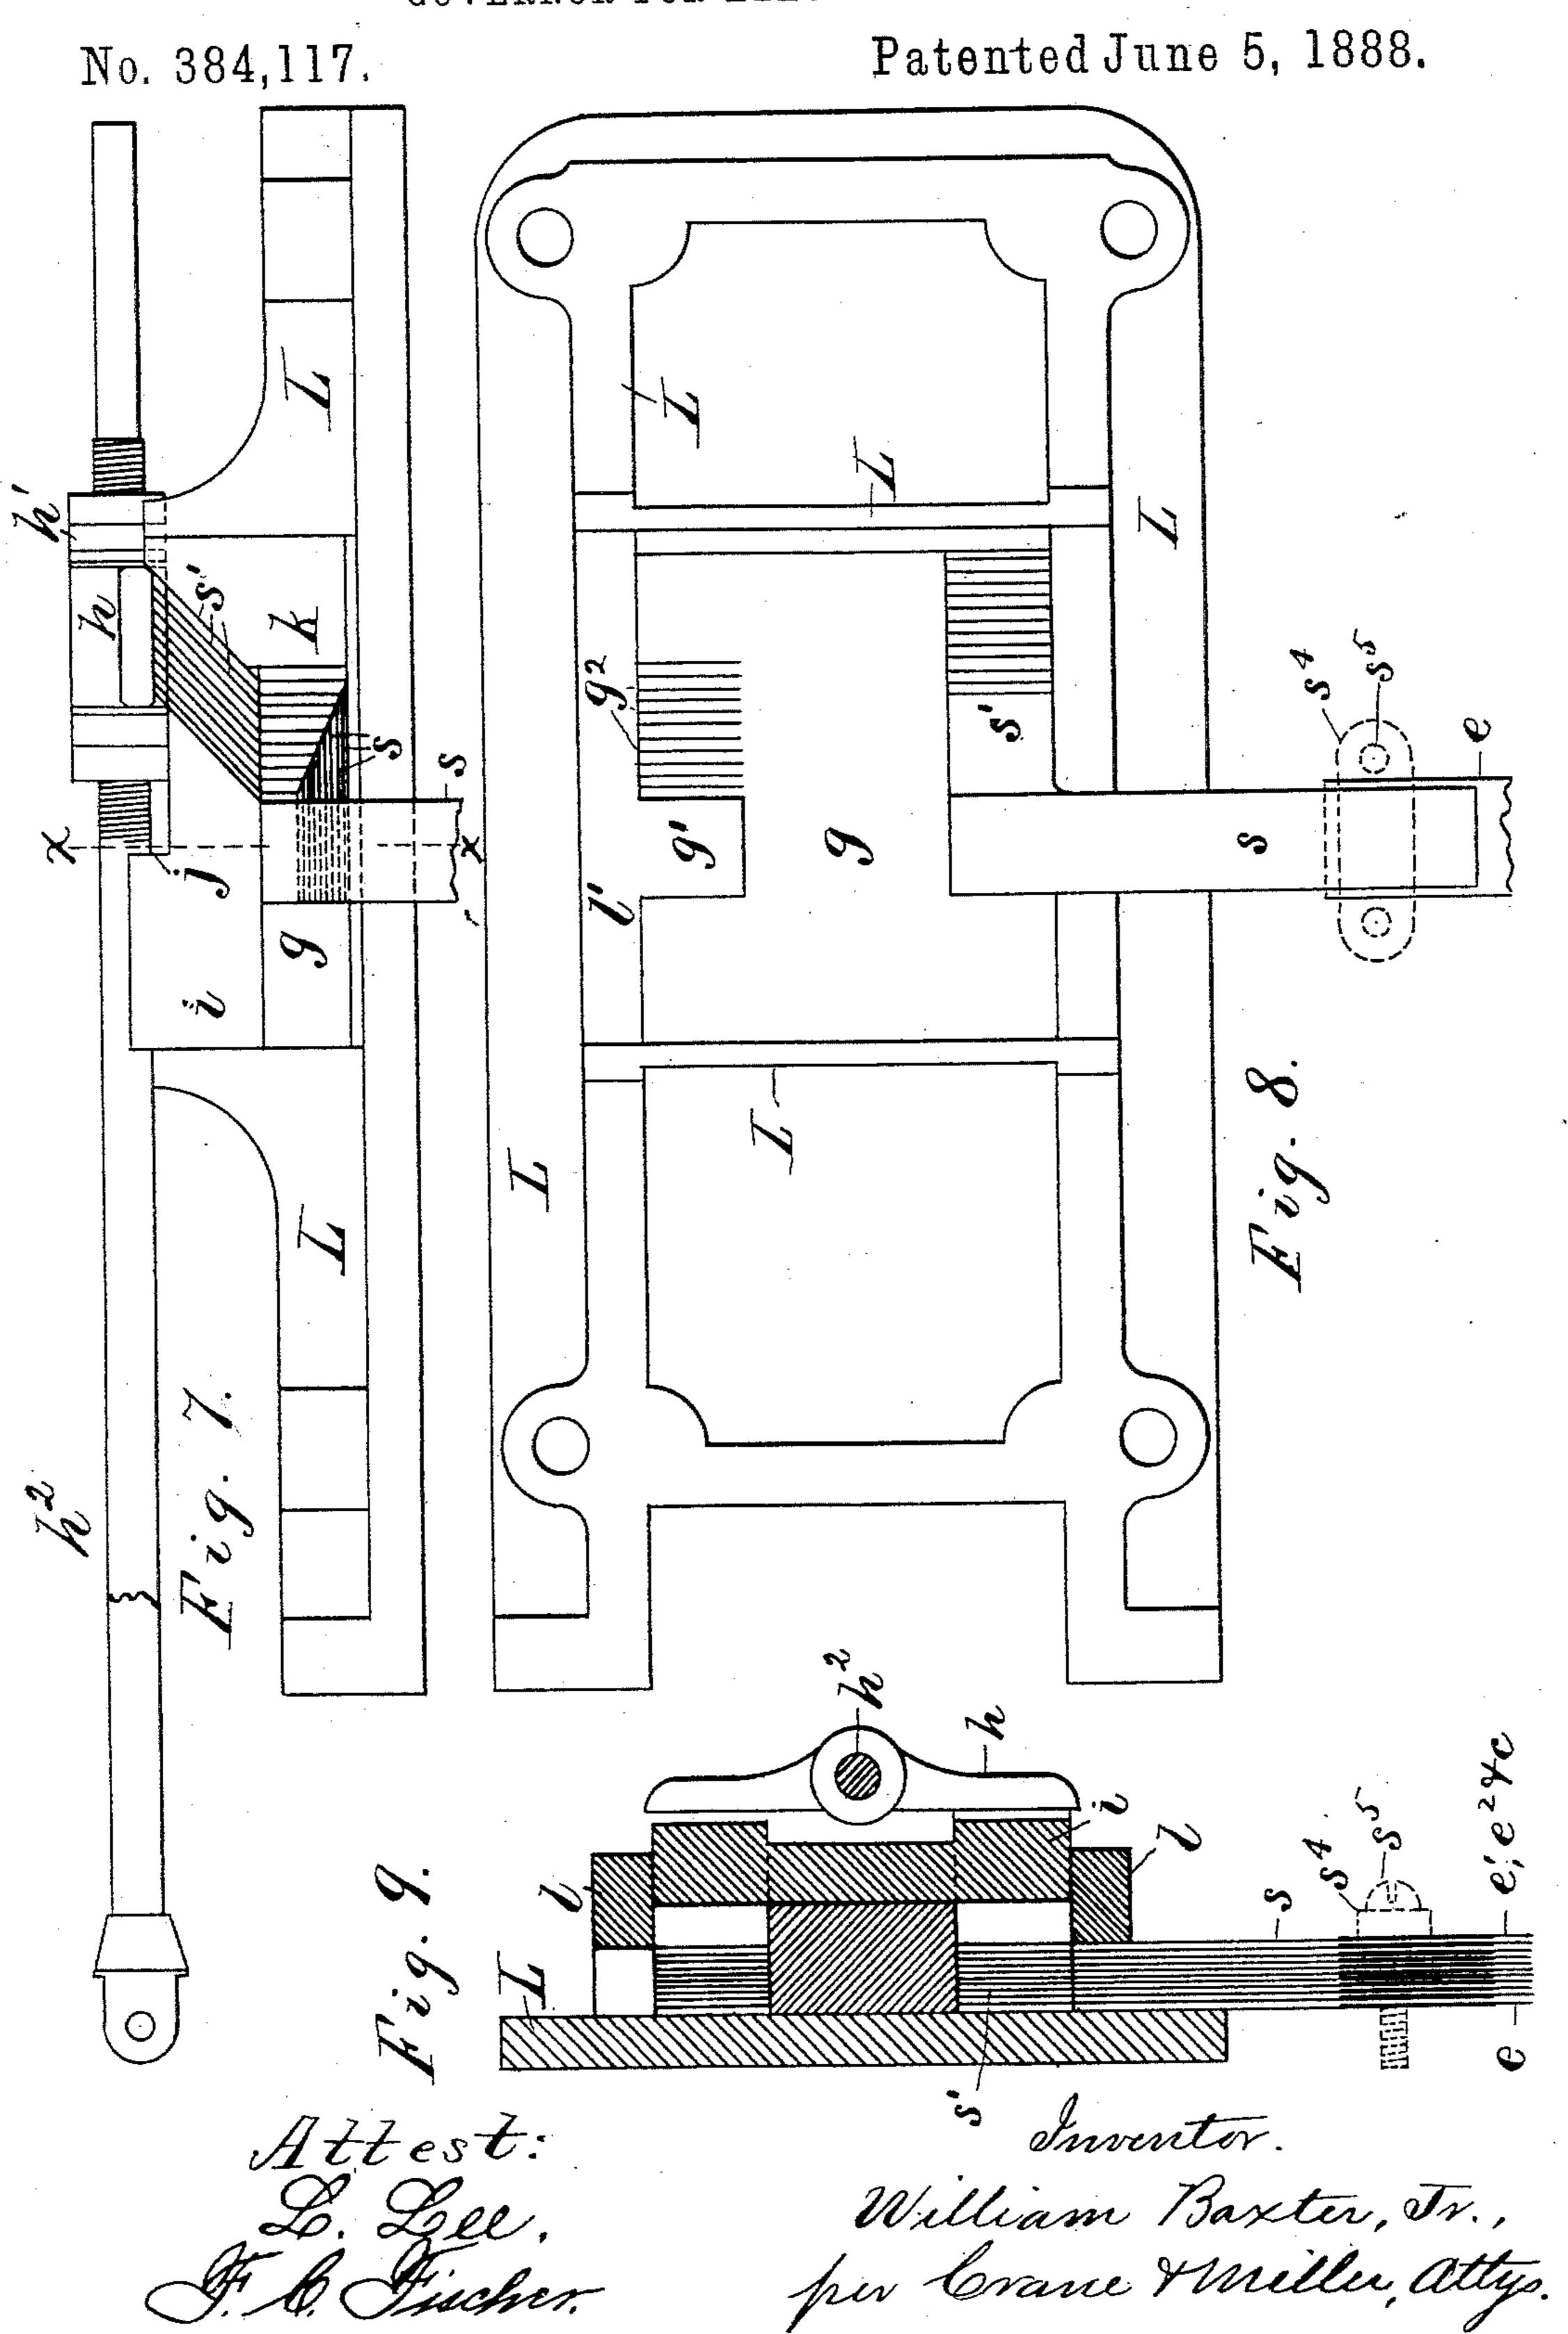

W. BAXTER, Jr. GOVERNOR FOR ELECTRIC MOTORS.

No. 384,117.

Patented June 5, 1888.

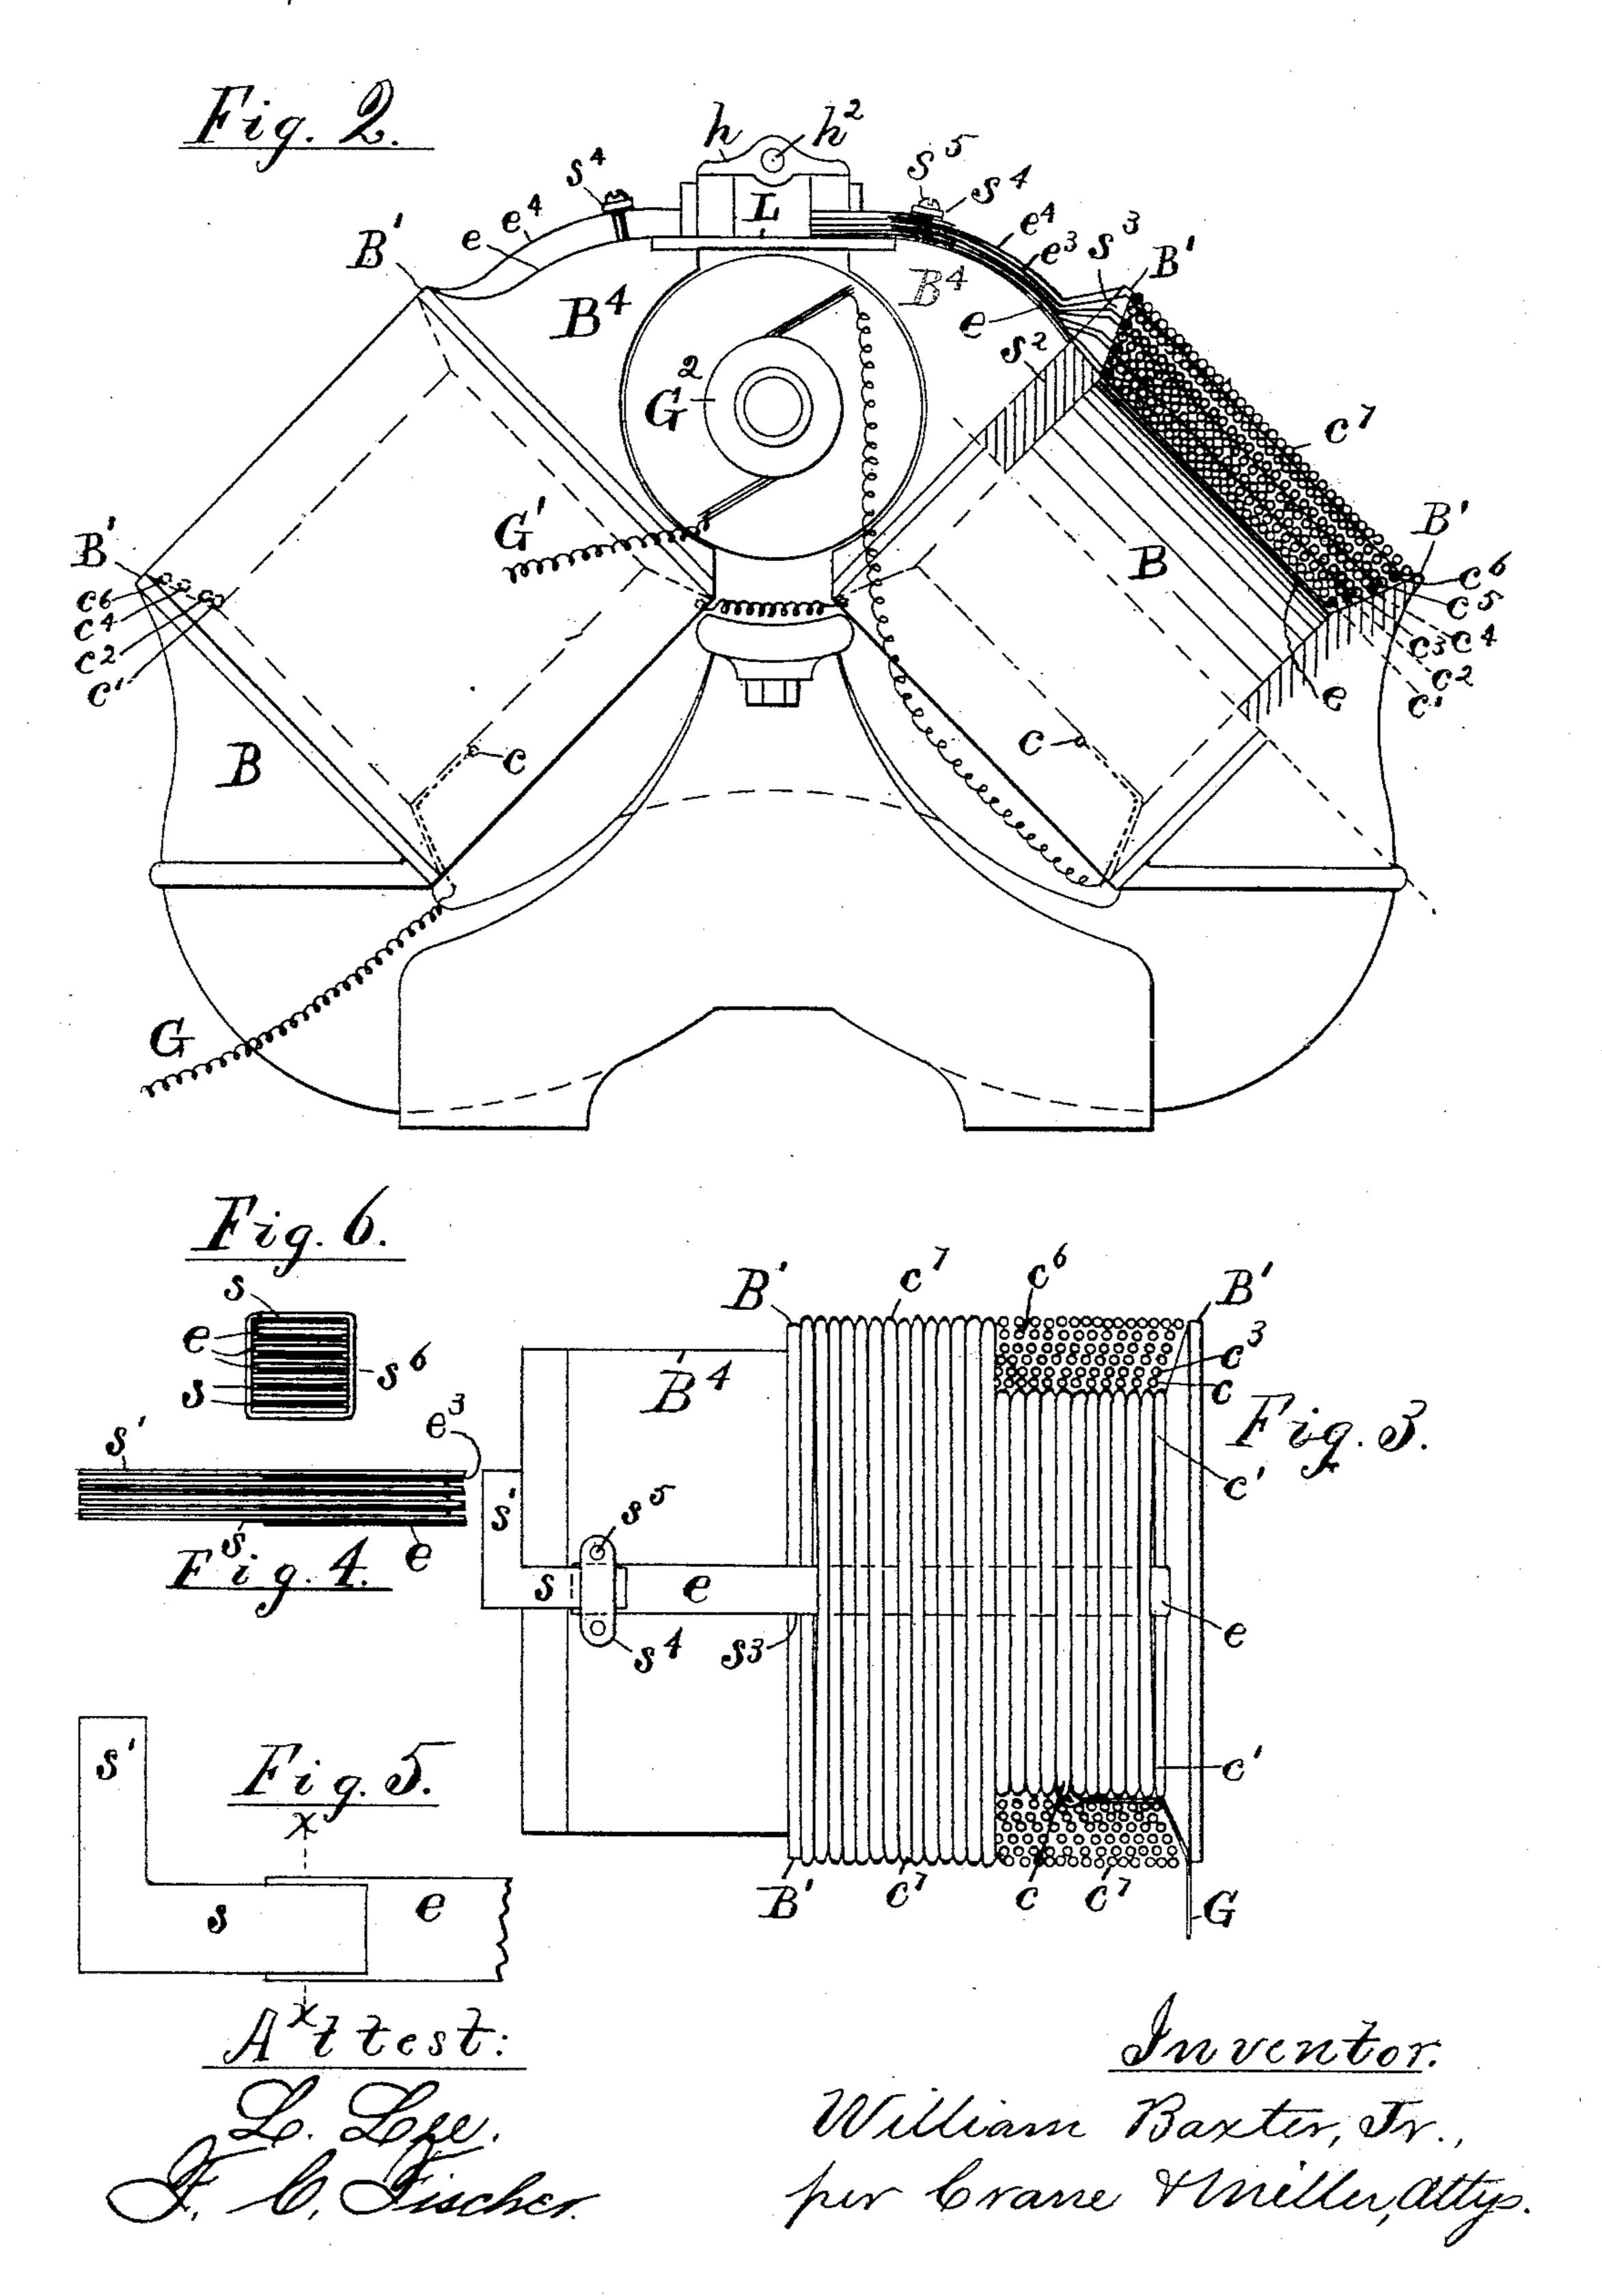


(No Model.)

W. BAXTER, Jr.


GOVERNOR FOR ELECTRIC MOTORS.

No. 384,117.

Patented June 5, 1888.

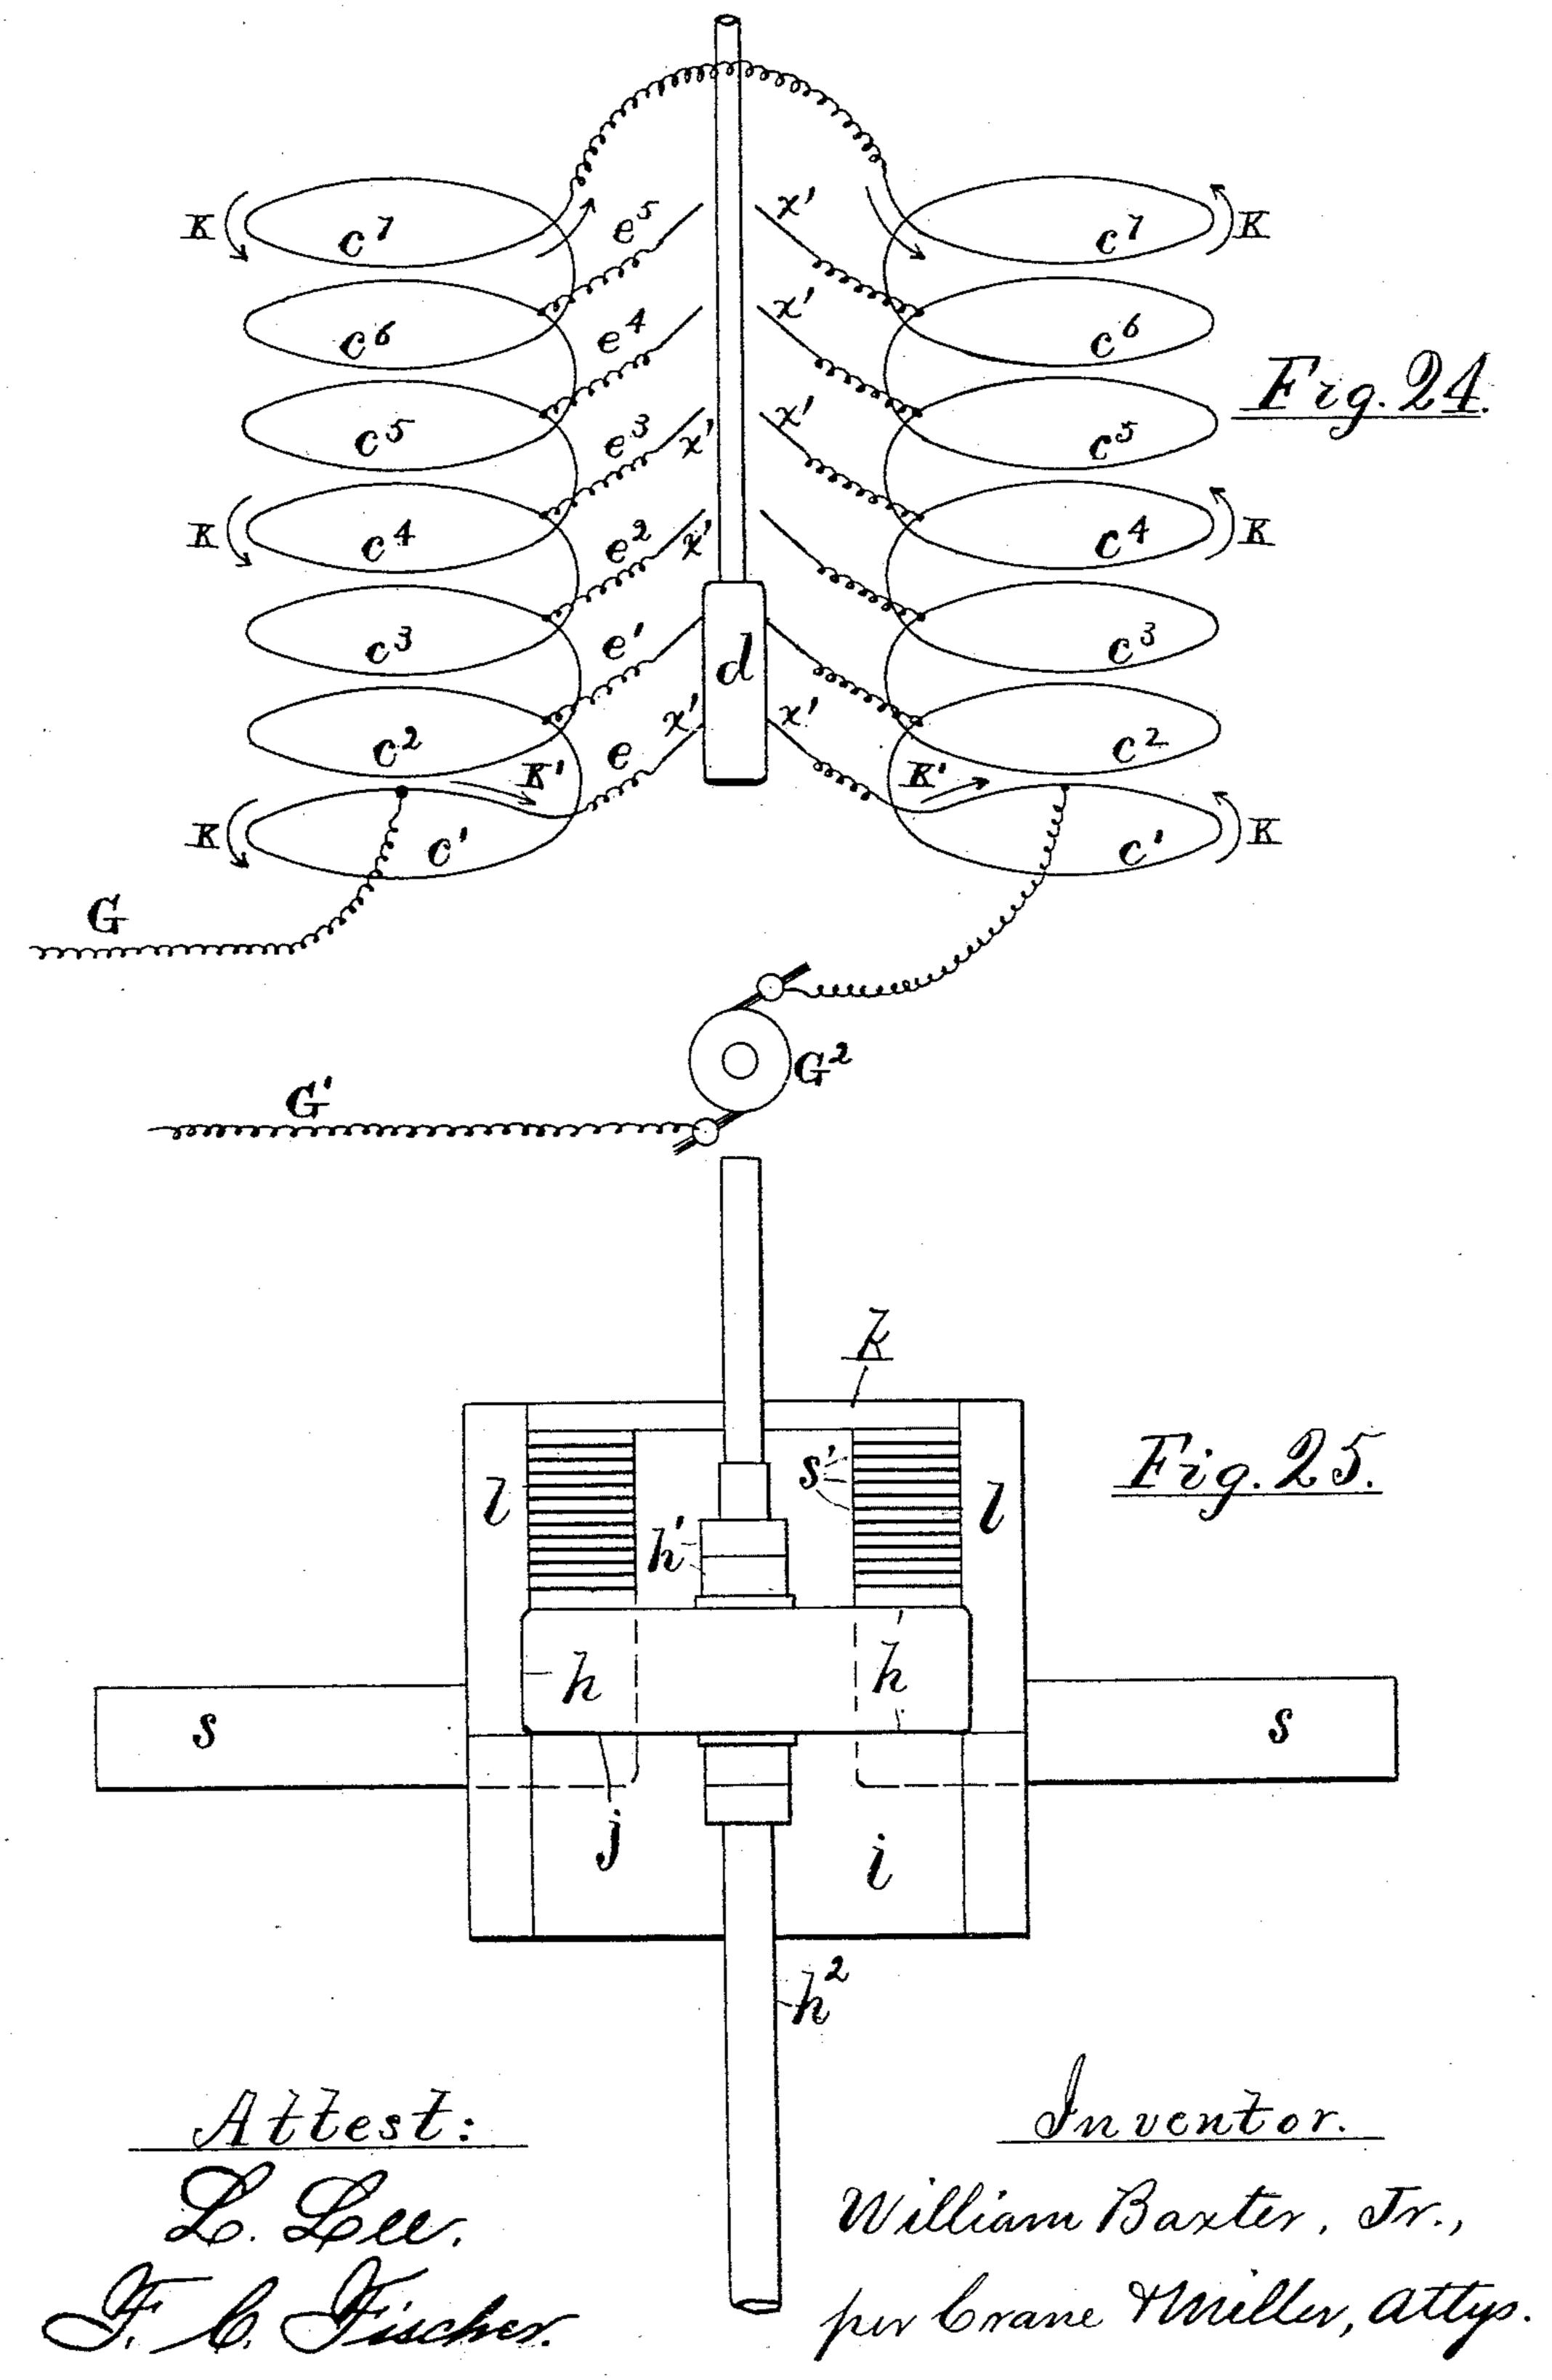

W. BAXTER, Jr. GOVERNOR FOR ELECTRIC MOTORS.

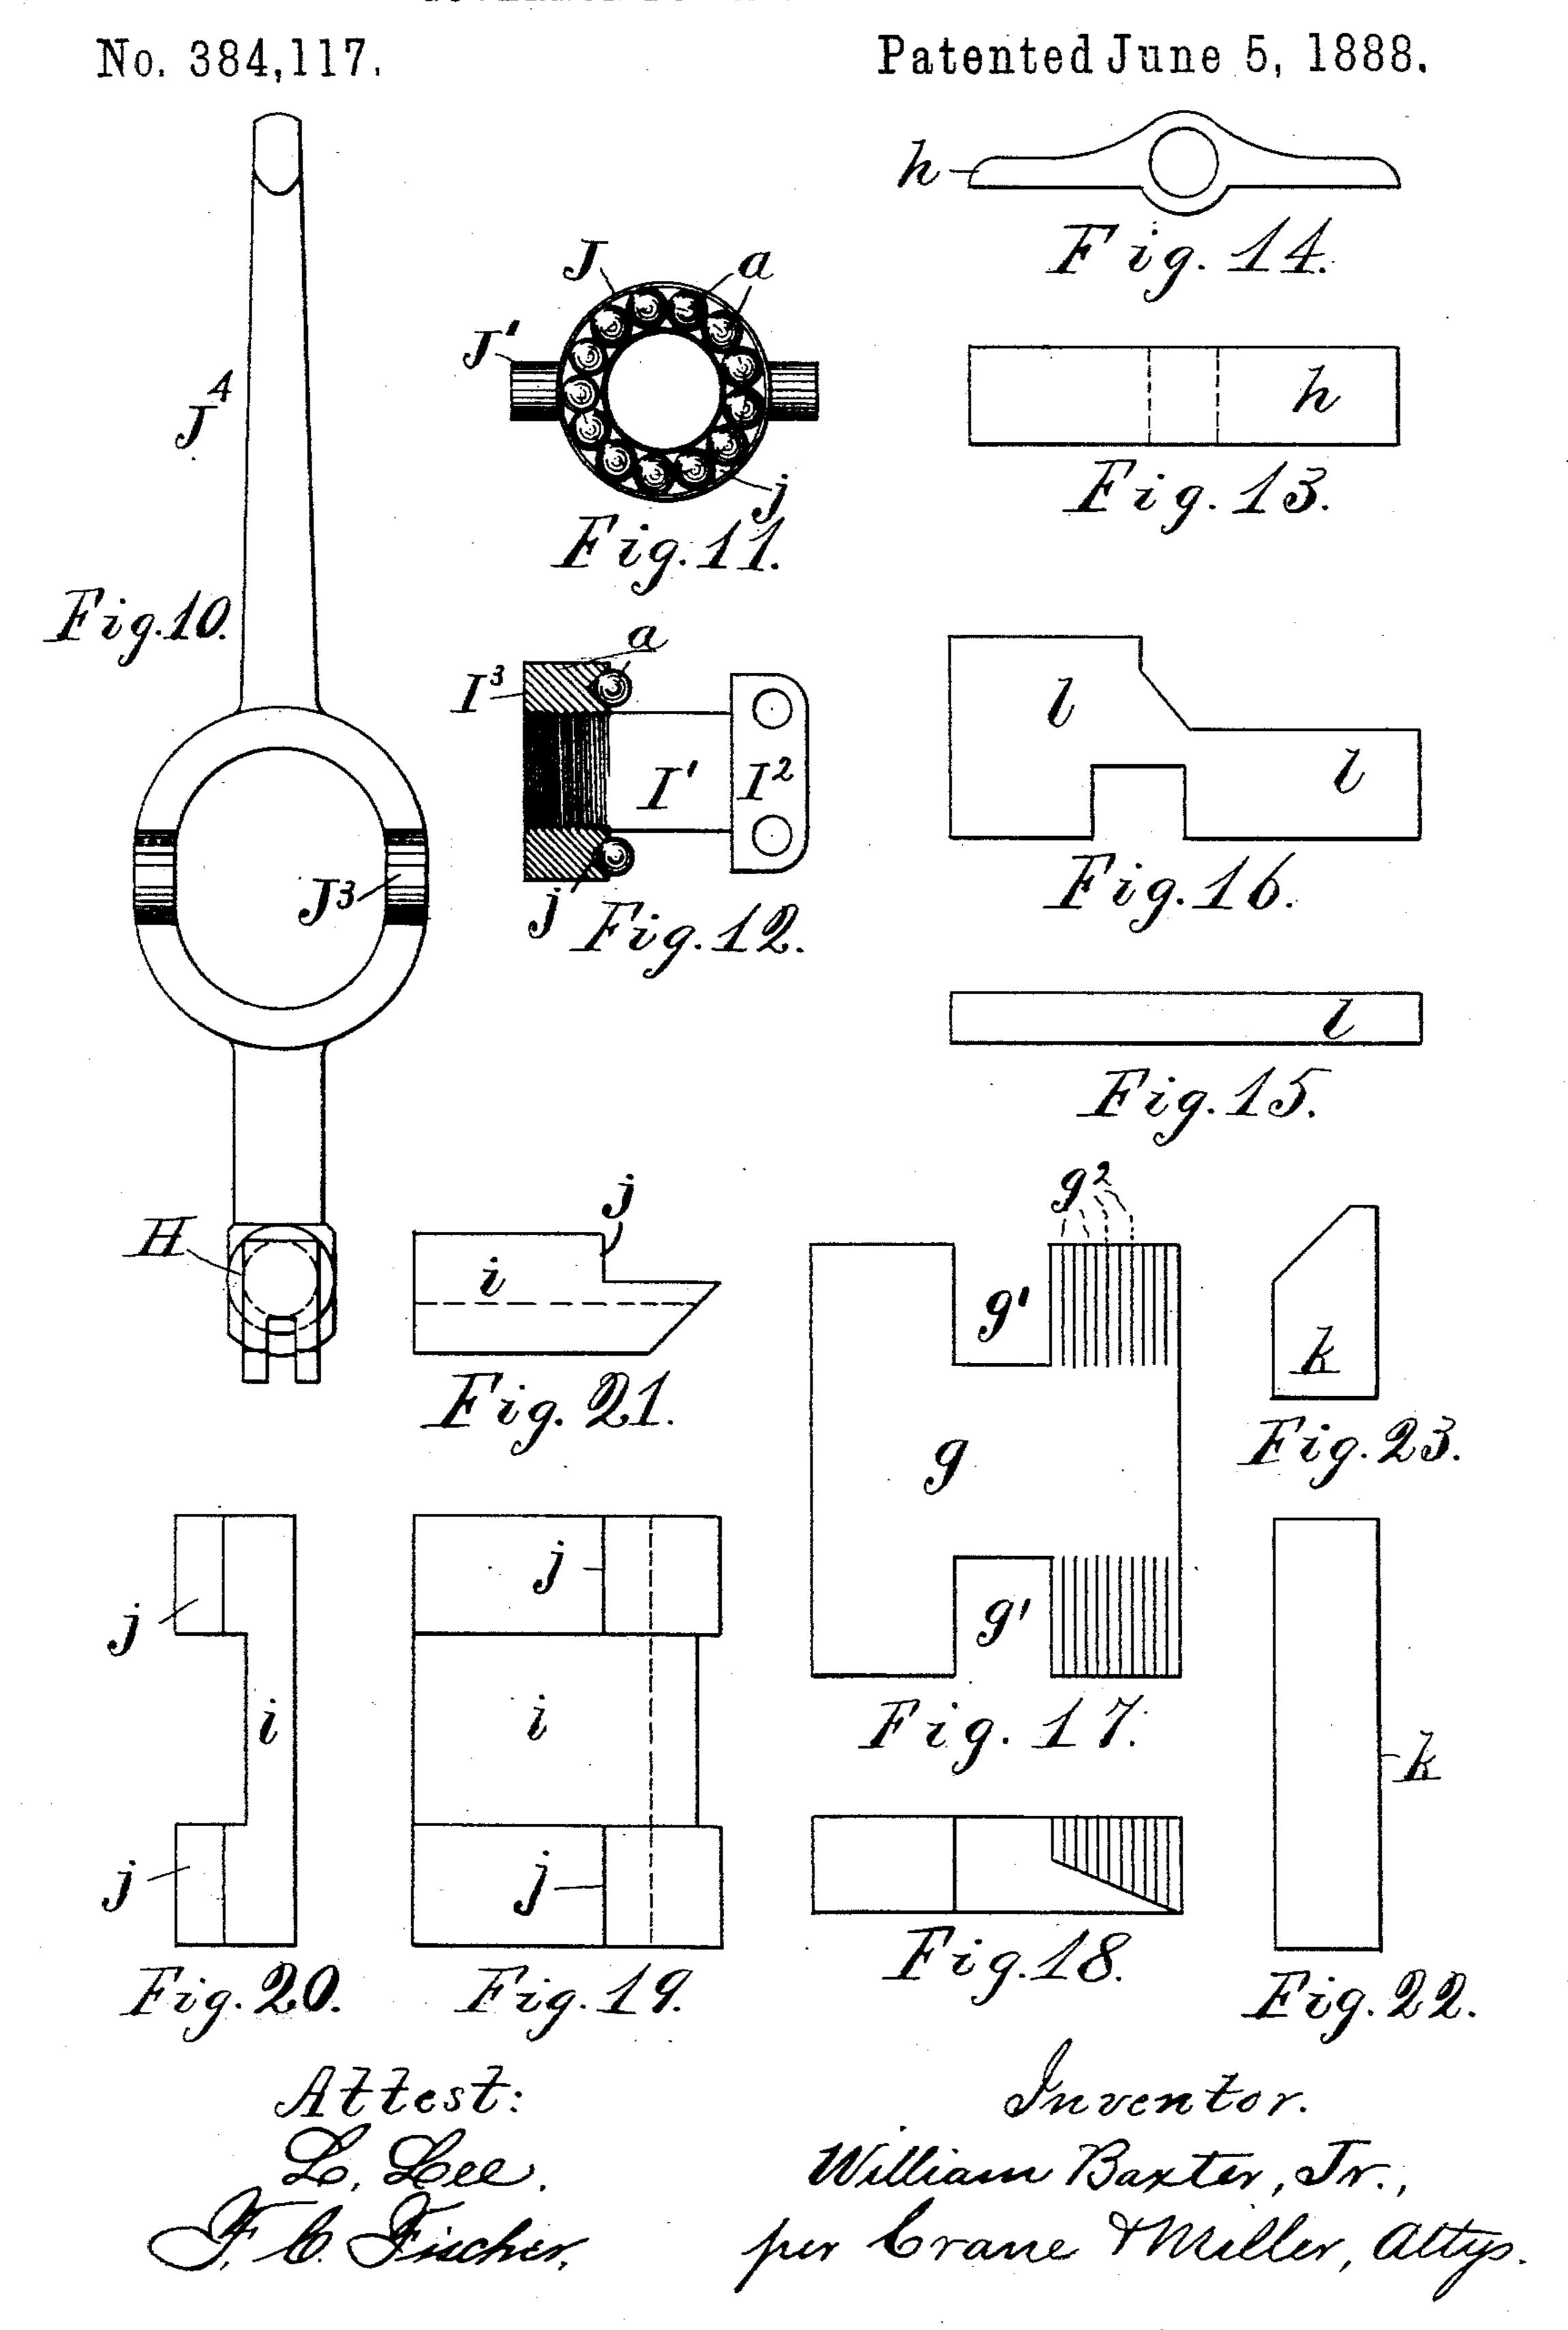

United States Patent Office.

WILLIAM BAXTER, JR., OF BALTIMORE COUNTY, ASSIGNOR TO THE BAXTER ELECTRIC MANUFACTURING AND MOTOR COMPANY, OF BALTIMORE, MARYLAND.

GOVERNOR FOR ELECTRIC MOTORS.

SPECIFICATION forming part of Letters Patent No. 384,117, dated June 5, 1888.

Application filed August 26, 1887. Serial No. 247,907. (No model.)

To all whom it may concern:

Be it known that I, WILLIAM BAXTER, Jr., a citizen of the United States, residing in the Ninth election district of the county of Baltimore, State of Maryland, have invented certain new and useful Improvements in Electric Motors with Governors, fully described and represented in the following specification and the accompanying drawings, forming a part of the same.

The object of this invention is partly to furnish a more compact and durable construction for the shunt-connections from the field-coils to a shunt-box, for which purpose I place the 15 shunt-box upon a bridge connecting the polepieces of the field-magnet and conduct the shunt-connections from the same point upon the coils over the pole-piece directly to the shunt-box. By extending all the connections 20 from the nearest point upon the coils to the shunt-box in such a location, and wrapping the connections firmly together and securing them to the pole-piece, I form a very direct conjunction of the coils and the contacts in the 25 shunt-box and protect the connections in the most effective manner from accidental derangement or injury.

My invention also consists, partly, in connecting with the field coils an auxiliary coil wound in an opposite direction and connected with a contact in the same shunt box as the connections from the various sections of the field coils, so that the same means may be employed to first close the circuit through the shunt-connections of the main coils and then through the auxiliary coil to react upon the residual magnetism of the field when the motor is very lightly loaded. By this construction the motor is prevented from running away (attaining an excessive velocity) when the motor is working under a very light load.

My improvement also consists in the combination, with the motor, of a governor lever having a tension spring applied to the leverarm at an acute angle to operate with a diminishing leverage upon the arm as the speed of the motor increases, and in the combination, with the motor armature shaft having a governor applied thereto and acting upon an arm

provided with such an opposing spring, of a 50 revolving thrust-ring connected with the governor-weights and provided with anti-friction balls fitted to a groove in such ring and to a collar upon the governor-arm, to diminish the frictional resistance imposed by the spring 55 upon such thrust-ring.

My improvements are especially adapted to motors which use a constant current such as is employed in arc-light circuits, and the speed of the motor is regulated by modifying the 50 strength of the magnetic field automatically by the action of the governor.

My invention will be understood by reference to the annexed drawings, in which—

Figure 1 is a side elevation of a motor pro- 65 vided with my improvements, certain parts of the governor being shown in section on their central line where hatched. Fig. 2 is an end view of the motor - frame and magnet - poles with the coils upon one magnet-core cut away 70 to the center line of the core and the wires blacked which connect with the strips $e e' e^2$, &c. Fig. 3 is a plan, with coils outside the first, in section, of one of the magnet-cores detached from the motor-frame and viewed at 75 right angles to its axis, with the elbow-pieces for connecting the coils to the shunt-box. Fig. 4 is an edge view, and Fig. 5 a plan, of the elbow-connections from the coils to the shuntbox; and Fig. 6 is a transverse section of the 80 elbow-connections on line x x in Fig. 5. Fig. 7 is a side view of the shunt-box with its connector and governor-rod. Fig. 8 is a plan of the same with the elbow connections at one side omitted, as well as the cover to the spring-85 holder and the connector and governor-rod; and Fig. 9 is a transverse section of the same on line x x in Fig. 7. Fig. 10 is an end view of the governor-lever. Fig. 11 is an end view of the governor-collar; Fig. 12, a side view of 90 the governor-sleeve; Figs. 13 and 14, a plan and end view of the shunt-block connector; Figs. 15 and 16, a plan and side view of the cheek-pieces for the shunt-box; Figs. 17 and 18 are a plan and side view of the spring 95 guide or holder. Figs. 19 and 20 are a plan and end view of the cap for the spring-holder; Fig. 21, an end view of the same, and Figs. 22

and 23 are a plan and end view of the spring abutment. Fig. 24 is a diagram showing the magnet-coils with their shunt-connections. In Fig. 8 the cap i, cheek-pieces l, and shunt-5 block h are removed; and Fig. 25 shows a plan of such parts with the springs s' and abutment k.

A is the frame of the motor, forming the bridge between the magnet-cores B and pro-10 vided with bearings C for the arbor of the armature D. These parts, as well as the governor-links E and their guard E', are similar to those shown in my United States Patent, No. 361,116, issued April 12, 1887. The governor 15 is mounted upon a shaft, F', extending from the end of the arbor F. The inner ends of the links are pivoted to rotate with a collar, I, affixed to the shaft, and the outer ends of the links are pivoted to a sleeve, I', (shown de-20 tached in Fig. 12,) and furnished at its inner end with a head, I², and at its outer end with a nut, I³. A collar, J, is fitted to the sleeve between the head and the nut, and provided with pivots J', which operate in sockets 25 J³ in a governor-lever, J⁴. The nut I³ and the collar J are each formed with an angular groove, j, and balls a are inserted in the groove (being shown in Figs. 11 and 12 both) to diminish the friction between the nut and collar 30 when the sleeve is drawn inward by the expansion of the governor-links. The lever is pivoted at j upon the guard E' and is furnished with an arm, H, having a tightening bolt, H', fitted in its outer end and connected with a 35 spring, H². The bolt is connected with the spring by an eye, H⁵, and is provided with a wedge-shaped block, H³, having sharp edges fitted to a forked bearing in the end of the arm Hand adjustable by a nut, H4, to vary the tension 40 of the spring. The spring is extended from the bolt at an acute angle with the arm H past the pivot j, and is attached to the frame A in such position that an increased speed of the gov-

ernor-links operates to extend the spring. The links are shown in Fig. 1 in the position assumed at their greatest velocity, and the spring operates, when the velocity is diminished, to draw the arm H downward and the sleeve I' outward, thus drawing the mass

55 of the links nearer to the shaft F'.

The movement of the eye H⁵ around the pivot j, as indicated by dotted line x' x', is not in a line with the spring, and therefore operates, as the spring retracts, to move the axis of the 55 spring gradually away from the pivot j, and to thus increase the leverage of the arm H. This increase in the force of the spring upon the arm H corresponds with the increased force of the governor when the links lie closer to the 60 shaft. If the resisting force of the spring remained constant while the governor force decreased, (with the changed relation of the links to the shaft at higher velocities,) the governor would not operate as desired; but the decreas-65 ing tension of the spring enables the governor to move the lever J4 through its whole range with a very slight increase of velocity, the

spring being adjusted in practice to just about balance the force of the governor at the beginning of its movement above the normal ve- 70

locity.

By properly proportioning the weight of the links and the strength of the spring to the normal velocity for which the motor is designed the resistance of the spring to the governor 75 may be made nearly uniform throughout its whole range of movement, so that a very slight increase of the centrifugal force will produce a great movement of the lever. The spring is readily adjusted by a nut, H⁴, and its tension 80 may thus be varied and the governor rendered

sensitive to any speed desired.

The velocity of the motor is regulated, as is sometimes done in constant current motors, without varying the position of the commu-85 tator-brushes, the intensity of the magnetic field being changed when it is necessary to vary the power of the motor by cutting out more or less of the magnet-coils which are wound around the magnet-cores B. My in 90 vention differs, however, from other constructions for the same purpose in leading the different shunt-connections of the magnet-coils from the same point upon the surface of the coil, and extending the same directly to the 95 shunt-box upon the bridge. By forming a notch in the flange at the inner end of the magnet-core the connections may all be conducted from the coils at the nearest point to the bridge, and may be bunched together and secured upon 100 the pole-piece in a single band, which is thus wholly protected from injury or accidental derangement.

The wrapping of the magnet is formed of a continuous wire with its primary end con- 125 nected with the circuit in any convenient man-

ner.

c' is the first coil extending between the flanges B' of each magnet-core, and c^2 , c^3 , c^4 , and so on are the exterior coils wrapped about the rec first, the terminal of the final coil being arranged to connect with the terminal of the opposite magnet-coil, or with the commutatorbrushes, in the usual manner.

When operating with a full load, the current 115 enters the first coil upon one side, and after traversing all the other coils passes through the coils upon the other side, and thence through the commutator and armature to line. To diminish the intensity of the magnetic field 120 in any desired degree, I extend a shunt connection formed of a flat strip, $e e' e^2$, &c., from each coil (or from any other preferred section of the magnet-helix) to a shunt-box, where a shunt block or connector, d, may operate to unite 125 the similar coils upon the opposite magnetcores, (and thus cut out part of the field-wires on both cores simultaneously,) or to shortcircuit the layers of each coil individually, as may be preferred.

In Fig. 24 is shown by a diagram the operation of these shunt-connections, the lines c', c^2 , c^3 , c^4 , c^5 , and c^6 representing an equal number of coils upon the opposite magnet-cores.

130

384,117

G represents the positive-current wire, G' field is thus not only deprived of its normal the negative, G^2 the commutator, and e', e^2 ,

and so on, the strips or shunt-connections from the several coils, terminating in springs

5 in the shunt-box.

A shunt-block, d, is arranged to move over the ends of the springs x' to unite electrically any of the similar connections, $e'e^2$, &c. The shunt-block d is made, in practice, long enough 10 to cover all the springs x' at once, to prevent its rear end from catching upon their ends when the block is retracted. As the block may thus cover any number of the springs under one of its ends, it may operate, if such 15 springs form the terminals of suitable circuit, to short-circuit either or both of the magnetic coils independently of the other. When the block is withdrawn from all the springs, the current passes through all the coils and pro-20 duces a field of maximum intensity; but if the pair of coils farthest from the connection G are united by placing the block d in contact with the springs x' it is obvious that the coils c^6 would be entirely cut out of the circuit and 25 the intensity of the magnetic field correspondingly diminished. In like manner, if the block be placed in contact with the springs attached to the connections e^{ϵ} , two coils would be cut out of the circuit, and if the block be placed 30 in contact with the springs attached to the connections e the current would pass directly to the commutator through such block, and all the magnet-coils would be cut out. The motor would then be destitute of power and 35 motion, but for the residual magnetism in the metal of the poles, which in practice is sufficient to rotate the armature at a high velocity when propelling a very light load, or when the belt is suddenly thrown off.

To maintain a constant speed when the work to be done is less than the power which the residual magnetism will develop, I provide means to send an electric current around the magnet-cores in a reverse direction, the neu-45 tralizing effect of such current balancing the difference between the force required and that which the residual magnetism can develop. The line-wire is not, therefore, connected with the first turn of the coil c', but to a point, c, 50 several turns distant from its beginning. Such turns are therefore wholly outside of the circuit on its passage through the coils $c' c^2 c^3$, and so on, but afford a means of throwing a reverse current directly around the magnet-55 cores by connecting the first of such turns through the sections e with the shunt-box, where they may be connected by the block d

when it is desired to thus reverse the current. In Fig. 24 the normal movement of the cur-60 rent is shown by the arrows K, while the movement of the reverse current is clearly indicated by the arrows K', applied to that portion of the coil c' which is connected with the springs e. The connection of such springs by 65 the block d furnishes a short circuit for the current by cutting out the remainder of the coil c' and the coils c^2 c^3 , &c, and the magnetic |

magnetism, but its residual polarity is reduced or reversed in the degree required to main- 70 tain a constant armature velocity. The number of turns required upon a given magnet to produce this effect is readily determined in practice, and the practical construction for making the connections e e', &c., is shown in 75 Figs. 2 and 3 applied to the magnet-cores, and in Figs. 7, 8, and 9 connected with the shuntbox.

The primary connection G is shown in Fig. 3 applied to the eighth turn c of the coil c', 80 while the flat connection e is shown applied to the first turn, and carried along the magnetcore beneath the whole of the first layer, from which it is extended through a notch, s3, in the flange B' of the pole-piece to an elbow- 85 piece, s, connected with the shunt-box.

The connections e are shown in the drawings formed of flat copper strips, which are readily arranged and insulated between the several coils, and are extended along the heads B4 of 90 the pole-pieces nearly to the shunt-box L, which is secured between the ends of the polepieces over the top of the armature.

The shunt-box is shown formed with a series of flexible springs connected in pairs with the 95 opposed ends of the strips $e' e^2$, &c., and sustained adjacent to one another in a spring guide or holder, g, over which a shunt-block, h, is moved by the governor, as required.

The spring guide or holder is shown in Fig. 100 S, as also in the dotted view in Figs. 17 and 18, as a block of wood or analogous material, with notches g' in its opposite edges to receive elbow-connections from the springs, and formed with vertical slits g^2 in its opposite edges, 105 through which the springs project upward into the path of the shunt-block h. A cap, i, beveled at its forward end adjacent to the springs, is fitted over the guide or holder g to support the block h when retracted from the springs, 110 and is formed with stops j to then arrest the block.

An abutment, k, is inserted in the shunt-box in front of the springs, and caps l (shown only in Figs. 15 and 16) would be placed at each 115 side of the pieces g and i, at the points indicated at l' in Fig. 8, to keep the springs in the stits g^2 .

The parts g, i, k, and l would be formed of wood or other insulating material, and would 120 be secured in the spring-box by suitable fastenings.

The block h is insulated and secured by nuts $d \mid h'$ adjustably upon a rod, h^2 , connected with the governor-lever j^4 , and moved thereby with 125 the varying velocity of the armature.

To press the rod toward the springs to make a positive electrical contact therewith, a roller, h^3 , is mounted upon the shunt-box l over a part of the rod h^2 , and is provided with a screw- 130 shank, m, fitted to a standard, n, upon the shunt-box and adjustable by means of threaded nuts n'.

The top of the abutment k is inclined, like

the end of the cap i, and the springs are bent to a similar angle, so as to yield readily as the block moves over them, and the last spring, which is connected with the strip e, is made 5 longer than the others and laid upon the inclined face of the abutment, so that the shuntblock may press it hard upon the same to form a more perfect connection therewith when the operation of the governor is intended to cut 10 off all the direct field-coils from the electrical circuit and to react on the polarity of the magnet to reduce the residual magnetism.

The motion of the rod h^2 when transmitted from the governor lever is parallel with the 15 armature-arbor, while the shunt connections from the magnet-coils are conducted at right angles to the armature to reach the shunt-box by the shortest course. To join the shunt-connections with the springs, I therefore provide 20 the latter with elbow-pieces s. The elbowpiece is formed integral with the spring s', and while the springs extend in the direction of the armature arbor the elbow-pieces extend at right angles thereto, and thus project directly 25 over the heads of the pole-pieces toward the flange s^2 , which holds the field-connections upon the pole-pieces in place. A notch, s³, is formed in the flange in line with the elbowpieces, and all the strips, e', e^2 , &c., which ex-30 tend from the different field-wire coils, are thus brought directly into line with the elbowpieces to make the shortest possible connection therewith.

As shown in Figs. 2 and 3, the strips $e'e^2$, 35 &c., are clamped upon the head B'alternately with the elbow-pieces s, each strip making an electrical connection with one of the springs, with paper or equivalent insulation inserted between each pair of connections, as is shown 40 in the edge view of a part of such connections in Fig. 4 and the section in Fig. 6.

The clamp st is merely a plate pressed upon the group of connections by screws s5, and the entire bundle or bunch of connections would 45 be preferably enveloped with a non-conducting and waterproof coating, s6, as shown in

Fig. 6. Heretofore it has been common in dividing the field-coils into different sections to form 50 shunt-circuits, to extend the electrical connections from the different coils outward between the wires at different points upon the surface of the field-coils; but it will be noticed that my arrangement differs from such construction 55 in the use of the flat strips $e'e^2$, &c., which enable me to extend all my shunt-connections

from different points within the coils under or between the same to a single point, as the notch s³ in the flange, which holds the coils in 50 place, and to form the several shunt-connections into a compact bundle which may be thoroughly protected from accident or derangement, while its several conductors may be readily connected with a suitable shunt-box.

65 I thus avoid the liability to damage and derangement which occurs when the various shunt-connections are extended separately

from the coils at different points and require to be separately led to binding-posts or to a switch-board to form the desired shunt-con- 70 nections.

I hereby disclaim the division of the fieldcoils into sections to form shunt-circuits and the regulation of the magnetic field by directing the current into more or less of such cir- 75 cuits, as I am aware that such a construction is old, and that the regulation has also been effected by shunting the current as required through reversing-coils, through which the current passes in a direction opposite to that in the 80 field-coils.

My present invention, so far as it relates to the connection of the shunt-coils with the shunt-box, consists in the mechanical arrangements adopted for protecting the shunt-con-85 nections where they are extended from the coil to the shunt-box, and for uniting such shunt-connections with the contact-pieces in the shunt-box.

I am not aware that any one has heretofore 90 connected a single auxiliary coil with the circuit-wires and wound it upon the cores in the opposite direction from the main coils and operated it when the connection was first shunted from the main coils to react upon the 95 residual mechanism of the field in the manner described herein.

I am aware that it is common to use a spiral spring upon a governor-lever to oppose the centrifugal force of the governor, and my 100 claim herein is therefore limited to the attachment of the spring to a governor-arm at an acute angle, so as to operate with a diminishing leverage upon the governor arm as the speed of the motor increases.

Having thus set forth my invention, what I claim is--

105

1. In an electric motor having the polepieces united by a bridge, the combination, with a series of coils wound upon the field-mag- 110 net cores, of the shunt-connections $e e' e^2$, &c., united with the several coils at intervals and extended from the surface of the magnet-coils (at the same point) to the bridge from opposite sides thereof, a shunt-box upon the bridge 115 between the pole pieces, with contacts united to the said shunt-connections, a shunt-block or connector, and a centrifugal governor actuated by the motor for successively closing the circuit through the shunt-connections, as and 120 for the purpose set forth.

2. In an electric motor, the combination, with the series of coils wound upon the magnet-cores, of a series of shunt-connections connected with the several coils at intervals, 125 means, as a shifting block or piece, for closing successively the electrical circuit through the several shunt-connections, a centrifugal governor mounted upon the armature arbor or shaft, a lever actuated by such governor to 130 operate the shunt-connector, an arm attached to such lever, and a tension-spring resisting the centrifugal force of the governor and arranged at an acute angle with the said arm to

384,117

operate with a diminishing leverage upon the arm as the speed of the motor increases, as

and for the purpose set forth.

3. In an electric motor, the combination, 5 with the main coils upon the magnet-cores, of an auxiliary coil connected with the line or circuit wires and wound upon the cores in the opposite direction from the main coils, a shuntconnection from the ends of such auxiliary 10 coils, shunt-connections attached at intervals to the main coils, contact-pieces attached to such shunt-connections, and a moving contact operating in connection with the same to first close the circuit through the shunt-connec-15 tions of the main coils, and to subsequently close the shunt-connections from the auxiliary coil to cause a reaction upon the residual magnetism of the field when the motor is very lightly loaded, substantially as herein set 20 forth.

4. In an electric motor, the combination, with the first coil of wire wound upon the magnet-cores, of the line or circuit connection attached to the coil between its ends, an elec-25 trical connection from one end of the coil to the other coils, and a shunt-connection from the opposite end of such coil, and means for closing the circuit through such shunt-connection to react on the residual magnetism of the 30 field, as and for the purpose set forth.

5. In an electric motor, the combination, with magnet-cores having poles at opposite sides of the armature, of the magnet-coils wound upon such cores, a shunt-box mounted

35 upon a bridge between the ends of the poles, shunt-connections attached at intervals to the main coils and terminated in electrical connections adjacent to one another in the shuntbox, a governor mounted upon the armature-40 shaft, and a connector moved thereby to successively close the several shunt-circuits and

thus cut out the successive sections of the main coils from the circuit, as and for the purpose set forth.

6. In an electric motor, the combination, with magnet-cores having poles at opposite sides of the armature, of the main coils wound upon such poles, a shunt-box mounted upon a bridge between the ends of the poles, shunt-50 connections formed of metallic strips attached at intervals to the main coils, with the latter wrapped over the same, and the said strips l

terminated in electrical connections adjacent to one another in the shunt-box, a governor actuated by the motor, and a connector moved 55 thereby to successively close the several shuntcircuits and thus cut out the successive sections of the main coils from the circuit, as and for

the purpose set forth. 7. In an electric motor provided with a 60 bridge between the pole-pieces and a shuntbox mounted upon said bridge, the combination, with the cores, of flanges upon the same,

field-coils wound between said flanges, shuntconnections attached at intervals to the field- 65 coils, with the latter wrapped over the same, a notch, s^3 , in one of the flanges, and the shuntconnections brought together and extended

through such notch in a single band to the shunt-box, as and for the purpose set forth. 70

8. In an electric motor, the combination, with a bridge between the pole-pieces and a shunt-box mounted upon said bridge, of the magnet-cores, field-coils wound upon said cores, shunt-connections attached at intervals 75 to the field-coils (with the latter wrapped over the same) and extended from the coils toward the shunt-box upon the bridge, elbow-pieces ss', having each one arm fitted in the shuntbox to form a contact-surface and the other So arms extended upon the pole-pieces between the several shunt-connections, insulating material between the several shunt-connections, and a clamp pressing such connections and set forth.

elbow-pieces together, as and for the purpose 85 9. In an electric motor, the combination,

with a bridge between the pole-pieces and a shunt-box mounted upon said bridge, of the magnet-cores, field coils wound upon said cores, 90 and shunt - connections formed of flat strips of thin sheet metal attached at intervals to the field-coils and extended beneath the several layers of the field-coils to the same point upon the exterior of the latter and to the shunt-box 95 upon the bridge and connected with contacts therein, as and for the purpose set forth.

In testimony whereof I have hereunto set my hand in the presence of two subscribing

witnesses.

WM. BAXTER, JR.

Witnesses:

C. R. GALLAGHER, HENRY S. THOMPSON.

 $\ddot{5}$